

This is a digital copy of a book that was preserved for generations on library shelves before it was carefully scanned by Google as part of a project to make the world's books discoverable online.

It has survived long enough for the copyright to expire and the book to enter the public domain. A public domain book is one that was never subject to copyright or whose legal copyright term has expired. Whether a book is in the public domain may vary country to country. Public domain books are our gateways to the past, representing a wealth of history, culture and knowledge that's often difficult to discover.

Marks, notations and other marginalia present in the original volume will appear in this file - a reminder of this book's long journey from the publisher to a library and finally to you.

Usage guidelines

Google is proud to partner with libraries to digitize public domain materials and make them widely accessible. Public domain books belong to the public and we are merely their custodians. Nevertheless, this work is expensive, so in order to keep providing this resource, we have taken steps to prevent abuse by commercial parties, including placing technical restrictions on automated querying.

We also ask that you:

+ *Make non-commercial use of the files* We designed Google Book Search for use by individuals, and we request that you use these files for personal, non-commercial purposes.

+ *Refrain from automated querying* Do not send automated queries of any sort to Google's system: If you are conducting research on machine translation, optical character recognition or other areas where access to a large amount of text is helpful, please contact us. We encourage the use of public domain materials for these purposes and may be able to help.

+ *Maintain attribution* The Google "watermark" you see on each file is essential for informing people about this project and helping them find additional materials through Google Book Search. Please do not remove it.

+ *Keep it legal* Whatever your use, remember that you are responsible for ensuring that what you are doing is legal. Do not assume that just because we believe a book is in the public domain for users in the United States, that the work is also in the public domain for users in other countries. Whether a book is still in copyright varies from country to country, and we can't offer guidance on whether any specific use of any specific book is allowed. Please do not assume that a book's appearance in Google Book Search means it can be used in any manner anywhere in the world. Copyright infringement liability can be quite severe.

About Google Book Search

Google's mission is to organize the world's information and to make it universally accessible and useful. Google Book Search helps readers discover the world's books while helping authors and publishers reach new audiences. You can search through the full text of this book on the web at `http://books.google.com/`


NYPL RESEARCH LIBRARIES
3 3433 06909703 2





3-VGM
Hawkin










Dup. to
Be Kept





THE NEW YORK
PUBLIC LIBRARY

ASTOR, LENOX AND
TILDEN FOUNDATIONS

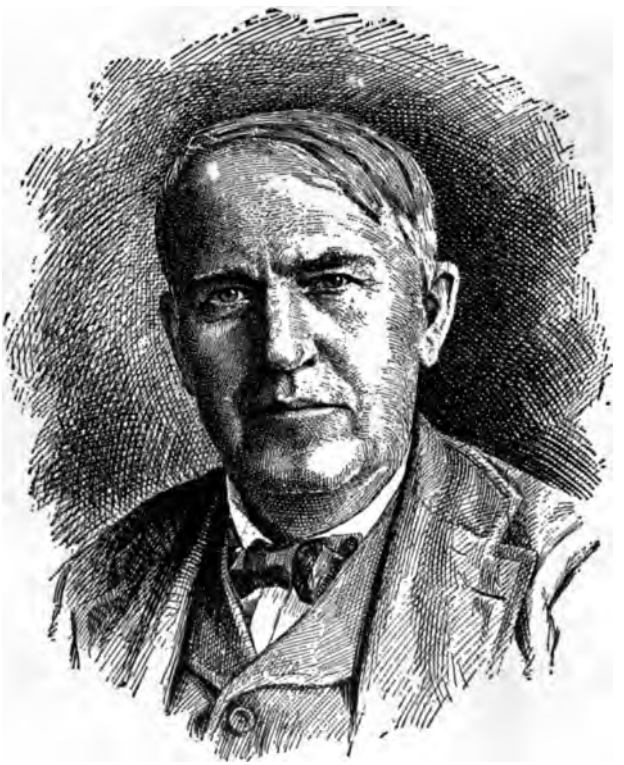

Thomas A. Edison

[redacted]

THE THOUGHT IS IN THE QUESTION THE INFORMATION IS IN THE ANSWER

HAWKINS

ELECTRICAL GUIDE

NUMBER ONE

QUESTIONS ANSWERS & ILLUSTRATIONS

A PROGRESSIVE COURSE OF STUDY FOR ENGINEERS, ELECTRICIANS, STUDENTS AND THOSE DESIRING TO ACQUIRE A WORKING KNOWLEDGE OF

ELECTRICITY AND ITS APPLICATIONS

A PRACTICAL TREATISE

BY

HAWKINS AND STAFF

THEO. AUDEL & CO. 72 FIFTH AVE. NEW YORK



THE NEW YORK
PUBLIC LIBRARY
677767 A
ASTOR, LENOX AND
TILDEN FOUNDATIONS
R 1933 L

COPYRIGHTED, 1914,
BY
THEO. AUDEL & CO.,
NEW YORK.

Printed in the United States.

PREFACE

The word "guide" is defined as:

One who leads another in any path or direction; a person who shows or points out the way, especially by accompanying or going before; more particularly, one who shows strangers or tourists about; a conductor; leader, as "let us follow our guide."

*This book, or "**Guide,**" is so called because it **leads** or **points out the way** to the acquirement of a theoretical and practical knowledge of Electricity.*

*There are several guides, each covering in detail a certain phase of the broad subject of Electricity and leading the reader progressively, and in such a way, that he easily grasps, not only the simple fundamental facts, but the more complex problems, encountered in the study of Electricity. This is accomplished by the aid of a **very large number of illustrations,** together with specific explanations, worded in **concise and simple language.***

The Guides are written partly in the question and answer form, as this style of presentation has met with hearty approval, not only from those of limited eaucation, but also from the better informed.

Where recourse is had to the question and answer form, the speci*aim of the author has been to give short* and direct answers, in s

SEP 1933
TRANSFER FROM C.C.



plain language as to preclude a misconception of the meaning. With this in view, ***the answer gives*** *simply* ***the information sought by the question.***

The answer is limited to one paragraph *so that the reader may concentrate upon the fact or facts demanded by the question.*

Any enlargement of the answer or specific explanations of items contained therein, are presented in separate paragraphs printed in ***smaller*** *type.*

With this plan of ***separating the answer,*** *as it were, from items of secondary importance, and making it short and simple, its content is more forcibly impressed upon the mind of the reader.*

In a text book, it is necessary to illustrate and explain the various species of commercial apparatus met with in practice, and in this connection the Publishers desire to call attention to the manner in which the author has treated what may be classed as the ***"descriptive matter."*** *Contrary to the usual custom of giving descriptions of commercial machines in the main text, where they would occupy considerable space, to the exclusion of the more important matter, all such descriptions are placed in small type directly under the illustrations, leaving space for an adequate presentation of the underlying* ***principles, theories,*** *and for the large amount of* ***practical information*** *that is essential to obtain a general knowledge of Electricity and its numerous applications.*

Credit is largely due to Frank D. Graham, B.S., M.S. (Princeton University), and M.E. (Stevens Institute), practical engineer, for the authorship of the ***Guides,*** *and for original sketches illustrating electrical principles and construction.*

TABLE OF CONTENTS GUIDE NO. 1.

ELECTRICITY - - - - - - - - - - - - 1 to 4

Nature and source—**kinds of electricity: static, current, dynamic, radiated, positive, negative, atmospheric, frictional, resinous, vitreous.**

STATIC ELECTRICITY - - - - - - - 5 to 26

Electrical **attraction and repulsion** — the charge — distribution of the charge — free and bound electricity — conductors and insulators — **electroscopes** — gold **leaf** electroscope — electric screens — electrification by induction — nature of the induced charge — the electrophorus — **condensers**; Leyden jar — **electric machines** — **action** of Toepler-Holz machine — Wimshurst machines.

THE ELECTRIC CURRENT - - - - - 27 to 34

Volt — ampere — ohm — **Ohm's law** — production of the electric current—current strength—voltage drop in an electric current.

PRIMARY CELLS - - - - - - - - - - 35 to 67

The word "battery" — action of cell — chemical changes; polarization — effects of polarization — methods of depolarization — depolarizers — depolarizer bag — Volta's contact **law** — contact series of metals — **laws of chemical action in cell** — requirements of a good cell — **single and two fluid cells** — the Leclanche cell — Fuller bichromate cell — the Edison cell—Grenet bichromate cell — Daniell cell — directions for making a Daniell cell — gravity cells — Daniell *gravity cell* — *so called "dry"* cells — **points relating to dry cells** — *care of cells* — cleanliness — separating *the elements* — *creeping* — **amalgamated** zinc — **battery connections.**



CONDUCTORS AND INSULATORS - - 68 to 74

The so called "non-conductors"— **table of conductors and insulators** — mode of transmission — effect of heat— heating effect of the current — **insulators** — impregnating compounds — water as a conductor.

RESISTANCE AND CONDUCTIVITY - 75 to 82

Standard of resistance — conductivity of metals and liquids — effect of heat — **laws of electrical resistance** — conductivity — specific conductivity — **divided circuits.**

ELECTRICAL AND MECHANICAL ENERGY - - - - - - - - - - 83 to 92

Definitions: energy, matter, molecule, work, foot pound, volt coulomb, ampere hour, power, horse power, **watt,** kilowatt, watt hour — mechanical equivalent of heat — **British thermal unit** — **electrical horse power** — the farad.

EFFECTS OF THE CURRENT - - - - 93 to 104

Thermal effect — use of heat from the current — magnetic effect — chemical effect — **electrolysis** — electrochemical series — electric osmose — electric distillation — muscular contractions — **electroplating** — electrotyping.

MAGNETISM - - - - - - - - - - - 105 to 124

Two kinds of magnetism — nature of each — **poles** — magnetic field — magnetic force — **magnetic circuit** — — magnetic flux — the Maxwell — the Gauss — **magnetic effect of the current** — corkscrew rule — solenoids — permeability — magnetic saturation — magnetomotive force — **reluctance** — analogy between electric and netic circuits — **hystereses** — residual magnetism.

ELECTROMAGNETIC INDUCTION - - 125 to 136

Faraday's discovery — Faraday's machine — Faraday's principle — line of force — induction of current — laws of electromagnetic induction — rules for direction of induced *current — Fleming's rule* — Ampere's rule — the palm rule — *self-induction.*

INDUCTION COILS - - - - - - - - - 137 to 154

Self-induction — mutual induction — **primary induction coils** — **secondary induction coils** — plain secondary induction coils — secondary induction coils with vibrator and condenser; **cycle of action** — magnetic vibrators — vibrator adjustment — table of induction coil dimensions — table of sparking distances in air — **points relating to induction coils** — wiring diagram.

THE DYNAMO - - - - - - - - - - 155 to 160

Operation — **essential parts** — field magnets — armature — **construction of dynamos** — parts; bed plate, field magnets, armature, commutator, brushes.

THE DYNAMO: BASIC PRINCIPLES - 161 to 170

Definitions — essential parts — **elementary alternator** — operation — direction of induced current — application of Fleming's rule — cycle of operation — **the sine curve; its construction and application.**

THE DYNAMO: CURRENT COMMUTATION - - - - - - 171 to 180

How the current is produced — **how direct current is obtained** — the commutator — inductors — "continuous current" — action of four coil elementary dynamo — **conditions for steadiness of the current.**

CLASSES OF DYNAMO - - - - - - - 181 to 198

Classification — bipolar and multipolar dynamos — difference between dynamo and magneto — self exciting dynamo — **the series dynamo** — regulation of series dynamo; difficulties experienced — **the shunt dynamo** — adaptation — operation — characteristic — regulation — **the compound dynamo** — service intended for — regulation — over compounding — usual degree of over compounding — short shunt — long *shunt* — voltage of short and long *shunt machines* — *separately* excited dynamos — **Dobrowolski three wire dynamo.**

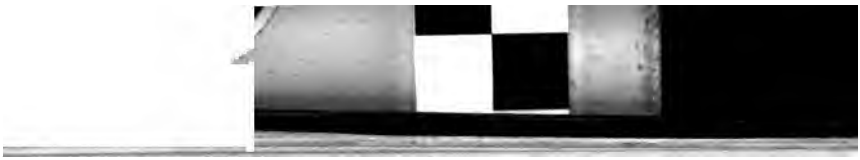


TABLE OF CONTENTS; GUIDE NO. 1

FIELD MAGNETS - - - - - - - - - 199 to 230

Object — essential parts — **classes of field magnet** — multipolar field magnets — construction — choice of materials — design — **pole pieces** — eddy current — **laminated fields** — construction to reduce reluctance of the magnetic circuit — magnetizing coils — **methods of winding** — **coil ends** — insulation — attachment of coils — **coil connections** — **heating** — ventilation.

INTRODUCTORY CHAPTER

The subject matter of this work relates to one of the secrets of creation which appears to have been intended at the very beginning to be "sought out." This idea is expressed in a certain saying copied three or four thousand years ago by the men of Hezekiah, King of Judah: from Solomon's proverbs: "*It is the glory of God to conceal a thing*: *But the glory of Kings* (i.e., *wise men*), *to search out a matter.*"

In all that may be said hereafter through the work, it is admitted that the results recorded are the determinations of experiments performed by an incredible number of searchers extending through many ages. These inquiries have been pursued with a generous rivalry which has permitted discovery to be added to discovery, until the sum total has been wrought into such exactness that it has been thoughtlessly stated that there is nothing more, save its application.

It may be well, however, to state a few fundamental facts relating to electricity: 1, Electricity and magnetism are one and the same thing; 2, what is really known about it has come as a discovery and *not as an* invention. Thus, we say the *intrepid explorer discovered* the pole, not that he inven



So with electricity it has been a subject of discovery while its many applications to useful purposes have been veritable inventions; 3, the earth itself is a magnet.

This last is shown by the fact that the earth affects a magnet just as one magnet affects another. Magnets are bodies, either natural or artificial, which have the property of attracting iron, and the power, when freely suspended, of taking a direction toward the poles of the earth. The natural magnet is sometimes called the *loadstone*. This word is said to be derived from *loedan*, a Saxon word which signifies to guide. It is an oxide of iron of a peculiar character, found occasionally in beds of iron ore. Though commonly met with in irregular masses only a few inches in diameter, however, loadstones of larger sizes are sometimes found.

By means of simple experiments it may be ascertained that the magnet has the following general properties, viz: 1, power of attraction; 2, power of repulsion; 3, power of communicating magnetism to iron or steel; 4, polarity, or the power of taking a direction toward the poles of the earth; 5, power of inclining itself toward a point below the horizon.

Speaking generally we may say, that magnetism is a department of electrical science which treats of the properties and effects of the magnet. The same terms are also used to denote the unknown cause of magnetic phenomena, as when we speak of magnetism as excited, imparted, and so on.

Lightning and the Northern Lights are displays of electricity on a grand scale. Electricity is a term derived from the Greek word for *amber*, that being the substance in which a property of the agent now denominated electricity was first *observed*.

The ancient Greek philosophers were acquainted with the fact that amber, when rubbed, acquired the property of attracting light bodies; hence the effect was denominated electrical and in later times, the term electricity has been used to denote the unknown cause of electrical phenomena, and broadly the science which treats of electrical phenomena and their causes.

Electricity, whatever it may prove to be, is not *matter* nor is it *energy*; it is however a means or medium of transmitting energy.

> If electricity is to transmit or convey energy along a wire, this energy must be imparted to the electricity from some external source, that is to say, before electricity can perform any work it must be set in motion, against more or less resistance. This involves that pressure must be applied, and to obtain this pressure, energy must be expended from some external source.

Accordingly, in electrical engineering, the first principle to be grasped is that of *energy*. Without the expenditure of energy no useful work can be accomplished.

Energy may be defined as *the capacity for performing work.*

Although electricity is not energy, electricity under pressure is a form of energy spoken of as electrical energy.

In an expenditure of energy in this form, the electricity acts simply as a transmission agent or medium to transmit the energy imparted to it in causing it to flow.

> In a similar manner, steam acts as a transmission agent or medium to transmit the heat energy of the coal to the steam engine, where it is converted into mechanical energy.

As just stated, electricity under pressure is a form of energy, and its generation is simply a transformation of energy from one form into another. Usually, mechanical energy is converted into electrical energy, and a dynamo is employed for effecting the transformation.



In transforming the mechanical energy of waterfalls into electric energy, this natural power of water due to its weight and motion is first converted into rotary motion by a turbine or water wheel, and then converted into electric energy by a dynamo, or an alternator.

All dynamos are but machines for converting into electric energy the energy which is given to them by some prime mover, as a steam engine, a gas engine, by hydraulic or even by wind power.

All electric motors are merely machines for reconverting the electric energy which they receive by means of the conducting wires or mains, into mechanical energy.

All electric lamps are contrivances for converting into luminous energy a percentage of the electric energy that is supplied through the mains.

Potential and Kinetic Energy.—*Potential energy* is the capacity for performing work which a body possesses *by virtue of its position.* *Kinetic energy* is the capacity for performing work which a body possesses *by virtue of its motion.*

It must be evident that position or motion given to a body enables it to perform work. In the first instance, for example, a heavy weight at the top of a high tower possesses potential energy. A ten pound weight supported one foot above a plane has ten foot pounds of potential energy.

The flywheel of a steam engine in motion is an example of a body possessing kinetic energy. Some of this kinetic energy which was stored up in the fly wheel during the working stroke is expended in moving the engine over the "dead center," and any other point where no torque is produced by the pressure on the piston.

Chemical Energy can be converted into electric energy to a limited extent by means of the electric battery, but the cost of this energy is so high that it is commercially feasible only where small quantities are required, and the cost of production is secondary to the convenience of generation, as for signalling purposes, the operation of bells and annunciators, etc.

The chemical energy of coal and other fuels cannot be directly converted into electric energy. For power producing purposes, the

chemical energy of a fuel is first converted into heat by combustion, and the heat thus obtained converted into mechanical energy by some form of heat engine, and the mechanical energy subsequently transformed into electric energy in an electric generator.

Energy cannot be created or destroyed. This is the law known as **the conservation of energy** which has been built up by Helmholtz, Thomson, Joule and others. It teaches further, that energy can be transmitted from one body to another or transformed in its manifestations.

Energy may be dissipated, that is, converted into a form from which it cannot be recovered, as is the case with the great percentage of heat escaping from the exhaust nozzle of a locomotive or in the circulating water of a steamship, but the total amount of energy in the universe, it is argued, remains constant and invariable.

Following this law comes the doctrine of the **conservation of electricity** as announced by Lippman, being undoubtedly the outcome of the ideas of Maxwell and of Faraday as to the nature of electricity. According to their doctrine, electricity *cannot be created or destroyed, although its distribution may be altered.*

Lippman states that every charge of electricity has an opposite and equal charge somewhere in the universe more or less distributed; that is, the sum of positive charges is always equal to the sum of negative charges.

In *altering the distribution of electricity*, we may cause **more** to appear at one place and **less** at another, or may change it from the condition of rest to that of motion, or may cause it to spin round in whirlpools or vortices, which themselves can attract or repel other vortices. According to this view all our electrical machines and batteries are merely instruments for altering the *distribution* of electricity by moving some of it from one place to another, or for causing electricity, when accumulated



or heaped together in one place, to do work in returning to its former distribution.

Electrical engineering has developed largely and widely within a very short time and its many applications has created so great a demand for various kinds of electrical apparatus, that their manufacture forms one of the leading industries.

Electricity is very valuable as a medium for the transmission of energy, especially to long distances; it is also used to great advantage in lighting, being free from the disagreeable properties of gas or oil.

Again, electricity finds various applications, in extracting gold from the ore, pumping and ventilation of mines, traction, telephone, telegraph, electroplating, therapeutics, etc.

These few, of its many applications will perhaps serve to indicate the far reaching interest and importance of electricity, and possibly help to kindle in the student something of the eagerness in his work and enthusiasm without which he will fail to do justice either to his calling or to himself.

SIGNS AND SYMBOLS

The following signs, symbols and abbreviations are almost universally employed in descriptive and technical works on electrical subjects.

Although, in the arrangement of the Guides, the direct current and alternating current matter has been kept separate, it is perhaps advisable in the case of signs and symbols, to combine those relating to the alternating current with the direct current and other symbols, making a single table, rather than have them scattered throughout the work.

1. Fundamental.

l, Length. cm. = centimeter; in., or $''$ = inch, ft. or $'$ = foot.
M, Mass. gr. = mass of 1 gramme; kg. = 1 kilogramme.
T, t, Time. s = second.

2. Derived Geometric.

S, s, Surface.
E, Volume.
α, β, Angle.

3. Derived Mechanical.

v, Velocity.
ω, Angular velocity.
m, Momentum.
a, Acceleration.
g, Acceleration due to gravity = 32.2 feet per second.
F, f, Force.
W, Work.
P, Power.
δ, Dyne.
ϵ, Ergs.
ft. lb., Foot pound.
H.P., h.p.; horse power.
I.H.P., Indicated horse power.
B.H.P., Brake horse power.
E.H.P., *Electrical horse power.*
J, Joule's equivalent.
p, Pressure.
K, Moment of inertia.

4. Derived Electrostatic.

e, Pressure difference.
i, Current.
r, Resistance.
q, Quantity.
c, Capacity.
sc, Specific inductive capacity.

5. Derived Magnetic.

m, Strength of pole.
$\mathfrak{J}$, Intensity of magnetization.
$\mathfrak{M}$, Magnetic moment.
$\mathfrak{H}$, Horizontal intensity of earth's magnetism.
$\mathfrak{H}$, Field intensity.
Φ, Magnetic flux.
$\mathfrak{B}$, Magnetic flux density or magnetic induction.
$\mathfrak{H}$, Magnetizing force.
$\mathfrak{F}$, Magnetomotive force.
$\mathfrak{R}$, Reluctance, magnetic resistance.
μ, Magnetic permeability.
κ, Magnetic susceptibility.
ν, Reluctivity (specific magnetic resistance).

6. Derived Electromagnetic.

R, Resistance, ohm.
O, do, megohm.
E, Volt, pressure.
- E_{im} Impressed pressure.
- E_a; E_o Active pressure; ohmic drop.
- E_v Virtual pressure.
- E_{max} Maximum pressure.
- E_{av} Average pressure.
- E_{ef} Effective pressure.
- E_l Inductance pressure.
- E_c Capacity pressure.


U, Difference of pressure, volt.
I, Intensity of current, ampere.
- I_{im} Impressed current.
- I_a Active current.
- I_v Virtual current.
- I_{max} Maximum current.
- I_{av} Average current.
- I_{ef} Effective current.

Q, Quantity of electricity, ampere hour; coulomb.
C, Capacity, farad.
W, Electric energy, watt hour; Joule.
P, Electric power, watt; kilowatt.
ρ, Resistivity (specific resistance) ohm centimeter.
G, Conductance, mho.
γ, Conductivity (specific conductivity).
Y, Admittance, mho.
Z, Impedance, ohm.
X, Reactance, ohm.
- X_l Inductance reactance.
- X_c Capacity reactance.


B, Susceptance, mho.
L, Inductance (coefficient of Induction), henry.
v, Ratio of electro-magnetic to electrostatic unit of quantity $=3\times10^{10}$ centimeters per second approximately.

7. Symbols in general use.

D, Diameter.
r, Radius.
t, Temperature.
θ, Deflection of galvanometer needle.
N, n, Number of anything.
π, Circumference ÷ diameter = 3.141592.
ω, $2\pi f = 6.2831 \times$ frequency, in alternating current.
$\sim f$, Frequency, periodicity, cycles per second.
ϕ Phase angle.
G, Galvanometer.
S, Shunt.
N, n, North pole of a magnet.
S, s, South pole of a magnet.
A.C. Alternating current.
D.C. Direct current.
P.D. Pressure difference.
P.F. Power factor.
C.G.S. Centimeter, gramme, Second system.
B.&S. Brown & Sharpe wire gauge.
B.W.G. Birmingham wire gauge.
R.p.m. Revolutions per minute.
C.P. Candle power.
—o— Incandescent lamp.
—×— Arc lamp.




Condenser.



Battery of cells.



Dynamo, or direct current motor.


Alternator, or alternating current motor.


Converter.


Static transformer.


Inductive resistance.


Non-inductive resistance.

CHAPTER I

ELECTRICITY

Nature and Source of Electricity.—What is electricity? This is a question that is frequently asked, but has not yet been satisfactorily answered. It is a force, subject to control under well known laws.

While the nature and source of electricity still remain a mystery, many things about it have become known, thus, it is positively assured that electricity never manifests itself except when there is some mechanical disturbance in ordinary matter.

The true nature of electricity has not yet been discovered. Many think it a quality inherent in nearly all the substances, and accompanied by a peculiar movement or arrangement of the molecules. Some assume that the phenomena of electricity are due to a peculiar state of strain or tension in the ether which is present everywhere, even in and between the atoms of the most solid bodies. If the latter theory be the true one, and if the atmosphere of the earth be surrounded by the same ether, it may be possible to establish these assumptions as facts.

The most modern supposition regarding this matter, by Maxwell, is that light itself is founded on electricity, and that *light waves are merely electro-magnetic waves.* The theory "that



electricity is related to, or identical with, the luminiferous ether," has been accepted by the most prominent scientists.

But while electricity is still a mystery, much is known about the laws governing its phenomena. Man has mastered this mighty force and made it his powerful servant; he can produce it and use it.

Electricity, it is also conceded, is without weight, and, while it is without doubt, one and the same, it is for convenience sometimes classified according to its motion, as:

1. Static electricity, or electricity *at rest;*
2. Current electricity, or electricity *in motion;*
3. Magnetism, or electricity *in rotation;*
4. Electricity *in vibration* (radiation).

Other useful divisions are:

1. Positive;
2. Negative electricity;
3. Static;
4. Dynamic electricity.

Static Electricity.—This is a term employed to define electricity produced by friction. It is properly employed in the sense of a static charge which shows itself by the attraction or repulsion between charged bodies.

When static electricity is discharged, it causes more or less of a current, which shows itself by the passage of sparks or a brush discharge; by a peculiar prickling sensation; by a peculiar smell due to its chemical effects; by heating the air or other *substances in its path;* and sometimes in other ways.

Current Electricity.—This may be defined as the quantity of electricity which passes through a conductor in a given time —or, electricity in the act of being discharged, or electricity in motion.

An electric current manifests itself by heating the wire or conductor; by causing a magnetic field around the conductor and by causing chemical changes in a liquid through which it may pass.

Dynamic Electricity.—This term is used to define current electricity to distinguish it from static electricity.

Radiated Electricity.—Electricity in vibration. Where the current oscillates or vibrates back and forth with extreme rapidity, it takes the form of waves which are similar to waves of light.

Positive electricity.—This term expresses the condition of the point of an electrified body having the higher energy from which it flows to a lo er level. The sign which denotes this phase of electric excitement is +; all electricity is either positive or negative.

Negative Electricity.—This is the reverse condition to the above and is expressed by the sign or symbol—. These two terms are used in the same sense as *hot* and *cold*.

NOTE.—In 1749, Benjamin Franklin, observing lightning to possess almost all the properties observable in electric sparks, suggested that the electric action of points, which was discovered by him, might be tried on thunderclouds, and so draw from them a charge of electricity. He proposed, therefore, to fix a pointed iron rod to a high tower, but shortly after succeeded in another way. He sent up a kite during the passing of a storm, and found the wetted string to conduct the electricity to the earth, and to yield abundance of sparks. These he drew from a key tied to the string, a silk ribbon being interposed between his hand and the key for safety. Leyden jars could be charged, and all other electrical effects produced, by the sparks furnished from the clouds. The proof of the identity was complete. The kite experiment was repeated by Romas, who *drew from a metallic string sparks 9 feet long.* In 1753, Richmann, of St. *Petersburg, who was experimenting with a similar apparatus, was struck by a sudden discharge and killed.*

Atmospheric Electricity is the free electricity of the air which is almost always present in the atmosphere. Its exact cause is unknown.

The phenomena of atmospheric electricity are of two kinds; there are the well known manifestations of thunderstorms; and there are the phenomena of continual slight electrification in the air, best observed when the weather is fine; the Aurora constitutes a third branch of the subject.



Fig. 1.—The electric eel. There are several species inhabiting the water, and which have the power of producing electric discharges by certain portions of their organism. The best known of these are the *Torpedo*, the *Gymnotus*, and the *Silurus*, found in the Nile and the Tiger. The Electric Ray, of which there are three species inhabiting the Mediteranean and Atlantic is provided with an electric organ on the back of its head, as shown in the illustration. This organ consists of laminæ composed of polygonal cells to the number of 800 or 1000, or more, supplied with four large bundles of nerve fibres; the under surface of the fish is −, the upper +. In the Surinam eel, the electric organ goes the whole length of the body along both sides. It is able to give a very severe shock, and is a formidable antagonist when it has attained its full length of 5 or 6 feet.

Frictional Electricity is that produced by the friction of one substance against another.

Resinous Electricity.—The kind of electricity produced upon a resinous substances such as sealing wax, resin, shellac, rubber or amber when rubbed with wool or fur. Resinous electricity is *negative electricity.*

Vitreous Electricity.—A term applied to the positive electricity developed in a glass rod by rubbing it with silk. This electric charge will attract to itself bits of pith or paper which have been repelled from a rod of sealing wax or other resinous *substance which had* been rubbed with wool or fur.

CHAPTER II

STATIC ELECTRICITY

Static electricity may be defined simply as *electricity at rest;* the term properly applies to an isolated charge of electricity produced by friction. The presence of static electricity manifests itself by *attraction* or *repulsion.*

Electrical Attraction and Repulsion.—When a glass rod, or a stick of sealing wax or shellac is held in the hand and rubbed with a piece of flannel or cat skin, the parts will be found to have the property of attracting bodies, such as pieces of silk, wool, feathers, gold leaf, etc.; they are then said to be *electrified.* In order to ascertain whether bodies are electrified or not, instruments called *electroscopes* are used.

There are two opposite kinds of electrification:


1. Positive;
2. Negative.

Franklin called the electricity excited upon glass by rubbing it with silk *positive* electricity, and that produced on resinous bodies by friction with wool or fur, *negative* electricity.

The *electricity developed on a body by friction depends on the rubber as well as the body* rubbed. Thus glass becomes

negatively electrified when rubbed with catskin, but positively electrified when rubbed with silk.

The nature of the electricity set free by friction depends on the degree of polish, the direction of the friction, and the temperature. If two glass discs of different degrees of polish be rubbed against each other, that which is most polished is positively, and that which is least polished is negatively electrified. If two silk ribbons of the same kind be rubbed across each

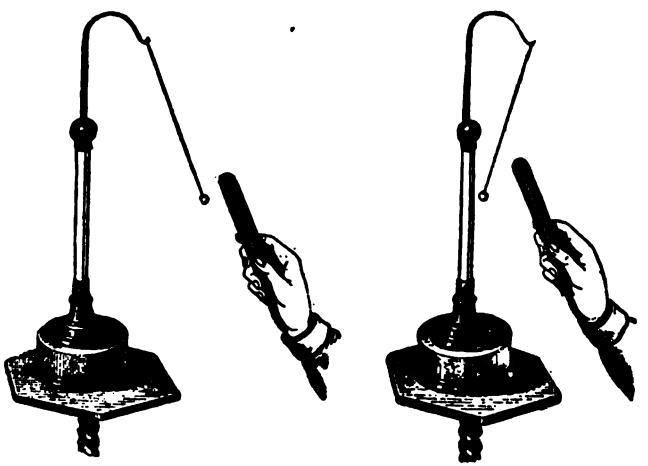

FIGS. 2 and 3.—Pith ball pendulum or electroscope; the figures illustrate also electrical attraction and repulsion.

other, that which is transversely rubbed is negatively and the other positively electrified. If two bodies of the same substance, of the same polish, but of different temperatures, be rubbed together, that which is most heated is negatively electrified. Generally speaking, the particles which are most readily displaced are negatively electrified.

In the following list, which is mainly due to Faraday, the *substances are arranged* in such order that each becomes

positively electrified when rubbed with any of the bodies following, but negatively when rubbed with any of those which precede it:

1. Catskin.
2. Flannel.
3. Ivory.
4. Rock crystal.
5. Glass.
6. Cotton.
7. Silk.
8. The hand.
9. Wood.
10. Metals.
11. Caoutchouc.
12. Sealing wax.
13. Resin.
14. Sulphur.
15. Guttapercha.
16. Gun cotton.

The Charge.—The quantity of electrification of either kind produced by friction or other means upon the surface of a body is spoken of as a charge, and a body when electrified is said to be *charged*. It is clear that there may be charges of different values as well as of either kind. When the charge of electricity is removed from a charged body it is said to be *discharged*. Good conductors of electricity are instantaneously discharged if touched by the hand or by any conductor in contact with the ground, the charge thus finding a means of escaping to earth. A body that is not a good conductor may be readily discharged by passing it rapidly through the flame of a lamp or candle; for the flame instantly carries off the electricity and dissipates it in the air.

Distribution of the Charge.—When an insulated sphere of conducting material is charged with electricity, the latter passes to the surface of the sphere, and forms there an extremely thin layer. The distribution of the charge then, depends on the *extent* of the surface and not on the mass.

Boit proved that the charge resides on the surface by the following *experiment:*

A copper ball was electrified and insulated. Two hollow hemisph of copper of a larger size, provided with glass handles, were t placed near the sphere, as in fig. 4. So long as they did not to the sphere, the charge remained on the latter, but if the hemisph touched the inner sphere, the whole of the electricity passed to exterior, and when the hemispheres were separated and removed inner globe was found to be completely discharged.

The distribution of a charge over an insulated sphere conducting material is uniform, provided the sphere is rem from all other conductors and electrified bodies.


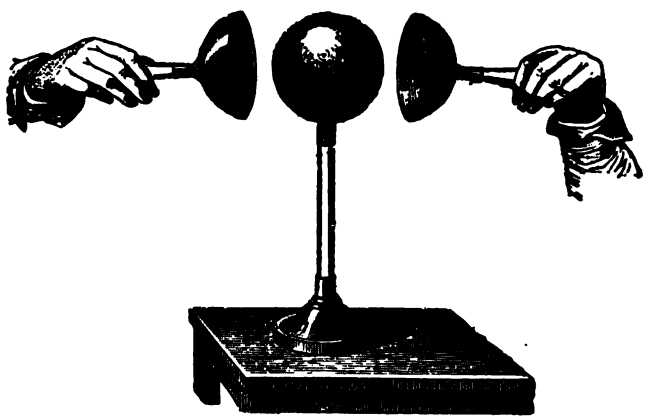


FIG. 4.—Bolts experiment which proved that the *charge resides on the surface.*

Figs. 5 to 8 show, by the dotted lines, the distribution a charge for bodies of various shapes. Fig. 6 shows that elongated bodies, the charge collects at the ends.

The effects of points is illustrated in fig. 9; when a charg body is provided with a point as here shown, the current cumulates at the point to such a high degree of density that passes off into the air, and if a lighted candle be held in fr *of the point, the flame* will be visibly blown aside.

Fig. 10 shows an *electric windmill* or experimental device for illustrating the escape of electricity from points. It consists of a vane of several pointed wires bent at the tips in the same direction, radiating from a center which rests upon a pivot. When mounted upon the conductor of an electrostatic machine, the vane rotates in a direction opposite that of the points. The movement of the vane is due to the repulsion of the electrified air particles near the points and the electricity on the points themselves. The motion of the air is called *electric wind.* This device is also called *electric flyer*, and *electric whirl.*

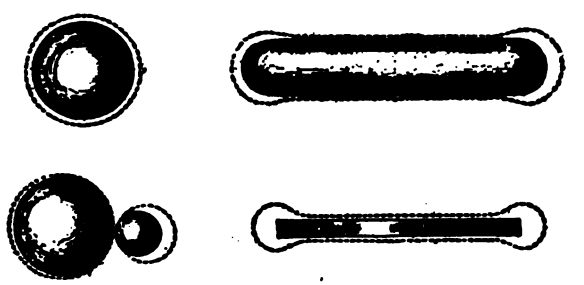

FIGS. 5 to 8.—Illustrating the distribution of the charge on conductors of various shapes.

"Free" and "Bound" Electricity.—These terms may be defined as follows:

The expression *free electricity* relates to the ordinary state of electricity upon a charged conductor, not in the presence of a charge of the opposite kind. A free charge will flow away to the earth if a conducting path be provided.

A charge of electricity upon a conductor is said to be *bound*, when it is attracted by the presence of a neighboring charge of the *opposite kind.*

Conductors and Insulators.—The term *conductors* is applied to those bodies which readily allow electricity to flow through them, in distinction from *insulators* or so called *non-conductors*, which practically allow no flow of electricity.

Strictly speaking, there is no substance which will prevent the passage of electricity, hence, the term non-conductors, though extensively used, is not correct.

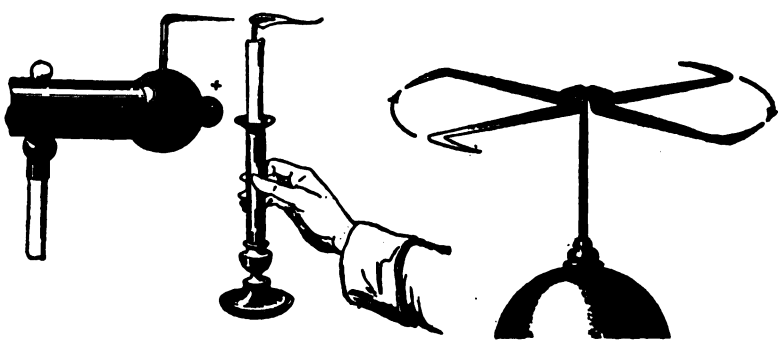


FIG. 9.—Experiment to illustrate the effect of pointed conductors.
FIG. 10.—Electric windmill which operates by the reaction due to the escape of the electric charge from the points.

Electroscopes.—These are instruments for detecting whether a body be electrified or not, and indicating also whether the electrification be positive or negative. The earliest electroscope devised consisted of a stiff straw balanced lightly upon a sharp point; a thin strip of brass or wood, or even a goose quill, balanced upon a sewing needle will serve equally well. Another form of electroscope is the pith ball pendulum, shown in figs. 2 *and 3.* When an electrified body is held near the electroscope *it is attracted or repelled* thus indicating the presence and *nature of the charge.*

Gold Leaf Electroscope.—This form of electroscope, which is very sensitive, was invented by Bennet. Its operation depends on the fact that *like charges repel each other.*

The gold leaf electroscope as shown in fig. 11, is conveniently made by suspending the two narrow strips of gold leaf within a wide mouthed glass jar, which both serves to protect them from draughts of air and to support them from contact with the ground. A piece of varnished glass tube is pushed through the



FIG. 11.—Gold leaf electroscope; it consists of two strips of gold foil suspended from a brass rod within a glass jar. Used to detect the presence and sign of an electric charge.

cork, which should be varnished with shellac or with paraffin wax. Through this passes a stiff brass wire, the lower end of which is bent at a right angle to receive the two strips of gold leaf, while the upper end is attached to a flat plate of metal, or may be furnished with a brass knob.

When kept dry and free from dust it will indicate excessively small quantities of electricity. A rubbed glass rod, even while two *or three feet from the instrument*, will cause the leaves to *repel one another. If the knob* be brushed with only a small

camel's hair brush, the slight friction produces a perce
effect. With this instrument all kinds of friction can be s
to produce electrification.

The gold leaf electroscope can be further used to indicat
kind of electricity on an excited body. Thus, if a pie
brown paper be rubbed with a piece of india rubber, the n
of the charge is determined as follows:

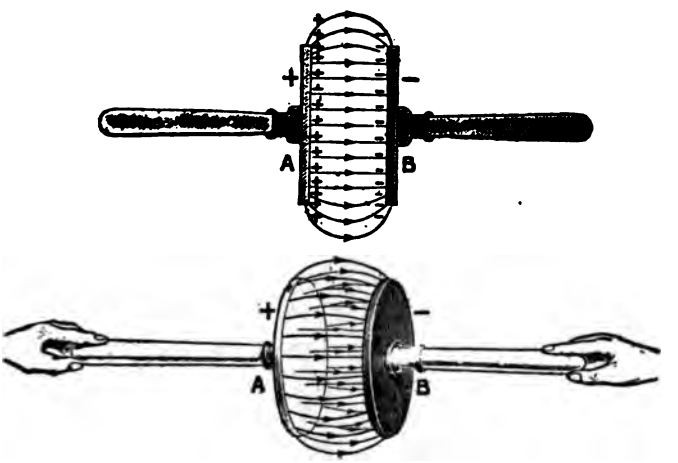


FIG. 12.—Distribution of electrification on a charged hollow sphere. If an insulat
ductor *d* be inserted through the opening in the sphere and brought in contact w
interior surface and afterwards carefully removed, it will be found, by testing w
gold leaf electroscope, that it has received no charge. If touched to the outsid
ever, the conductor will receive part of the charge.

First charge the gold leaves of the electroscope by touching the
with a glass rod rubbed on silk. The leaves diverge, being elec
with positive electrification. When they are thus charged the ap
of a body which is positively electrified will cause them to diver

more widely; while, on the approach of one negatively electrified, they will tend to close together. If now the brown paper be brought near the electroscope, the leaves will be seen to diverge more, proving the electrification of the paper to be of the same kind as that with which the electroscope is charged.

The gold leaf electroscope will also indicate roughly the amount of electricity on a body placed in contact with it, for the gold leaves open out more widely when the quantity of electricity thus imparted to them is greater.



FIGS. 13 and 14.—Electrification produced by rubbing dissimilar bodies together and then separating them. If the insulated glass and leather discs A and B be rubbed together, *but not separated*, no signs of electrification can be detected; but if the discs be drawn apart a little distance the space between them is found to be an electric field, and as they separate farther and farther, electric forces will be found to exist in more and more of the surrounding space, the electrification being indicated by "lines of force." It should be noted that *work has to be done* in separating the charged discs to overcome the attraction which tends to hold them together. The stress indicated by the lines of force consists of a tension or pull in the direction of their length and a pressure or thrust at right angles to that direction.

Electric Screens.—That the charge on the outside of a conductor always distributes itself in such a way that there is no electric force within the conductor was first proved experimentally *by Faraday. He* covered a large box with tin foil

and went inside with the most delicate electroscopes obtainab Faraday found that the outside of the box could be charged strongly that long sparks would fly from it without any el rical effects being observable anywhere inside the box.

To repeat the experiment in modified form, let an electroscope placed beneath a bird cage or wire netting, as in fig. 15. Let char rods or other powerfully charged bodies be brought near the electrosc outside the cage. The leaves will be found to remain undisturbed.

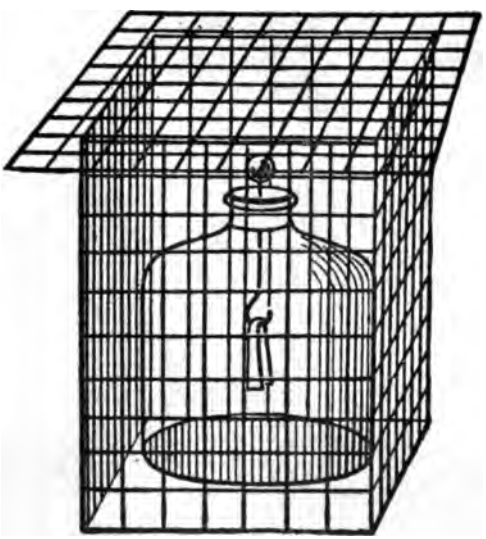


FIG. 15.—The electric screen. A screen of wire gauze surrounding a delicate electrical ins ment will protect it from external electrostatic induction.

Electrification by Induction.—An insulated conduct charged with either kind of electricity, acts on bodies in neutral state placed near it in a manner analogous to that the action of a magnet on soft iron; that is, it decomposes t *neutral electricity*, attracting the opposite and repelling t

like kind of electricity. The action thus exerted is said to take place by *influence* or *induction.*

The phenomenon of electrification by induction may be demonstrated by the following experiment:

In fig. 16, let the ebonite rod be electrified by friction and slowly brought toward the knob of the gold leaf electroscope. The leaves will be seen to diverge, even though the rod does not approach to within a foot of the electroscope.

This experiment shows that the mere *influence* which an electric charge exerts upon a conductor placed in its vicinity

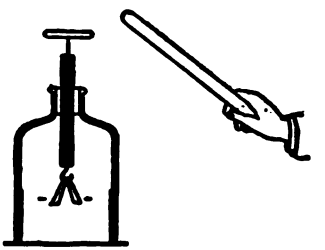


FIG. 16.—Experiment to illustrate electrostatic induction. The leaves will diverge, even though the charged ebonite rod does not approach to within a foot of the electroscope.

is able to produce electrification in that conductor. This method of producing electrification is called *electrostatic induction.*

As soon as the charged rod is removed the leaves will collapse, indicating that this form of electrification is only a temporary phenomenon which is due simply to the presence of the charged body in the neighborhood.

Nature of the Induced Charge.—This is shown by the experiment *illustrated in fig. 17.*

Let a metal ball A be charged by rubbing it with a charged rod, and let it then be brought near an insulated metal cylinder B which is provided with pith balls or strips of paper C, D, E, as shown.

The divergence of C and E will show that the ends of B have received electrical charges because of the presence of A, while the failure of D to diverge will show that the middle of B is uncharged. Further, the rod which charged A will be found to repel C but to attract E.

From these experiments, the conclusion is that when a conductor is brought near a charged body, the end away from the


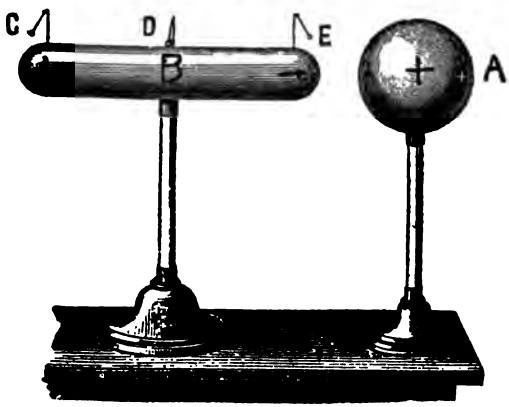


FIG. 17.—Experiment illustrating the nature of an induced charge. The apparatus consists of a metal ball and cylinder, both mounted on insulated stands, pith balls being placed on the cylinder at points C, D, and E.

inducing charge is electrified with the same kind of electricity as that on the inducing body, while the end toward the inducing body receives electricity of opposite sign.

The Electrophorus.—This is a simple and ingenious instrument, invented by Volta in 1775 for the purpose of procuring, by the principle of induction, *an unlimited number of charges of electricity from one single charge.*

It consists of two parts, as shown in fig. 19, a round cake of resinous material B, cast in a metal dish or "sole" about one foot in diameter, and a round disc A, of slightly smaller diameter made of metal or of wood covered with tinfoil, and provided with a glass handle. Shellac, or sealing wax, or a mixture of resin shellac and Venice turpentine, may be used to make the cake.

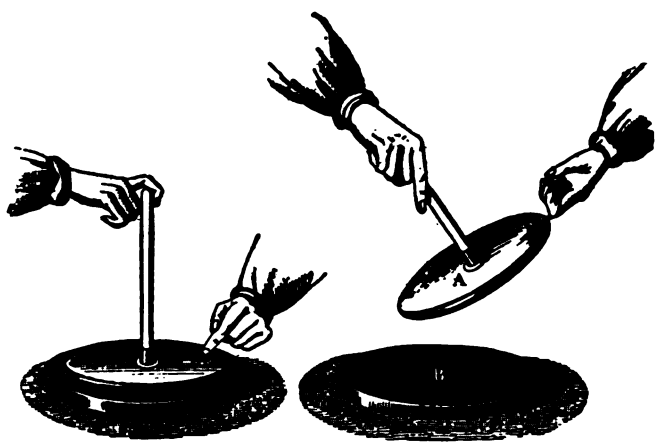

FIGS. 18 and 19.—The electrophorus and method of using. Charge B; place A in contact with B, and touch A (fig. 18). The disc is now charged by *induction* and will yield a spark when touched by the hand, as in fig. 19.


To use the electrophorus, the resinous cake B must be first beaten or rubbed with fur or a woolen cloth, the disc A is then placed on the cake, touched with the finger and then lifted by the handle. The disc will now be found to be charged and will yield a spark when touched with the hand, as in fig. 19.

The "cover" may be replaced, touched, and once more removed, and will thus yield any number of sparks, the or

charge on the resinous plate meanwhile remaining practically as strong as before.

The theory of the electrophorus is very simple, provided the student has clearly grasped the principle of induction.

When the resinous cake is first beaten with the cat's skin its surface is negatively electrified, as indicated in fig. 20. Again,

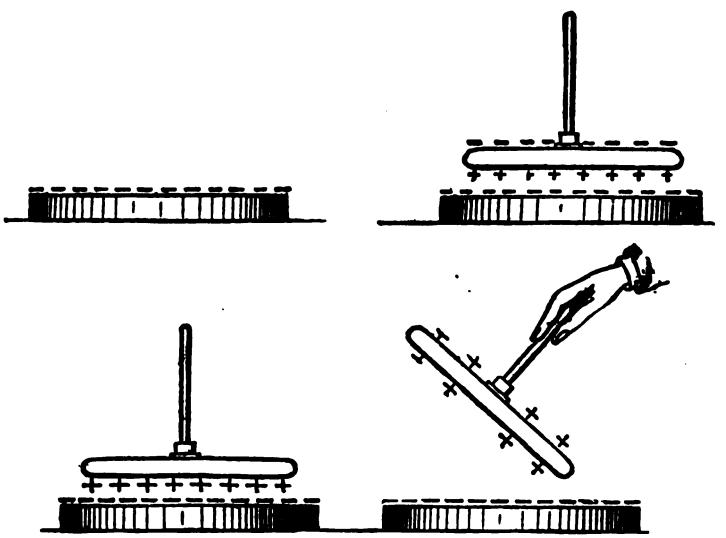

FIGS. 20 to 23.—Illustrating "how the electrophorus works."

when the metal disc is placed down upon it, it rests really only on three or four points of the surface, and may be regarded as an insulated conductor in the presence of an electrified body. The negative electrification of the cake therefore acts inductively on the metallic disc or "cover," attracting a positive *charge to its under side,* and repelling a negative charge to its *upper surface, as shown* in fig. 21.

If, now, the cover be touched for an instant with the finger, the negative charge of the upper surface (which is upon the upper surface being repelled by the negative charge on the cake) will be neutralized by electricity flowing in from the earth through the hand and body of the experimenter. The attracted positive charge will, however remain being bound as it were

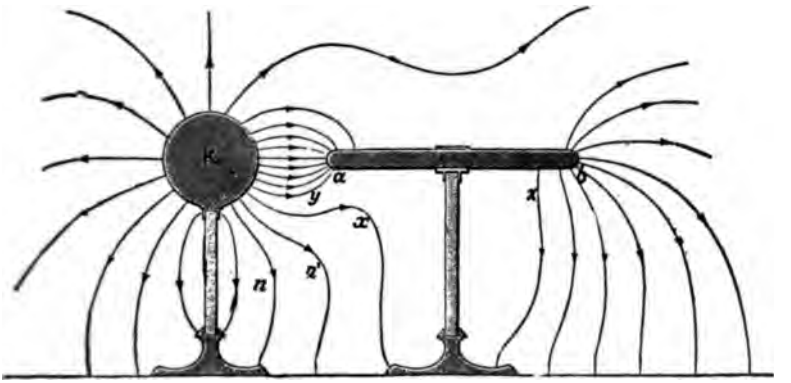


FIG. 24.—Lines of force of a charged sphere and a conductor under induction. The negative electrification on the end *a* of the cylinder indicates that a certain number of lines end there, while the positive electrification on the end *b* similarly indicates that an *equal* number of lines set out from that end. It is one of the fundamental properties of a conductor that it yields instantly to the smallest electric force, and that no electric force can be permanently maintained within the substance of a conductor in which no current is passing. There can, therefore, be no electrostatic strain and no lines of force within the material of a conductor where the electric field has become steady. Hence the lines starting from *b* are entirely distinct from those ending at *a*. The two sets are equal in number because no charge has been given to the cylinder, either positive or negative, and therefore the sum of all the positive electrifications (or lines starting from *b*) must be equal to the sum of all the negative electrifications (or the lines ending at *a*). In all nine lines have been drawn at each end of the cylinder, leaving the thirteen lines emanating from the sphere which do not run on to the cylinder. If the cylinder be withdrawn to a distance from K, it (the cylinder) will be found to show no signs of electrification.

by its attraction towards the negative charge on the cake.

Fig. 22 shows the result after the cover has been touched. If, finally, the cover be lifted by its handle, the remaining positive charge will no longer be "bound" on the lower surface by *attraction, but will distribute* itself on both sides of the *cover, and may be used to give* a spark. It is clear that no

part of the original charge has been consumed in the process, which may be repeated as often as desired. As a matter of fact, the charge on the cake slowly dissipates—especially if the air be damp. Hence it is needful sometimes to renew the original charge by again beating the cake with the cat's skin.




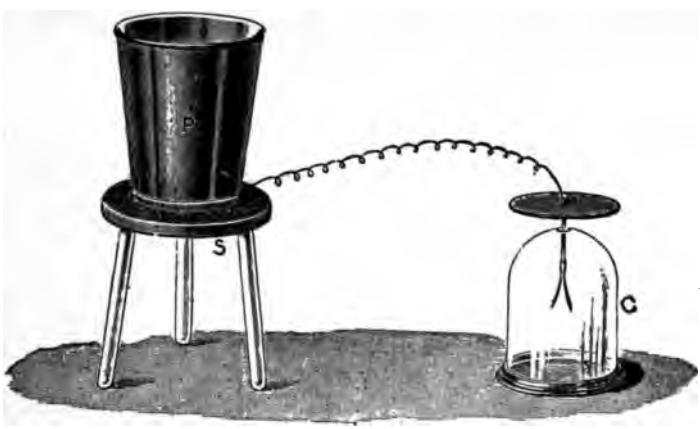


FIG. 25.—Faraday's ice pail experiment. An ice pail P connected with the gold leaves of an electroscope C, is placed on an insulating stand S. A charged conductor K, carried by a silk thread, is lowered into the pail, and finally touches it at the bottom. While it is being lowered the leaves of the electroscope diverge farther and farther, until K is well within the pail, after which they diverge no more, even when K touches the pail or is afterwards withdrawn by the insulating thread. After withdrawal, K is found to be completely discharged.

The labor of touching the cover with the finger at each operation may be saved by having a pin of brass or a strip of tinfoil *projecting* from the metallic "sole" on to the top of the cake, *so that it touches the plate* each time, and thus neutralizes the *negative charge by allowing* electricity to flow in from the earth

Since the electricity thus yielded by the electrophorus is not obtained at the expense of any part of the original charge, it is a matter of some interest to inquire whence is the source from which the energy of this apparently unlimited supply is drawn;

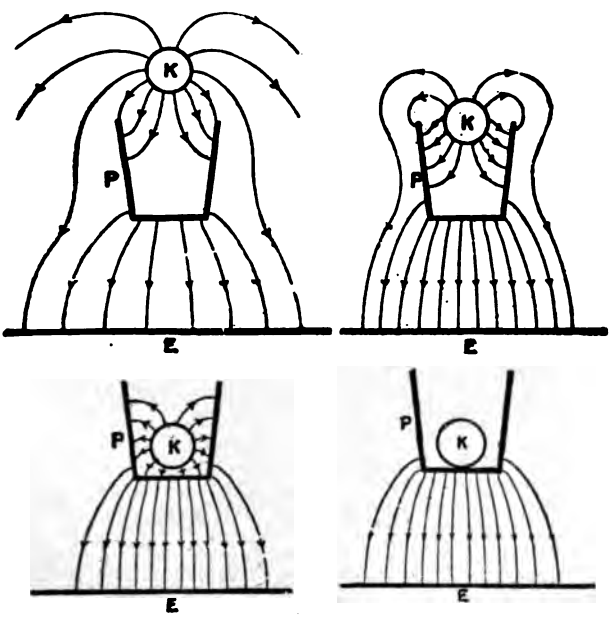

FIGS. 26 to 29.—Explanation of Faraday's ice pail experiment. For simplicity the electroscope, insulating stand and silk thread have been omitted. Only the three principal conductors K, P, and the earth E are shown. In fig. 26 the ball K is sufficiently close to P to act inductively on it; six lines are shown as falling on P, and the other six as passing to E by different paths. Corresponding to the six lines falling on P from K, six others pass to E from the lower surfaces. In fig. 27 where K is just entering the pail, two lines only pass from K to E through the dielectric; the remaining ten fall on P, and ten others starting from the distant parts of P pass to E. In fig. 28, K is so far within P that none of its lines can reach E through the dielectric; they all fall on P and from the outside of P an equal number start and pass through the dielectric to E. It is evident that in this position K can be moved about within P, without affecting the outside distribution in the slightest, and that even when K touches P as shown in fig. 29, and when, therefore, all lines between them disappear, the lines in the dielectric outside remain just as they are in fig. 28. K is now completely discharged, since lines no longer emanate from it, hence it can be removed by the silk cord without disturbing the electrification of P. If K be again charged and introduced into P it will be again discharged, for the fact that P is *already charged will have* no effect on the final result, provided when K *touches P it is well under cover.*

for it cannot be called into existence without the expenditure of some other form of energy. The fact is, *more work is done in lifting the cover when it is charged* with the positive electricity than when it is not charged; for when charged, there is the force of the electric attraction to be overcome as well as the force of gravity; this excess force is the real origin of the energy stored up in the separate charges.



FIGS. 30 and 31.—The Leyden jar and discharger. Its discovery is attributed to the attempt of Musschenbrock and his pupil Cuneus to collect the supposed electric "fluid" in a bottle half filled with water. The bottle was held in the hand and was provided with a nail to lead the "fluid" down through the cork to the water from the electric machine. The invention of the Leyden jar is also claimed by Kleist, Bishop of Pomerania.

Condensers; Leyden Jar.—A *condenser* is an apparatus for condensing a large quantity of electricity on a comparatively small surface. The form may vary considerably, but in all cases it *consists essentially of two insulated conductors, separated by an insulator and the working depends on the action of induction.*

A form of condenser generally used in making experiments *on static electricity is* the Leyden jar, so named from the town

of Leyden where it was invented. It consists of a glass jar coated inside and out to a certain height with tinfoil, having a brass rod terminating in a knob passed through a wooden stopper, and connected to the inner coat by a loose chain, as shown in fig. 30.

The jar may be charged by repeatedly touching the knob with the charged plate of the electrophorus or by connecting the inner coating to one knob of an electrical machine and the outer coating to the other knob.

The discharge of a condenser is effected by connecting the plates having an opposite charge. This may be done by use of a wire or a discharger, as shown in fig. 31; the connection is made between the outer coat and the knob.

When the knob of the discharger is sufficiently close to the knob of the jar, a bright spark will be observed between the knobs. This discharge occurs whenever the difference of potential between the coats is great enough to overcome the resistance of the air between the knobs.

Let a charged jar be placed on a glass plate so as to insulate the outer coat. Let the knob be touched with the finger. No appreciable discharge will be noticed. Let the outer coat be in turn touched with the finger. Again no appreciable discharge will appear. But if the inner and outer coatings be connected with the discharger, a powerful spark will pass.

Electric Machines.—Various machines have been devised for producing electric charges such as have been described. The ordinary "static" or electric machine, is nothing but a continuously acting electrophorus.

Fig. 32 represents the so called Toepler-Holtz machine. Upon the back of the stationary plate E, are pasted paper sectors, beneath which are strips of tinfoil AB and CD called *inductors*.

In front of E is a revolving glass plate carrying discs *l*, *m*, *n*, *o*, *p* and *q*, *called carriers.*

To the inductors *AB* and *CD* are fastened metal arms *t* and *u*, which bring *B* and *C* into electrical contact with the discs *l*, *m*, *n*, *o*, *p* and *q*, when these discs pass beneath the tinsel brushes carried by *t* and *u*.

A stationary metallic rod *rs* carries at its ends stationary brushes as well as sharp pointed metallic combs.

The two knobs *R* and *S* have their capacity increased by the Leyden jars *L* and *L'*.

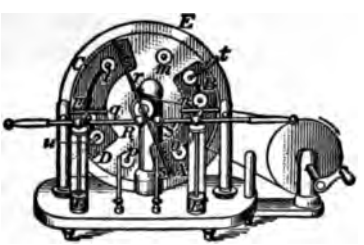


FIG. 32.—The Toepler-Holtz electric machine.

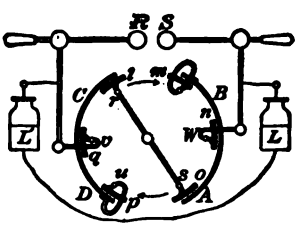


FIG. 33.—Principle of Toepler-Holtz electric machine.

Action of the Toepler-Holtz Machine.—The action of the machine described above is best understood from the diagram of fig. 33. Suppose that a small + charge is originally placed on the inductor *CD*. Induction takes place in the metallic system consisting of the discs *l* and *o* and the rod *rs*, *l* becoming negatively charged and *o* positively charged. As the plate carrying *l*, *m*, *n*, *o*, *p*, *q* rotates in the direction of the arrow the negative charge on *l* is carried over to the position *m*, where a part of it passes over to the inductor *AB*, thus charging it negatively.

When *l* reaches the position *n* the remainder of its charge, *being repelled by the negative* electricity which is now on AB, *passes over into the* Leyden jar *L*.

When *l* reaches the position *o* it again becomes charged by induction, this time positively, and more strongly than at first, since now the negative charge on *AB*, as well as the positive charge on *CD*, is acting inductively upon the rod *rs*.

When *l* reaches the position *u*, a part of its now strong positive charge passes to *CD*, thus increasing the positive charge upon this inductor.

In the position *v* the remainder of the positive charge on *l* passes over to *L'*. This completes the cycle for *l*. Thus as the rotation continues *AB* and *CD* acquire stronger and stronger charges, the inductive action upon *rs* becomes more and more intense, and positive and negative charges are continuously imparted to *L'* and *L* until a discharge takes place between the knobs *R* and *S*.

There is usually sufficient charge on one of the inductors to start the machine, but in damp weather it will often be found necessary to apply a charge to one of the inductors by means of the ebonite or glass rod before the machine will work.

The Wimshurst Machine.—The essential parts of an ordinary Wimshurst machine, as shown in fig. 34, are two insulating plates or drums. On each plate are fixed a large number of strips of conducting material, which are equal in size and are equally spaced—radially if on a plate, and circumferentially if on a drum. The plates, or drums, are made to rotate in opposite directions. The capacity of the inductors therefore varies from a maximum when each strip on one plate is facing a strip on the other, to a minimum when the conducting strips on each plate are *facing blank or insulating* portions of the other plate.

There are three pairs of contact brushes, the members of two of the pairs being at opposite ends of diametrical conducting rods placed at right angles to one another; the third pair are insulated from one another and form the principal collectors, the one giving positive and the other negative electricity.

The plates are revolving in opposite directions; thus if there be a charge on one of the conducting segments of one plate and an opposite charge on one of the conducting segments on the other plate near it, their potential will be raised as the rotation of the plates separates them.

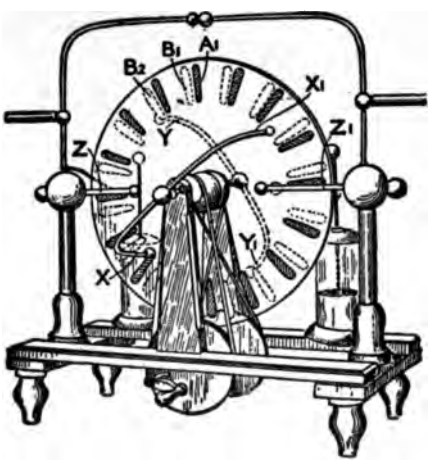


FIG 34.—The Wimshurst Electric Machine.

NOTE.—Suppose that the conditions are as in the fig. 34, that is, the segment A_1 is positive and the segment B_1 negative. Now, as A_1 moves to the left and B_1 to the right, their potentials will rise on account of the work done in separating them against attraction. When A_1 comes opposite the segment B_2 of the B plate, which is now in contact with the brush Y, it will be at a high positive potential, and will therefore cause a displacement of electricity along the conductor between Y and Y_1, bringing a large negative charge on B_2 and sending a positive charge to the segment touching Y_1.

As A_1 moves on, it passes near the brush Z and is partially discharged into the external circuit. It then passes on until, on touching the brush X, it is put in connection with X, and has a new charge, this time negative, driven into it by induction from B_2. Positive electricity, then, being carried by the conducting patches from right to left on the upper half of the A plate, and negative from left to right on its lower half.

A similar process is taking place on the B plate, but in this case the negative electricity is *going from left to right above*, and the positive from right to left below. On the whole, therefore, *positive electricity is being* supplied to the left hand main conductor Z_1 by both upper and lower plates, and negative to Z_1.

CHAPTER III

THE ELECTRIC CURRENT

The ordinary statement that an electric current is flowing along a wire is only a conventional way of expressing the fact that the wire and the space around the wire are in a different state from that in which they are when no electric current is said to be flowing.

In order to make laymen understand the action of this so called current, it is generally compared with the flow of water.

In comparing hydraulics and electricity, it must be borne in mind, however, that there is really no such thing as an "electric fluid," and that water in pipes has mass and weight, while electricity has none. It should be noted, however, that electricity is conveniently spoken of as having weight in explaining some of the ways in which it manifests itself.

All electrical machines and batteries are merely instruments for moving electricity from one place to another, or for causing electricity, when accumulated in one place, to do work in returning to its former level of distribution.

The *head* or *pressure* in a standpipe is what causes water to move through the pipes which offer *resistance* to the *flow*.

Similarly, the *conductors*, along which the electric current is said to flow, offer more or less *resistance* to the flow, depend-

on the material. Copper wire is generally used as it offers little resistance.

The current must have pressure to overcome the resistance of the conductor. This pressure is called *voltage* caused by what is known as *difference of potential* between the source and terminal.

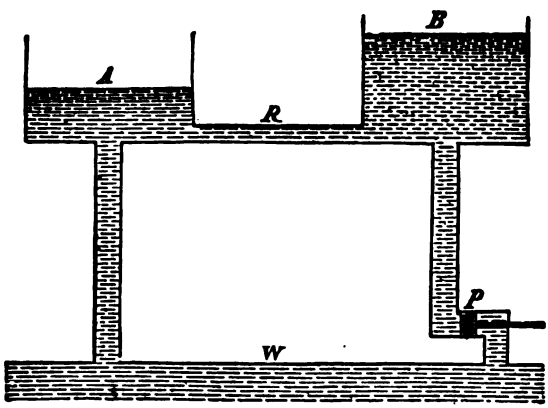


FIG. 35.—Analogy of the flow of water to the electric current. The water in the reservoirs A and B stands at different heights. As long as this difference of level is maintained, water from B will flow through the pipe R to A. If by means of a pump P the level in B be kept constant, flow through R will also be maintained. Here, by means of the work expended on the pump, the level in the reservoir is kept constant; and in the corresponding case of the electric current, by the conversion of chemical energy a constant difference of potential is maintained.

The pressure under which a current flows is measured in *volts* and the quantity that passes in *amperes*. The resistance with which the current meets in flowing along a conductor is measured in *ohms*.

Ques. What is a volt?

Ans. A volt is that electromotive force (E. M. F.) which *produces a current of* one ampere against a resistance of one ohm.

Ques. What is an ampere?

Ans. An ampere is the current produced by an E.M.F. of one volt in a circuit having a resistance of one ohm. It is that quantity of electricity which will deposit .005084 grain of copper per second.

Ques. What is an ohm?

Ans. An ohm is equal to the resistance offered to an unvarying electric current by a column of mercury at 32° Fahr., 14.4521 grams in mass, of a constant cross sectional area, and of the length of 106.3 centimeters.

Ohm's Law.—*In a given circuit, the amount of current in amperes is equal to the E. M. F. in volts divided by the resistance in ohms; that is:*

$$\text{current} = \frac{\text{pressure}}{\text{resistance}} = \frac{\text{volts}}{\text{ohms}}$$

expressed as a formula:

$$I = \frac{E}{R} \quad \ldots\ldots\ldots\ldots\ldots\ldots (1)$$

in which

I = current strength in amperes;
E = electromotive force in volts;
R = resistance in ohms.

From (1) is derived the following:

$$E = I\,R \quad \ldots\ldots\ldots\ldots\ldots\ldots (2)$$

$$R = \frac{E}{I} \quad \ldots\ldots\ldots\ldots\ldots\ldots (3)$$



From (1) it is seen that the flow of the current is proporti to the voltage and inversely proportional to the resistance; latter depends upon the material, length and diameter of conductor.

Since the current will always flow along the path of resistance, it must be so guarded that there will be no leak Hence, to prevent leakage, wires are *insulated*, that is, cov by wrapping them with cotton or silk thread or other insul material. If the insulation be not effective, the current leak, and so return to the source without doing its work. is known as a *short circuit.*

The conductor which receives the current from the sour called the *lead*, and the one by which it flows back, the *retu*

When wires are used for both lead and return, it is call *metallic circuit:* when the ground is used for the return, it is c a *ground circuit.* An electric current is said to be:

1. *Direct*, when it is of unvarying direction;
2. *Alternating*, when it flows rapidly to and fro in opp directions;
3. *Primary*, when it comes directly from the source;
4. *Secondary*, when the voltage and amperage of a pri current have been changed by an *induction coil*;
5. *Low tension*, when its voltage is low;
6. *High tension*, when its voltage is high.

A high tension current is capable of forcing its way against con able resistance, whereas, a low tension current must have its made easy.

Production of the Electric Current.—To produce a st flow of water in a pipe, two conditions are necessary. T *must first be* available a hydraulic pressure, or, as

technically called, a "*head*" of water produced by a pump, or a difference of level or otherwise.

In addition to the pressure there must also be a suitable path or channel provided for the water to flow through, or there will be no flow, however great the "head," until something breaks down under the strain. In the case just cited, although there is full pressure in the water in the pipe, there is no current of water as long as the tap remains closed. The opening of the tap completes the necessary *path* (the greater part of which was already in existence) and the water flows.



FIG. 36.– Hydraulic analogy of the electric current. If, say 10 gallons of water flow in every second into a system of vessels and pipes of any shape, whether simple or more complicated as shown in the figure, and 10 gallons flow out again per second, it is evident that through every cross section of any vessel or pipe of the system 10 gallons of water pass every second. This follows from the fact that water is an uncompressible liquid and must be practically of the same density throughout the system. The water moves slowly where the section is large and quickly where it is small, and thus the quantity of water that flows through any part of the system is independent of the cross section of that part. The same condition holds good for the electric current; if in a closed circuit a constant current circulates, the same anount of electricity will pass every cross section per second. Hence the following law: *The magnitude of a constant current in any circuit is equal in all parts of the circuit.*

For the production of a steady electric current two very similar conditions are necessary. There must be a steadily maintained electric pressure, known under different aspects as "electromotive force," "potential difference," or "voltage." This alone, however, is not sufficient. In addition, a suitable conducting path is necessary. Any break in this path occupied by unsuitable material acts like the closed tap in the analogous case above mentioned, and it is only when all such breaks have

been properly bridged by suitable material, that is, by conductors, that the effects which denote the flow of the current will begin to be manifested.

The necessary electromotive force or voltage required to cause the current to flow may be obtained:

1. Chemically;
2. Mechanically;
3. Thermally.

In the first method, two dissimilar metals such as copper and zinc called *elements*, are immersed in an exciting fluid or *electrolyte*.

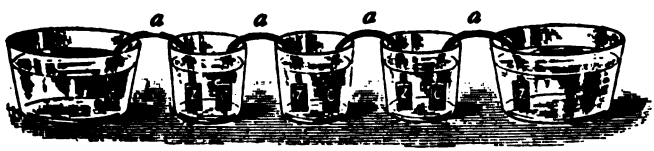


FIG. 37.—Volta's "Crown of Cups." The metallic elements C and Z each consisted of two metals, the plate C being of copper and the plate Z of zinc. They were placed, as shown, in the glass vessels, which contained salt water and ordinary water or lye. Into each vessel, except the two end ones, the copper end of one arc and the zinc end of the next were introduced, the series, however long, ending with copper dipping into the terminal vessel at one end and zinc into that at the other. The arrangement is almost exactly that of a modern one fluid primary battery.


When the elements are connected at their terminals by a wire or conductor a chemical action takes place, producing a current which flows from the copper to the zinc. This device is called a *cell*, and the combination of two or more of them connected so as to form a unit is known as a *battery*. *The word battery is frequently used incorrectly for a single cell.* That terminal of the element from which the current flows is called the *plus* or *positive pole*, and the terminal of the other element the *negative pole*.

Cells are said to be primary or *secondary* according as they generate a current of themselves, or first require to be charged from an external

source, storing up a current supply which is afterwards yielded in the reverse direction to that of the charging current.

An electric current is generated mechanically by a *dynamo*. In either case *no electricity is produced, but part of the supply already existing is simply set in motion by creating an electric pressure.*

An electric current, according to the third method, is generated directly from heat energy, as will be later explained; the current thus obtained is very feeble.

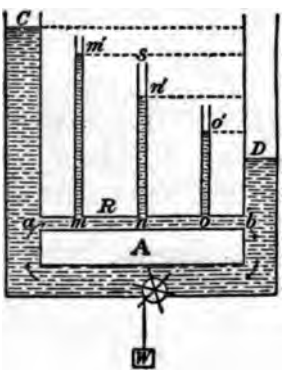

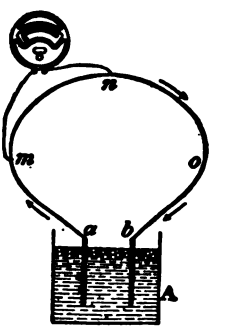


FIG. 38.—Hydrostatic analogy of fall of potential in an electrical circuit.

FIG. 39.—Showing method of connecting voltmeter to find potential difference between any two points as *m* and *n* on an electrical circuit.

Strength of Current.—It is important that the reader have a clear conception of this term, which is so often used. The exact definition of the strength of a current is as follows:

The strength of a current is the quantity of electricity which flows past any point of the circuit in one second.

Example.—If, during 10 seconds, 25 coulombs of electricity flow through *a circuit, then the average strength* of the current during that time is *2½ coulombs per second, or 2½* amperes.

Voltage Drop in an Electric Circuit.—A difference of potential exists between any two points on a conductor through which a current is flowing on account of the resistance offered to the current by the conductor.

For instance, in the electrical circuit shown in fig. 39, the potential at the point *a* is higher than that at *m*, that at *m* higher than that at *n*, etc., just as in the water circuit, shown in fig. 38, the hydrostatic pressure at *a* is greater than that at *m'*, that at *m'* greater than that at *n'*, etc. The fall in the water pressure between *m'* and *n'* (fig. 38) is measured by the water head *n's*.

In order to measure the fall in electrical potential between *m* and *n*, (fig. 39), the terminals of a volt meter are placed in contact with these points as shown. Its reading will give the difference of potential between *m* and *n*, in volts, provided that its own current carrying capacity is so small that it does not appreciably lower the potential difference between the points *m* and *n* by being touched across them; that is, provided the current which flows through it is negligible in comparison with that which flows through the conductor which already joins the points *m* and *n*.



CHAPTER IV

PRIMARY CELLS

The word "battery" is a much abused word, being often used incorrectly for "cell," as in fig. 40. Hence, careful distinction should be made between the two terms.

A battery consists of two or more cells joined together so as to form a single unit.

There are numerous forms of primary cell; they may be classified as follows:

1. According to the service for which they are designed;
2. According to the chemical features.

With respect to the first method cells are classified as:

1. Open circuit cells;

 Used for *intermittent work*, where the cell is in service for short periods of time, such as in electric bells, signaling work, and electric gas lighting. If kept in continuous service for any length of time the cell soon polarizes or "runs down," but will recuperate after remaining on open circuit for some little time.

2. Closed circuit cells.

 This type of cell is adapted to furnishing current continuously, as in telegraphy, etc.

With respect to the second method, cells are classified as:

1. One fluid;
2. Two fluid;



Ques. Describe a primary cell.

Ans. A primary cell consists of a vessel containing a liquid in which two dissimilar metal plates are immersed.

In *one fluid* cells both metal plates are immersed in the same solution. In *two fluid* cells each metal plate is immersed in a separate solution, one of which is contained in a porous cup which is immersed in the other liquid.

Ques. What name is given to the metal plates?

Ans. They are called *elements*.

Ques. What is the fluid called?

Ans. The *electrolyte* or *exciting fluid*.

The term "electropoion" is a trade name for the electrolyte employed in the Fuller cell.

Action of a Primary Cell.—The fundamental fact on which the electro-chemical generation of current depends is, that if a plate of metal be placed in a liquid there is a difference of electrical condition produced between them of such sort that the metal either takes a lower or higher electrical potential than the liquid, according to the nature of the metal and the liquid. If two different metals be placed in one electrolytic liquid, then there is a difference of state produced between them, so that, if joined by wire outside the liquid, a current of electricity will traverse the wire. This current proceeds in the liquid from the metal which is most acted upon chemically to that which is least acted upon.

Referring to fig. 41, the construction and action of a simple primary cell may be briefly described as follows:

Place in a glass jar some water having a little sulphuric or other acid added to it. Place in it separately two clean strips, one of zinc, Z, and one of copper, C. This cell is capable of *supplying a continuous* flow of electricity through a wire whose

[redacted] brought into connection with the two strips. When [redacted] nt flows, the zinc strip is observed to waste away, its [redacted]ion in fact furnishing the energy or electromotive force [redacted]o drive the current through the cell and the connecting [redacted]. The cell may therefore be regarded as a kind of chemical [redacted] in which the fuel is the zinc.

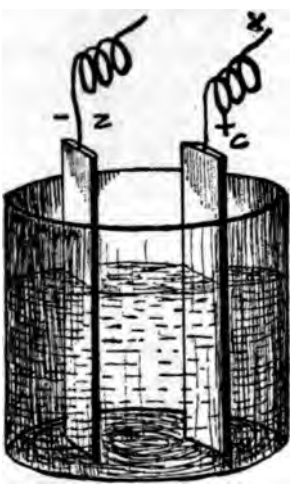


FIG. 40.—Simple primary cell. It consists of two dissimilar metal plates (such as copper and zinc which are called the *elements*), immersed in the *electrolyte* or exciting fluid contained in the glass jar.

Ques. How are the positive and negative elements of a primary cell distinguished?

Ans. The plate attacked by the electrolyte is the negative element, and the one unattacked the positive element.

Chemical Changes; Polarization.—The chemical changes which take place in a simple cell, consisting of zinc and copper *elements in an electrolyte of dilute* sulphuric acid, may be briefly

described as follows: When the two elements are connected and the current commences to flow, the sulphuric acid acts on the surface of the zinc plate and forms sulphate of zinc. The formation of this new substance necessitates the liberation of some of the hydrogen contained in the sulphuric acid, and it will be found that bubbles of free hydrogen gas speedily appear on the surface of the negative element, that is, on the copper plate.

While the zinc is being dissolved to form zinc sulphate, hydrogen gas is liberated from the sulphuric acid.

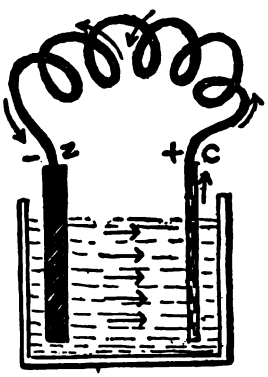


FIG. 41.—Simple primary cell with circuit closed, showing direction of the current.

Some bubbles of the gas rise to the surface of the electrolyte and so escape into the air, *but much of it clings to the surface of the copper element which thus gradually becomes covered with a thin film of hydrogen.*

Partly on account of the decreased area of copper plate in contact with the electrolyte, and partly because the hydrogen tends to produce a current in the opposite direction, the useful *electrical output* becomes considerably diminished and the cell *is said to be polarized.* This state of affairs may be rectified

by stirring up the electrolyte, or by shaking the cell, so as to assist the hydrogen bubbles to detach themselves from the surface of the copper plate and make their way to the atmosphere through the electrolyte. This, however, is only a temporary remedy, as the polarized condition will soon be reached again, and a further agitation of the cell will be necessary. Hence, a simple cell of this kind is not desirable for practical work, and it must be modified to adapt it to constant use.

When the sulphuric acid in a cell acts in the zinc element and produces sulphate of zinc, a certain anount of work is done which is manifested partly in the form of useful electric energy, and partly as heat which warms the electrolyte and which is thereby lost for all practical purposes.

Ques. If the zinc and copper electrodes of a simple cell be not connected externally what changes take place within the cell?

Ans. The zinc plate immediately becomes strongly charged with negative electricity, and the copper plate weakly so. As long as the plates remain unconnected, and the zinc is pure, no further action takes place.

Ques. If the electrodes be connected externally what happens?

Ans. If the plates be connected by a wire outside the electrolyte, the tendency which dissimilar electrical charges have to neutralize one another causes a flow of negative electricity through the wire from zinc to copper, and a positive flow in the opposite direction. The " static " charge being thus disposed of, a fresh charge is given to the plates by the action of the acid, which commences to dissolve the zinc. As long as the wire connects the copper and zinc plates, the acid will continue its action *on the zinc until either acid* or zinc is exhausted.

The reader may ask: how can there be a positive flow when both plates are negatively electrified?

An analogy is the best way to make this point clear: Imagine two equal vessels, from each of which the air has been partially exhausted, but from one (A) 10 times as much air has been taken as from the other (B). Connect A and B by a tube. Now, although both vessels have less than the atmospheric pressure, that is, both have "negative" pressures, yet a current of air will flow from B to A until the pressures in each are equalized; that is, until both have equal "negative charges" of air.

There is a second important effect of the acid solution or electrolyte in a cell. If pure sulphuric acid were used, the first action or production of an electrical charge on the zinc plate would be the same, but when the plates were joined by the wire the current would soon cease. The reason for this lies in the fact that the sulphate of zinc, which is the compound produced by the acid plus the zinc, being insoluble in pure undiluted sulphuric acid, remains on the surface of the zinc plate. The coating of sulphate of zinc thus formed also operates as a protective agent, and no further electrical charge can be induced until it is removed. The addition of water to the acid has the effect of allowing the sulphate of zinc to dissolve, and the zinc plate is left free for further action.

Ques. What governs the rate of current flow of a primary cell?

Ans. The size of the elements and their proximity.

Effects of Polarization.—The film of hydrogen bubbles affects the strength of the current of the cell in two ways:

1. It weakens the current by the increased *resistance* which it offers to the flow, for bubbles of gas are bad conductors;

2. *It weakens the* current by setting up an opposing *electromotive force.*

Hydrogen is almost as oxidizable a substance as zinc, especially when freshly deposited (in the "nascent" state), and is electropositive; hence, the hydrogen itself produces a difference of potential, which would tend to start a current in the opposite direction to the true zinc-to-copper current. It is therefore an important matter to abolish this polarization, otherwise the currents furnished by batteries would not be constant.

Methods of Depolarizing.—One of the chief aims in the arrangement of the numerous cells which have been devised is to avoid polarization. The following are the methods usually employed:

1. Chemical methods;
 - *a*. Oxidation of the hydrogen by potassium bichromate and by nitric acid.
 - *b*. Substitution of the hydrogen by some other substance which does not give a counter electromotive force of polarization; for instance, in the Daniell cell by replacement of the copper in copper sulphate by the hydrogen, the copper being deposited on the positive pole.

2. Electro-chemical means;

 It is possible by employing double cells, to secure such action that some solid metal, such as copper, shall be liberated instead of hydrogen bubbles, at the point where the current leaves the liquid. This electro-chemical exchange obviates polarization.

3. Mechanical methods.
 - *a*. Agitation of the liquid or of the positive electrode, in order to prevent the accumulation of hydrogen thereon.
 - *b*. Corrugating or roughing the positive electrode, as in the Smee cell. This causes the hydrogen gas to form in large bubbles which rise to the surface more rapidly than the small bubbles which form on a smooth electrode.

In the simplest form of cell, as zinc, copper, and dilute sulphuric acid, no attempt has been made to prevent the evil of polarization, hence, it will quickly polarize when the current is closed for any length of time, and may be classified as an open circuit cell.

When polarization is remedied by chemical means, the chemical added is one that has a strong affinity for hydrogen and will combine with it, thus preventing the covering of the negative plate with the hydrogen gas.



FIGS. 42 and 43.—Carbon cell and carbon cylinder. Carbon possesses a natural power to prevent a limited amount of polarization by absorbing the hydrogen gas coming from the zinc rod; hence it is used in various shapes for open circuit cells, which gives rise to as many different names, such as *Samson, Hercules, Law, National, Standard,* etc. In all these types of cell, sal-ammoniac and zinc are used, and by corrugating the carbon, fluting it, or making concentric cylinders, special merits are obtained in each case. The carbon element is usually made in the form of a porous cup, filled with oxide of manganese to prevent polarization, and then sealed. The zinc rod is inserted through a porcelain insulator. About 4 to 6 ounces of sal-ammoniac are generally used for cells of ordinary size. The salt is placed in the jar, water poured in until it is about two-thirds full, and then stirred till all the salt is dissolved. When the carbon cylinder is inserted, the solution should be within 1½ inches of the top of the jar. The electromotive force is from 1.0 to 1.4 volts for the different forms of carbon cell.

Ques. What is a depolarizer?

Ans. A substance employed in some types of cell to combine *with the hydrogen* which would otherwise be set free at *the positive electrode* and cause polarization.

The chemical used for this purpose may be either in a *solid* or *liquid* form, which gives rise to several types of cell, such as cells with a single fluid, containing both the acid and the depolarizer, cells with a single exciting fluid and a solid depolarizer, and cells with two separate fluids.

In the two fluid cell, the zinc is immersed in the liquid (frequently dilute sulphuric acid) to be decomposed by the action upon it, and the negative plate is surrounded by the liquid depolarizer, which will be decomposed by the hydrogen gas it arrests, thereby preventing polarization.

In *open circuit cells* polarization does not have much opportunity to occur, since the circuit is closed for such a short period of time; hence, these cells are always ready to deliver a strong current when used intermittently.

In *closed circuit cells* polarization is prevented by chemical action, so that the current will be constant and steady till the energy of the chemicals is expended.

Ques. What is a depolarizer bag?

Ans. A cylinder of hemp or other fabric used in place of a porous pot in some forms of Leclanche cell, and also as a support for the depolarizing mass in some forms of dry cell where the electrolyte is of a thin gelatinous nature.

Volta's Contact Law.—When metals differeing from each other are brought into contact, different results are obtained, both as to the kind of electrification as well as the difference of potentials.

Volta found that iron, when in contact with zinc, becomes negatively electrified; the same takes place, but somewhat weaker, when iron is touched with lead or tin. When, however, iron is touched by copper or silver, it becomes positively electrified. Volta, Seebeck, Pfaff, and others have investigated the behavior of many metals and alloys when in contact with each other.



The following lists are so arranged that those metals first each list become positively electrified when touched by any tak rank after them:

CONTACT SERIES OF METALS

According to Volta.	*According to Pfaff.*	
+ zinc	+ zinc	copper
lead	cadmium	silver
tin	tin	gold
iron	lead	uranium
copper	tungsten	tellurium
silver	iron	platinum
gold	bismuth	— palladium
graphite	antimony	
— manganese ore		

Volta laid down a law regarding the position of the metals his table which may be stated as follows:

The difference of potential between any two metals is equal to sum of the differences of potentials of all the intermediate memb of the series.

Hence, it is immaterial for the total effect whether the fi and the last are brought into contact directly, or whether t contact is brought about by means of all or any of the int mediate metals.

Volta's law further asserts that when any number of metals are brou into contact with each other, but so that the chain closes with the m *with which it was* begun, the total difference must be zero.

Laws of Chemical Action in the Cell.—There are two simple laws of chemical action in the cell:

1. *The amount of chemical action in a cell is proportional to the quantity of electricity that passes through it.*

 One coulomb of electricity in passing through the cell liberates .000010352 of a gramme of hydrogen, and causes .00063344 of a gramme of zinc to dissolve in the acid.

2. *The amount of chemical action is equal in each cell of a battery connected in series.*

Requirements of a Good Cell.—The several conditions which should be fulfilled by a good cell are as follows:

1. Its electromotive force should be high and constant;
2. Its internal resistance should be small;
3. It should be perfectly quiescent when the circuit is open;
4. It should give a constant current, and therefore must be free from polarization, and not liable to rapid exhaustion;
5. It should be easily cared for, and if possible, should not emit corrosive fumes;
6. It should be cheap and of durable materials.

Single and Two Fluid Cells.—The distinction between a single and a two fluid cell has already been given. The single fluid cell of Volta with its zinc and copper plates represents the simplest form of primary cell.

In the *two fluid cell*, the positive (zinc) plate is immersed in the exciting liquid (usually dilute sulphuric acid) and is decomposed by the action upon it, while the negative plate is placed in the liquid depolarizer which is decomposed by the hydrogen arrested by it, thus preventing polarization.

In some forms of cell, the two liquids are separated by a porous partition of *unglazed earthenware*, which, while it prev-

the liquids mixing except very slowly, does not prev the passage of hydrogen and electricity.

Complete depolarization is usually obtained also in si fluid cells, having in addition a depolarizing solid body, sucl oxide of manganese, oxide of copper, or peroxide of lead contact with the carbon pole. Such cells really do not bel





FIGS. 44 and 45.—Leclanche cell and porous cup. This very common form of cell example of the single fluid type, with a solid depolarizer surrounding the negative eler the latter is generally carbon, the positive element being zinc. The liquid used is a s solution of ammonium chloride, commonly known as sal-ammoniac, and which reser table salt. In the porous cup type of cell, a carbon slab is placed in the porous cup, a surrounded by a mixture of small pieces of carbon and manganese dioxide, the top l covered by means of pitch, leaving one or two small holes for air and gas to pass thr The depolarizer will take care of a limited amount of the hydrogen produced whe cell is on closed circuit, but if the circuit be closed for any length of time polariz occurs. The cell is thus of the open circuit class, and will furnish a good current v it is required only intermittently. Zinc is dissolved only when the cell is being This type of cell, or its modification, is used for gas lighting and bell work. Th requires very little attention. Water must be added as the solution evaporates, an zinc rod replenished when necessary. The electromotive force is about 1.48 volts the internal resistance about 4 ohms.

to the single fluid cells, and are considered in the two fluid class.

A few examples of single and double fluid primary cells will now be described.

The Leclanche Cell.—This cell was invented by Leclanche, a French electrician, and was the first cell in which sal-ammoniac was used. This form of cell, as shown in fig. 45, is in general use for electric bells, its great recommendation being that, once charged, it retains its power without attention for considerable time.

Two jars are employed in its construction; the outer one is of glass, contains a zinc rod, and is charged with a solution of ammonium chloride, called sal-ammoniac.

The inner jar is of porous earthenware, containing a carbon plate, and is filled with a mixture of manganese peroxide and broken gas carbon. When the carbon plate and the zinc rod are connected, a steady current of electricity is set up, the chemical action which takes place being as follows: *the zinc becomes oxidized by the oxygen from the manganese peroxide, and is subsequently converted into zinc chloride by the action of the sal-ammoniac.*

After the battery has been in continuous use for some hours, the manganese becomes exhausted of oxygen, and the force of the electrical current is greatly diminished; but if the battery be allowed to rest for a short time, the manganese obtains a fresh supply of oxygen from the atmosphere, and is again fit for use.

After about 18 months work, the glass cell will probably require recharging with sal-ammoniac, and the zinc rod may also need renewing; but should the porous cell get out of order, it is better to get a new one than to attempt to 're-



The directions for setting up a Leclanche cell are as follows:

1. Place in the glass jar six ounces of sal-ammoniac, and pour in water until the jar is one-third full, then stir thoroughly.
2. Place the porous cup in the solution, and if necessary add water until it rises to within 1½ inches of the top of the porous cup.
3. Put the zinc rod in place and set the cell away (not connected up), for about 12 hours, so as to allow the liquid to thoroughly soak into the porous cup. This will lower the level of the liquid to about one-third the height of the jar. The cell will then be ready for use. As the level of the liquid is lowered by evaporation, it should be maintained at the stated height by adding water.

The Leclanche cell is adapted to open circuit work, being extensively used for ringing electric bells.

The objections to the Leclanche cell are:


1. Rapid polarization;
2. High internal resistance due to porous pot;
3. Restricted space for electrolyte causing rapid lowering of level of liquid by evaporation;
4. Eating away of the zinc rod at the surface of the liquid, rendering the rod useless before the lower part is consumed.

Fuller Bichromate Cell.—In the bichromate cells or the chromic acid cells, bichromate of soda, or bichromate of potassium, is used for the depolarizer, water and sulphuric acid being added for attacking the zinc.

The Fuller cell is of the two fluid type. A pyramidal block of zinc at the end of a metallic rod covered with guttapercha is placed in the bottom of a porous cup containing an ounce of mercury. The cup is then filled with a very dilute solution of sulphuric acid or water and placed in a jar of glass or earthenware containing the bichromate solution and the carbon plate. The diffusion of the acid through the porous cup is sufficiently rapid to attack the zinc, which being well amalgamated, prevents local action; while the hydrogen passes through the porous cup *and combines with* the oxygen in the bichromate of potassium.

This type of cell has an electromotive force of 2.14 volts, and is suited to open circuit, or semi-closed circuit work. The directions for setting up a Fuller cell are as follows:

1. To make the "electropoion" fluid, mix together one gallon of sulphuric acid and three gallons of water, and in a separate vessel, dissolve six pounds of bichromate of potash in two gallons of boiling water; then thoroughly mix together the two solutions.
2. Immerse the zinc in a solution of dilute sulphuric acid, and then in a bath of mercury, and rub it with a brush or cloth so as to reach all parts of the surface.
3. Pour into the porous cell one ounce (a tablespoonful) of mercury, and fill the porous cell with water up to within two inches of the top.
4. Place the porous cell and the carbon plate in the glass jar, as in fig. 46, and fill glass jar to within about three inches of the top with a mixture of three parts of electropoion fluid to two parts of water.

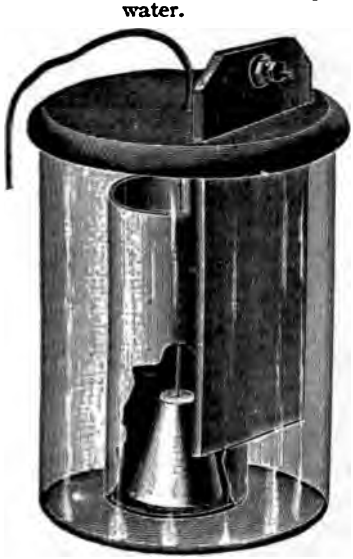



FIGS. 46 and 47.—The telephone standard and compound forms of Fuller cell. The type shown in fig. 46 is especially adapted to long distance telephoning, and that shown in fig. 47 to incandescent lamps, motors, nickel and other electroplating. The Fuller cell is of the double fluid variety and has the advantage over the Grenet type, in that the zinc is always kept well amalgamated and does not require removal from the solution. The Fuller cell is suitable for open and semi-closed circuit work; its electromotive force is about 2.14 volts.

5. The zinc should be lifted out occasionally and the sulphate washed off.
6. The supply of mercury in the porous cell should be maintained, so as to have the zinc always well amalgamated.
7. To renew, clean all deposits from carbon plate and zinc, and set up with fresh solution.

The Edison Cell.—This is a single fluid cell with a solid depolarizer, as shown in fig. 48, and is well adapted for use on closed circuits.

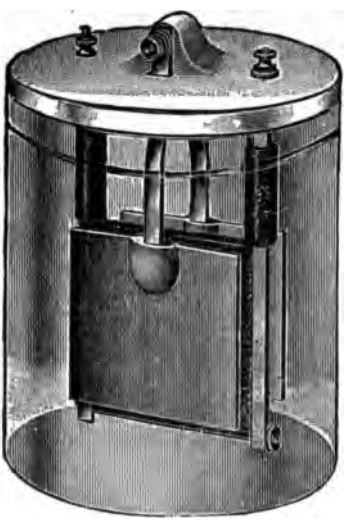


FIG. 48.—Edison cell, type R R. The electrolyte used is caustic soda, the positive element zinc, and the negative element copper oxide. The Edison cell is suitable for large stationary gas engine ignition, railroad crossing signals, electroplating, fire alarms, telephone circuits, etc.

The positive element is zinc, and the negative element black *oxide of copper.* The exciting fluid is a solution of caustic pot*ash. The black oxide* of copper plates are suspended from the *cover of the jar by a* light framework of copper, one end of

which forms the positive pole of the battery. A zinc plate is suspended on each side of the copper oxide element and kept from coming in contact with the latter by means of vulcanite buttons.

When the cell is in action, the water is decomposed, and the oxygen thus liberated combines with the zinc and forms oxide of zinc, which combines with the potash to form a double salt of zinc and potash. The last combination dissolves as rapidly as it is formed. The hydrogen liberated by the decomposition of the water reduces the copper oxide to pure metallic copper. It is highly important that the copper oxide plates be completely submerged in the solution of caustic potash, and that heavy paraffin oil be poured on top of the solution to the depth of about ¼ of an inch to exclude the air. If oil be not used, the formation of creeping salts will reduce the life of the battery fully two-thirds. The battery has a low electromotive force, about 0.7 of a volt, but as the internal resistance is also very low, quite a large current can be drawn from the cell.

The *Bunsen Cell*, shown in figs. 49 and 50, is a two fluid cell constructed with zinc and carbon electrodes. The negative plate is carbon, the positive plate amalgamated zinc. The excitant is a dilute solution of sulphuric acid. The top part of the carbon is sometimes impregnated with paraffin (to keep the acid from creeping up).

The force of the Bunsen cell increases after setting up for about an hour, and the full effect is not attained until the acid soaks through the porous cell. Carbons are not affected and last any length of time. The zinc is slowly consumed through the mercury coating.

Grenet Bichromate Cell.—In this cell, as shown in figs. 49 and 50, the *positive element is zinc* and the negative element carbo

The electrolyte is a solution of bichromate of potash in a mixture of sulphuric acid and water.

The cell consists of a glass bottle containing the electrolyte and fitted with a lid from which the elements are supported. There is a zinc plate in the center and a carbon plate on each





FIGS. 49 and 50.—American and French forms of Grenet cell. The elements are zinc and carbon. In the Grenet cell, a zinc plate is suspended by a rod between two carbon plates, so that it does not touch them, and when the cell is not in use the zinc is withdrawn from the solution by raising and fastening the rod by means of a set screw, as the acid attacks the zinc when the cell is on open circuit. This cell has an electromotive force of over 2 volts at first, and gives a strong current for a short time, but the liquid soon becomes exhausted, as will be noted by the change in the color of the solution from an orange to a dark red, and must be replenished. The zinc should be kept well amalgamated and out of the solution except when in use. It is a good type of cell for experimental work. To make the electrolyte take 3 ounces of finely powdered bichromate of potash and 1 pint of boiling water; stir with a glass rod and after it is cool, add slowly, stirring all the time, 3 ounces of sulphuric acid. The electrolyte may also be prepared as follows: take 4 ounces of bichromate of soda, 1¼ pints of boiling water, and 3 ounces of sulphuric acid.

side. The two carbon plates are connected to the same terminal, thus forming a large negative surface, and the zinc plate *to a terminal on the* top of the brass rod to which it is attached.

This rod slides through a hole in the lid so that the zinc plate can be lifted out of the electrolyte when the cell is not at work, thus preventing wasteful consumption of zinc and of the electrolyte. Bichromate cells give a strong current, the electromotive force of a single cell being 2 volts.

Daniell Cell.—This is one of the best known and most widely used forms of primary cell. It is a double fluid cell, composed of an inner porous vessel containing an electrolyte of either



FIG. 51.—The Bunsen cell. This is a two fluid cell and has a bar of carbon immersed in strong nitric acid contained in a porous cup. This cup is then placed in another vessel, containing dilute sulphuric acid, and immersed in the same liquid, is a hollow cylindrical plate of zinc, which nearly surrounds the porous cup. The hydrogen, starting at the zinc, traverses by composition and recomposition, the sulphuric acid; it then passes through the porous partition, and enters into chemical action with the nitric acid, so that none of it reaches the carbon. Water is produced by this action, which in time dilutes the acid, and orange colored poisonous fumes of nitric oxide rise from the battery. If the nitric acid first be saturated with nitrate of ammonia, the acid will last longer and the fumes be prevented. Strong sulphuric acid cannot be used in any battery; one part of sulphuric acid is generally added to 12 parts by weight, or 20 by volume, of water. *Grove* used a strip of *platinum instead of carbon* in his cell. A solution of bichromate of potassium is frequently *substituted* for the nitric acid in the porous cup, thereby avoiding *disagreeable fumes. Bunsen's and* Grove's cells produce powerful and constant *currents, and are well adapted for experiments,* but they require frequent attention, and are *expensive, so that they are little used* for work of long duration. The electromotive force *of these cells is from 1.75 to 9.51* volts.

dilute sulphuric acid or dilute zinc sulphate solution, and an outer vessel containing a saturated solution of copper sulphate.

A zinc rod is placed in the inner electrolyte, and a thin plate of sheet copper in the outer electrolyte. Sometimes this arrangement of the elements is modified, the outer vessel being made of copper and serving as the copper plate. This would then contain the copper sulphate solution, while the zinc sulphate and the zinc rod would be contained in the porous pot as before.

The chemical reactions which take place in a Daniell cell are as follows:

> The zinc dissolves in the dilute acid, thus producing zinc sulphate, and liberating hydrogen gas. The free hydrogen passes through the walls of the porous pot, but when it reaches the copper sulphate solution it displaces some of the copper therefrom, and combines with this solution, forming sulphuric acid. The copper, which is thus set free, is deposited on the surface of the copper plate. In this way polarization is avoided, and a practically constant current is obtained.
>
> When the zinc sulphate solution is employed in place of dilute acid, a similar series of chemical reactions occur, except that the zinc is liberated instead of hydrogen.

Daniell cells are used especially for electroplating, electrotyping and telegraphic work. The electromotive force of a single cell is 1.079 volts.

Directions for Making a Daniell Cell.—The simple Daniell cell shown in fig. 52 may be easily made as follows: The outer vessel A, consists of a glass jar (an ordinary glass jam jar will do) containing a solution of sulphuric acid (1 part in 12 to 20 parts of water), and a zinc rod B.

Inside the jar is placed a porous pot C containing a strip of *thin* sheet copper D, and a saturated solution of sulphate of *copper (also called* " blue stone " and " blue vitrol "). *The zinc is preferably* of the Leclanche form, which will be

found to be cleaner, more durable, and cheaper than a zinc sheet. The porous pot should be dipped in melted paraffin wax, both top and bottom, to prevent the solution mingling too freely and "creeping." A few crystals of copper sulphate are placed in the pot as shown.

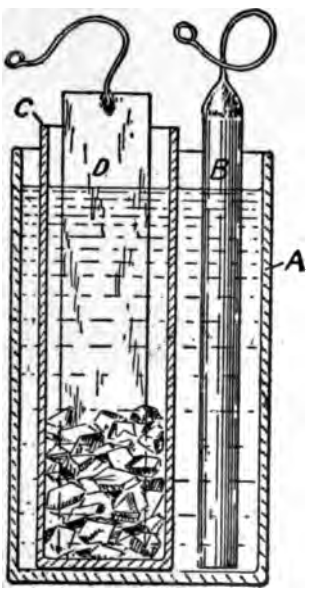


FIG. 52.—Simple Daniell cell for closed circuit work. To maintain a constant current for an indefinite time, it is only necessary to maintain the supply of copper crystals and zinc. The cell as shown in the figure is easily made by following the direction given in the accompanying text.

In mixing the sulphuric acid and water, *the acid should be added to the water—never the reverse.* Zinc sulphate is sometimes used instead, as it reduces the wasteful consumption of the zinc, but it should be pure.

With care the cell will last for weeks. When it weakens or *"runs down," an addition* of sulphuric acid to the outer jar and

a few more crystals placed in the porous pot will put the cell in good condition.

Gravity Cells.—In a two liquid cell, instead of employing a porous cell to keep the two liquids separate, it is possible, where one of the liquids is heavier than the other, to arrange that the heavier liquid shall form a stratum at the bottom of the cell,



FIG. 53.—Daniell gravity cell, "crowfoot" pattern. This is a two fluid cell in which gravity instead of a porous cup is depended upon to keep the liquids separate. The two solutions consist of copper sulphate and dilute sulphuric acid, the elements being made of zinc and copper.

the lighter floating upon it. Such arrangements are called *gravity cells;* but the separation is never perfect, the heavy liquid slowly diffusing upwards.

Daniell Gravity Cell.—In this cell, shown in fig. 53, the same elements are used as in the ordinary Daniell cell, but the porous pot is dispensed with, the two solutions being separated by the action of gravity as explained in the preceding paragraph.

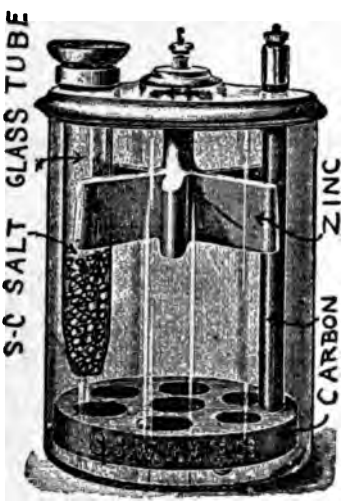


FIG. 54.—Partz acid gravity cell. In this form of cell, the electrolyte which surrounds the zinc is either magnesium sulphate or common salt. The depolarizer is a bichromate solution which surrounds the perforated carbon plate located in the bottom of the jar. A vertical carbon rod fits snugly into the tapered hole in the carbon plate, and extends through the cover forming the positive pole. The depolarizer, being heavier than the electrolyte, remains at the bottom of the jar, and the two liquids are thus kept separate. This depolarizer is placed on the market in the form of crystals, known as sulpho-chromic salt, made by the action of sulphuric acid upon chromic acid. When dissolved, its action is similar to that of the chromic acid solution. After the cell has been set up with everything else in place, the crystals are introduced into the solution, near the bottom of the jar, through the vertical glass tube shown, and slowly dissolve and diffuse over the surface of the carbon plate. When the cell current weakens a few tablespoonfuls of the salt introduced through the tube will restore the current to its normal value. The cell should remain undisturbed to prevent the solution from mixing. Its electromotive force is from 1.9 to 2 volts, and the 6 in. x 8 in. size has an internal resistance of about .5 ohm. Since the depolarizer is quite effective, the cell may be used on open or closed circuit work.

The copper sulphate solution, being the heavier of the two, sets at the bottom of the battery jar, while the dilute sulphuric acid remains at the top. To suit this arrangement the copper and zinc elements are located as shown, the copper elements

being at the bottom, and the zinc element, shaped like a crow's foot (hence the name "crowfoot cell") is suspended at the top.

The absence of the porous pot decreases the internal resistance, but the electromotive force is the same as in the ordinary type of Daniell cell.



FIG. 55.—Wheelock cell; the elements are carbon and zinc. To set up, place the grid in the bottom of the jar and fill its two troughs each about half full of mercury. Place the porous cell in position on the grid so that it sits perfectly upright, resting in the recess of the latter. The zincs stand with lower ends resting in mercury in the troughs of the grid. Into the porous cell, to a height of *only two thirds* full, pour solution consisting of equal parts water and sulphuric acid, by measure. Add to this ½ pound nitrate soda, 1 ounce chromic acid. This solution may be made up in the above proportion and kept in covered receptacle in any desired quantity, ready for use. In the outer jar for 6 x 8 size, 2½ pints of water, and ½ gill sulphuric acid, 1 part sulphuric acid to 20 parts water, or as much sulphuric acid as it will take without boiling. When a charge becomes exhausted it may be renewed by adding sulphuric acid and salts in the proportions given above, after drawing out with syringe enough of the old solutions to make room for the additions, but the best action is obtained with entirely new solutions. Zincs must be *kept thoroughly* amalgamated by keeping a good supply of mercury in the troughs.

When a current is produced by a Daniell cell:

1. Copper is deposited on the copper plate;
2. Copper sulphate is consumed;
3. The sulphuric acid remains unchanged in quantity;
4. Zinc sulphate is formed;
5. Zinc is consumed.

If, however, the copper sulphate solution be too weak, the water is decomposed instead of the copper sulphate, and hydrogen is deposited on the copper plate. This deposit of hydrogen lowers the voltage, hence care should be taken to maintain an adequate supply of copper sulphate.

The voltage of a Daniell cell varies from about 1.07 volt to 1.14 volt, according to the density of the copper sulphate solution and the amount of zinc sulphate present in the dilute sulphuric acid.


"Dry" Cells.—It is often necessary to use cells in places where there is considerable jarring or motion, as for automobile or marine ignition. The ordinary cell is not well adapted to this service on account of the liability of spilling the electrolyte, hence, the introduction of the so called dry cell.

A dry cell is composed of two elements, usually zinc and carbon, and a liquid electrolyte. A zinc cup closed at the bottom and open at the top forms the negative electrode; this is lined with several layers of blotting paper or other absorbing material.

The positive electrode consists of a carbon rod placed in the center of the cup; the space between is filled with carbon—ground coke and dioxide of manganese mixed with an absorbent material. This filling is moistened with a liquid, generally sal-ammoniac. The top of the cell is closed with pitch to prevent leakage and evaporation. A binding post for holding the wire connections is attached to each electrode and each cell is placed in a paper box to protect the zincs of adjacent cells from coming into contact with each other when finally connected together to form a battery.

Points Relating to Dry Cells.—The following instructions on the care and operation of dry cells should be carefully noted and followed to get the best results:



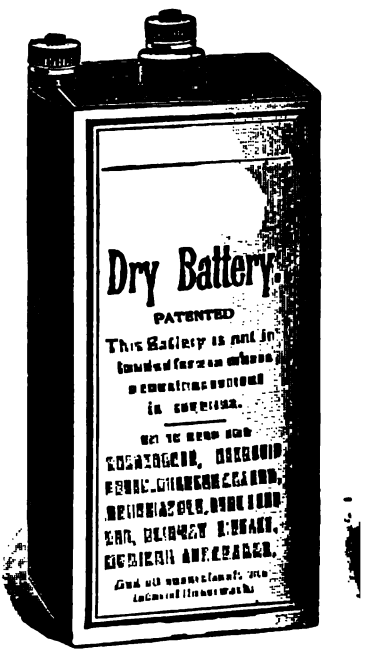

FIGS. 56 and 57.—Round and rectangular types of the so called "dry" cell.

1. In renewing dry cells (or any other kind of cell), a greater number should never be put in series than was originally required to do the work, because the additional cells increase the voltage beyond that required, which causes more current than is necessary to flow through the coil. This increased current flow shortens the life of the battery.


2. In connecting dry cells in places where there is vibration, heavy copper wire should not be used, because vibration will cause it to break.

3. Water should not be allowed to come in contact with the paper *covers of the cells* because they form the insulation, hence, when moist,

current will leak across from one cell to another, resulting in running down the battery.

4. Dry cells will deteriorate when not in use, making it necessary to renew them about every sixty days. The reason dry cells deteriorate is because the moisture evaporates. Freezing, exposure to heat, and vibration which loosens the sealing, causes the evaporation.

5. Weak cells can be strengthened somewhat by removing the paper jacket, punching the metal cup full of small holes, and then placing in a weak solution of sal-ammoniac, allowing the cells to absorb all they will take up. This is only to be recommended in cases of emergency when they are hard to get.

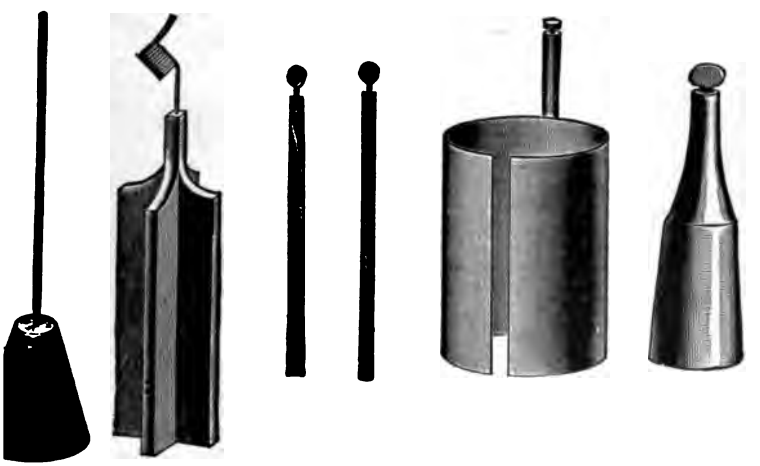

s. 58 to 63.—Various zincs; fig. 58 Fuller; fig. 59 Daniel; fig. 60 Leclanche square; fig. 61 Leclanche round; fig. 62 Sampson; fig. 63, bottle.

6. The average voltage of a dry cell when new is one and one-half volts, while the amperage ranges from about twenty-five to fifty amperes according to size.

7. A dry cell when fresh should show from 20 to 25 amperes when tested; the date of manufacture should also be noted as fresh cells are most efficient.

8. Dry cells should be tested with an ammeter, care being taken to *do it quickly as the ammeter being* of a very low resistance short circuits

the cell. A volt meter is not used in testing because, while the cells are not giving out current, their voltage remains practically the same, and a cell that is very weak will show nearly full voltage. When no ammeter is at hand, the battery current may be tested by disconnecting the end of one of the terminal wires and snapping it across the binding post of the other terminal; the intensity of the spark produced will indicate the condition of the battery.

Points Relating to the Care of Cells.—To get the best results from primary cells, they should receive proper attention and be maintained in good condition. The instructions here given should be carefully followed.




FIGS. 64 to 66: Various carbons; fig. 64 Cylindrical form, fig. 65 Calland star; fig. 66, wheel.

Cleanliness.—In the care of batteries, cleanliness is essential in order to secure best results. Zincs and coppers should be thoroughly cleaned every time a cell is taken out of use. The zinc, after being thoroughly cleaned, should be rubbed with a little mercury. This prevents local action. Porous cups should be soaked in clean water four or five hours and then wiped dry.

The terminals of each cell should be thoroughly cleansed and *scraped bright so as* to get good contact of the connecting wires *and thus avoid* extra resistance in the circuit.

ırating the Elements.—Obviously the positive and ⁄e elements of a cell must not be in contact within the g fluid; they should be separated by a space of ⅜ to ½ In the case of cells without porous cups, periodic atten- ıust be given to ensure this condition being maintained.

eping.—As evaporation of the electrolyte takes place ell, it increases in strength, and crystals are left on the ɔf the jar previously wetted by the solution, the action

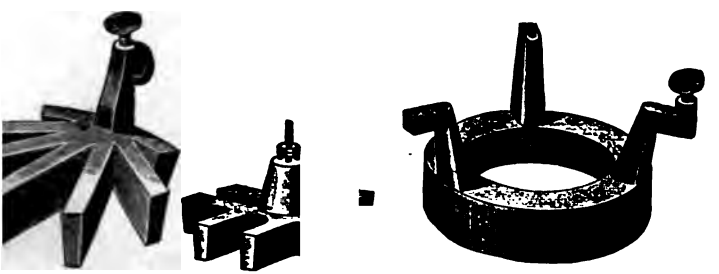


ı 67 to 69.—Variour zincs: fig. 67 Crowfoot; fig. 68 Lockwood; fig. 69 fire alram.

very marked when the solution is a saturated one. The between these crystals and the side of the jar acts as a ɛr of capillary tubes, and draws up more liquid, which evaporates and deposits crystals above the former ones. ıt finally the film of crystals passes over the edge of the ıd forms on the outside, thus making a kind of syphon draws off the liquid. This action may, to a great extent, ɛvented by warming the edges of the glass, or stoneware, ınd of the porous pots, before the cells are made up, and ıg them *while warm into* some paraffin wax melted in

warm oil, a precaution that should always be carried out when a dense solution of zinc sulphate is employed in the cell.

Amalgamated Zinc.—To "amalgamate" a piece of zinc, dip it into dilute sulphuric acid to clean its surface, then rub a little mercury over it by means of a piece of rag tied on to the end of a stick, and lastly, leave the zinc standing for a short time in a dish to catch the surplus mercury as it drains off.

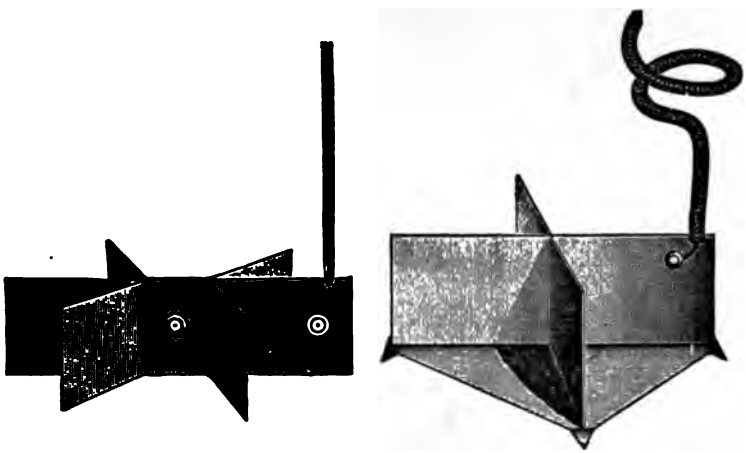

FIGS. 70 and 71.—Two forms of copper element: fig. 70, regular form for crowfoot cell; fig. 71, signal pan bottom copper.

The action of the amalgamated zinc is not well understood; by some it is considered that amalgamating the zinc prevents local currents by the amalgam *mechanically* covering up the impurities on the surface of the zinc and preventing their coming into contact with the liquid. By others it is thought that *amalgamating the zinc* protects it from local action by causing *a film of hydrogen gas* to adhere to it. This theory is based on

the fact that while no action takes place when amalgamated zinc is placed in dilute sulphuric acid at ordinary atmospheric pressure, the creation of a vacuum above the liquid causes a rapid evolution of hydrogen, which, however, stops on the readmission of the air.

Amalgamating a zinc causes it to act as a somewhat more positive substance than before, therefore the voltage of a cell containing amalgamated zinc is slightly higher than that of a cell constructed with unamalgamated zinc.




FIG. 72.—Diagram of a series battery connection: four cells are shown connected by this method. If the cell voltage be one and one-half volts, the pressure between the (+) and (−) terminals of the *battery* is equal to the product of the voltage of a single cell multiplied by the number of cells. For four cells it is equal to six volts.

The addition of a very small amount of zinc to mercury causes the mercury to act as if it were zinc alone, arising perhaps from the amalgam having the effect of bringing the zinc to the surface.

Battery Connections.—There are three methods of connecting cells to form a battery; they may be connected:

1. In series;
2. In parallel;
3. In series multiple.

A series connection consists in joining the positive pole of one cell to the negative pole of the other, as shown in fig. 72; this adds the voltage of each cell.

Thus, connecting in series four cells of one and one-half volts each *will give a total of six volts.*

Fig 73 illustrates a parallel or multiple connection; this is made by connecting the positive terminal of one cell with the positive terminal of another cell and the negative terminal of the first cell with the negative terminal of the second cell.




FIG. 73.—Diagram of a multiple or parallel connection. When connected in this manner the voltage of the battery is the same as that of a single cell, but the current is equal to the amperage of a single cell multiplied by the number of cells. Thus with 1½ volt 15 ampere dry cells, the combination or battery connected as shown would give 4 × 15 = 60 amperes at a pressure of 1½ volts.

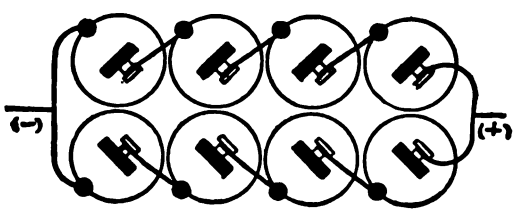


FIG. 74—Diagram of a series multiple connection. Two sets of cells are connected in series, and the two batteries thus formed, connected in parallel. The pressure equals the voltage of one cell, multiplied by the number of cells in one battery, and the amperage, that of one cell multiplied by the number of batteries. This form of connection is objectionable unless all the cells be of equal strength. If old cells be placed on one side and new cells on the other, current will flow (as in fig. 75) from the stronger through the weaker until the pressure of all the cells thus becomes equal. This process therefore wastes some of the energy of the strong cells.

A paralled or multiple connection adds the amperage of each cel ; that is, the amperage of the battery will equal the sum of the amperage of each cell.

For instance, four cells of twenty-five amperes each would give a total of *one hundred amperes* when connected in parallel.

A series multiple connection, fig. 74, consists of two series sets of cells connected in parallel. In series multiple connections the voltage of each set of cells or battery must be equal, or the batteries will be weakened, hence each battery of a series multiple connection should contain the same number of cells.

The voltage of a series multiple connection is equal to the voltage of one cell multiplied by the number of cells in one battery, and the amperage is equal to the amperage of one cell multiplied by the number of batteries.

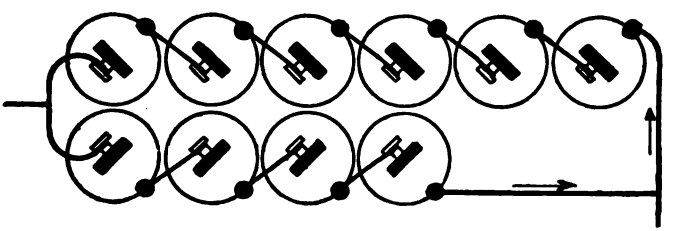


FIG. 75.—Diagram to illustrate incorrect wiring. The current pressure of the six cell battery being greater than that of the smaller unit, current will flow from the former through the latter until the pressure of the six cells is equal to that of the four cells.

Fig. 75 shows an incorrect method of wiring in series multiple connection. If the circuit be open, the six cells, on account of having more electromotive force than the four cells, will overpower them and cause a current to flow in the direction indicated by the arrows until the pressure of the six cells has dropped to that of the four. This will use up the energy of the six cells, but will not weaken the four cell battery. This action can be corrected by placing a two-way switch in the circuit at the junction of the two negative terminals so that only one battery can be used at a time.

CHAPTER V

CONDUCTORS AND INSULATORS

Bodies differ from each other in a striking manner in the freedom with which the electric current moves upon them. If the electric current be imparted to a certain portion of the surface of glass or wax, it will be confined strictly to that portion of the surface which originally receives it, by contact with the source of electricity; but if it be in like manner imparted to a portion of the surface of a metallic body, it will instantaneously diffuse itself uniformly over the entire extent of such metallic surface, exactly as water would spread itself uniformly over a level surface on which it is poured.*

Bodies in which the electric current moves freely are called *conductors*, and those in which it does not move freely are called *insulators*. There is, however, no substance so good a conductor as to be devoid of resistance, and no substance of such high resistance as to be a *non-conductor*.

Mention should be made here of the misuse of the word non-conductor; the so called "non-conductors" are properly termed insulators.

*NOTE.—The discovery of this property of matter is due to Stephen Gray, who, in 1729, found that a cork, inserted into the end of a rubbed glass tube, and even a rod of wood stuck into the cork, possessed the power of attracting light bodies. He found, similarly, that metallic wire and pack thread conducted electricity, while silk did not.


Gray even succeeded in transmitting a charge of electricity through a hempen thread over 700 feet long, suspended on silken loops. A little later, Du Fay succeeded in sending electricity to no less a distance than 1,256 feet through a moistened thread, thus proving the conducting power of moisture. From that time the classification of bodies into conductors and insulators has been observed.

odies named in the following series possess conducting different degrees in the order in which they stand, the cient conductor being first, and the most efficient insu- ıg last in the list.

TABLE OF CONDUCTORS AND INSULATORS

conductors..... (tals and alloys)	Silver
	Copper
	Aluminum
	Zinc
	Brass (according to composition)
	Platinum
	Iron
	Nickel
	Tin
	Lead
	German silver (copper 2 parts, zinc 1, nickel 1)
	Platinoid (German silver 49 parts, tungsten 1 part)
	Antimony
	Mercury
	Bismuth.
conductors.....	Charcoal and coke
	Carbon
	Plumbago
	Acid solutions
	Sea water
	Saline solutions
	Metallic ores
	Living vegetable substances
	Moist earth.
ial conductors.....	Water
	The body
	Flame
	Linen
	Cotton
	Mahogany } Dry woods
	Pine } Dry woods
	Rosewood } Dry woods
	Lignum Vitæ } Dry woods
	Teak
	Marble.

Insulators, or so-called non-conductors.	Slate Oils Porcelain Dry leather Dry paper Wool Silk Sealing wax Sulphur Resin Gutta percha Shellac Ebonite Mica Jet Amber Paraffin wax Glass (varies with quality) *Dry* air.

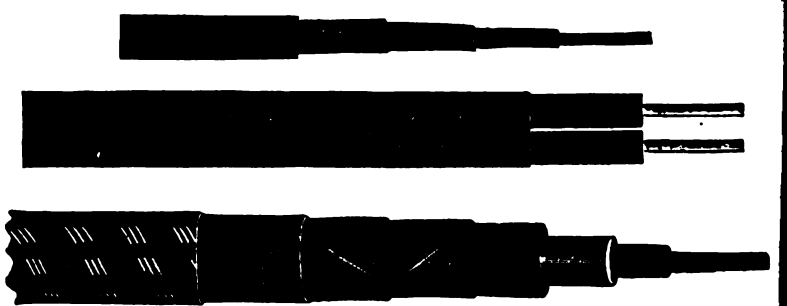


FIGS. 76 to 78.—Various covered wires. fig. 76, single; fig. 77, duplex; fig. 78, automobile high tension cable.

The earth is a good conductor; much difficulty is frequently experienced by the wires making contact with some substance that will conduct the electricity to the earth. This is called "grounding."

NOTE.—Copper is pre-eminently the metal used for electric conduction, being among the best conductors, it is excelled by one or more of the other metals, but no other approaches it in the average of all qualities.

Mode of Transmission.—The exact nature of electricity is ot known, yet the laws governing its action, under various nditions are well understood, just as the laws of gravitation re known, although the constitution of gravity cannot be lefined. Electricity, though not a substance, can be associated

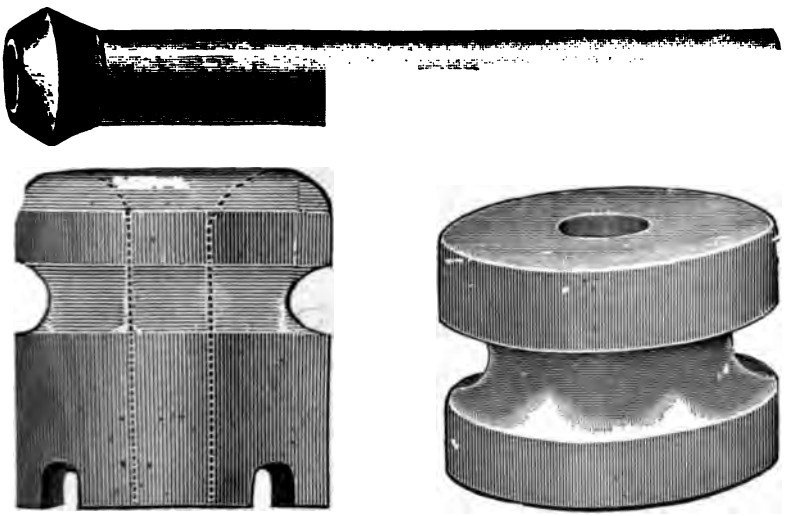

FIGS. 79 to 81.—Standard porcelain insulators. Fig. 79, tube type; figs. 80 and 81, grooved insulators.

with matter, and its transmission requires energy. While it is neither a gas nor a liquid, its behavior sometimes is similar to that of a fluid so that it is said to "flow" through a conductor. This expression of flowing does not really mean that there is an actual movement in the wire, similar to the flow of water in a pipe, but is a convenient expression for the phenomena involved.

Effect of Heat.—The conducting power of bodies is affected in different ways by *their temperature*. In the metals it is *diminished by elevation of temperature*; but in all other bodie

and especially in liquids, it is augmented. Some substances, which are insulators in the solid state, become conductors when fused.

Sir H. Davy found that glass raised to a red heat became a conductor; and that sealing wax, pitch, amber, shellac, sulphur, and wax, became conductors when liquefied by heat.

Heating Effect of the Current.—If a current of electricity pass over a conductor, no change in the heat condition of the conductor will be observed as long as its transverse section is so considerable as to leave sufficient space for the free passage of the current. But, if this thickness be diminished, or the quantity of electricity passing over it be augmented, or, in general, if the

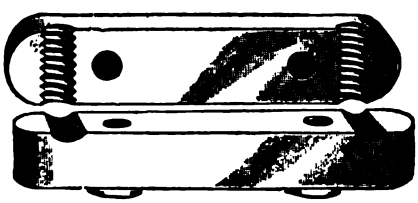


FIG. 82.—Standard two wire porcelain cleat.

ratio of the electricity to the magnitude of the space afforded to it be increased, the conductor will be found to undergo an elevation of temperature, which will be greater, the greater the quantity of the electricity and the less the space supplied for its passage.

These heat effects are manifested in different degrees in different metals, according to their varying conducting powers.

The poorest conductors, such as platinum and iron, suffer *much greater changes* of temperature by the same charge than *the best conductors*, such as gold and copper.

The charge of electricity, which only elevates the temperature of one conductor a small amount, will sometimes render another incandescent, and will vaporize a third.

Insulators.—The term insulator is used in two ways: 1, as an insulating substance or medium, and 2, as a specially formed piece of some insulating material, such as glass, porcelain, etc. No substance has the power of absolutely preventing the passage of electric currents between conductors but many have sufficient insulating power for practical purposes. The properties to be desired in a good insulating material are:

1. Permanence;
2. High power of resisting breakdown;
3. Mechanical strength;
4. Fairly high dielectric or insulation resistance;
5. Special qualities for the use to which the material is to be put.

Permanence is the most important quality, and is the one least easily attained. The power of resisting breakdown is a complex quality, for it is not solely dependent on mere puncturing pressure, but also on mechanical goodness, and to a certain extent on the insulation resistance. It cannot be easily determined by a simple laboratory test, but must be found by experience of actual service conditions.

Impregnating Compounds.—These are used for the treatment of fibrous materials. They increase the insulating properties of the fibrous *materials,* render them moisture proof and *able to withstand the effect of heat* with less rapid deterioration



When wires or cables are to be used under water, the be made impervious, and great care must be taken to p the water penetrating and thus injuring the insulation.

Water as a Conductor.—Water, whether in the liq vaporous form, is a conductor, though of an order inferior to the metals. This fact is of great importance trical phenomena. The atmosphere contains, suspende always more or less aqueous vapor, the presence of impairs its insulating property.

The best insulators become less efficient if their surf moist, the electricity passing by the conducting power moisture. This circumstance also shows why it is ne to dry previously the bodies on which it is desired to e electricity by friction.

CHAPTER VI

RESISTANCE AND CONDUCTIVITY

Resistance is that property of a substance that opposes the flow of electric current through it.

The practical electrician has to measure electrical resistance, electromotive forces, and the capacities of condensers. Each of these several quantities is measured by comparison with certained standards, the particular methods of comparison varying, however, to meet the circumstances of the case.

Ohm's law states that the strength of a current due to an electromotive force falls off in proportion as the resistance in the circuit increases. It is therefore possible to compare two resistances with one another by finding out in what proportion each will cause the current of a constant battery to fall off.

Silver is taken as the standard, with the percentage of 100, and the conductivity of all other metals is expressed in hundredths of the conductivity of silver.

NOTE.—A current of electricity always flows in a conducting circuit when its ends are kept at different potentials, in the same way that a current of water flows in a pipe when a certain pressure is supplied. The same electrical pressure does not, however, always produce a current of electricity of the same strength, nor does a certain pressure of water always produce a current of water of the same volume or quantity. In both cases the strength or volume of the currents is dependent not only upon the pressure applied, but also upon the *resistance* which the conducting *circuit* offers to the flow in the case of electricity, and on the friction *(which may be expressed as resistance)* which the pipe offers to the flow in the case of water.

Conductivity of Metals and Liquids.—The metals in general, conduct well, hence their resistance is small, but metal wires must not be too thin or too long, or they will resist too much, and permit only a feeble current to pass through them. The liquids in the battery do not conduct nearly so well as the metals, and different liquids have different resistances. Pure water will hardly conduct at all, unless the voltage be very high.

Salt and saltpetre dissolved in water are good conductors, and so are dilute acids, though strong sulphuric acid is a bad conductor. Gases are bad conductors.

Effect of Heat.—Another very important fact concerning the resistance of conductors is that the resistance in general increases with the temperature. While this fact is true regarding metals, it does not apply to non-metals. The resistance of different metals does not increase in the same proportion. Iron at 100 degrees C, has lost 39 per cent. of the conducting power it possessed at zero, while silver loses but 23 per cent.

Laws of Electrical Resistance.—Resistances in a circuit may be of two kinds:

1. Resistance of the conductors;
2. Resistance due to imperfect contact.

The latter kind of resistance is affected by pressure, for when the surfaces of two conductors are brought into more intimate contact the current passes more freely from one conductor to the other.

The following are the laws of the resistance of conductors:

1. *The resistance of a conducting wire is proportional to its length.*

If the resistance of a mile of telegraph wire be 13 ohms, that of fifty *miles will be* $50 \times 13 = 650$ ohms.

2. *The resistance of a conducting wire is inversely proportional to the area of its cross section,* and therefore in the usual round wires *is inversely proportional to the square of its diameter.*

Ordinary telegraph wire is about 1/6th of an inch thick; a wire twice as thick would conduct four times as well, having four times the area of cross section; hence an equal length of it would have only 1/4th the resistance.

3. *The resistance of a conducting wire of given length and thickness depends upon* the material of which it is made—that is, upon the specific resistance *of the material.*

Conductivity.—This is *the inverse of resistance.* The term expresses the capability of a substance to conduct the electric current.

If the symbol Y represent the conductivity of a substance, and I the current then:

$$\frac{I}{Y} = \text{its resistance;}$$

and if R represent the resistance of a substance, then

$$\frac{I}{R} = \text{its conductivity.}$$

Good conductors of heat are also good conductors of electricity.

Specific Conductivity.—The figure which indicates the relation between one substance and another as to their capacity to conduct electricity *is called specific* or *relative* conductivity.

Taking the specific conductivity of silver as 100, that of pure copper is 96.

The specific resistance of a substance is the reverse of its relative conductivity. The specific resistance of a metal is generally expressed in millionths of an ohm as the resistance of a centimeter cube of that metal between opposite sides.

The following table gives the data for a few metals:

Substance.	Specific Resistance in Microhms.	Specific Conductivity.
Silver	1.609	100.
Copper	1.642	96.
Gold	2.154	74.
Iron (soft)	9.827	16.
Lead	19.847	8.
German Silver	21.470	7.5
Mercury (liquid)	96.146	1.6

The specific resistance of copper is therefore:

$$\frac{1.642}{1{,}000{,}000} \text{ ohms, or } 1.642 \text{ microhms.}^*$$

Divided Circuits.—If a circuit be divided, as in fig. 83, into two branches at A, uniting again at B, the current will also be divided, part flowing through one branch and part through the other.

The relative strength of current in the two branches will be proportional to their conductivities.

This law will hold good for any number of branch resistances connected between A and B. Conductivity is, as shown before, the reciprocal of resistance.

*NOTE.—The prefixes "meg" and "micro" denote million and millionth. For example, a megohm equals 1,000,000 ohms, a microhm equals $\frac{1}{1{,}000{,}000}$ of an ohm.

EXAMPLE.—If, in fig 83, the resistance of R = 10 ohms, and R′ = 20 ohms, the current through R will be to the current through R′ as $\frac{1}{10}$ to $\frac{1}{20}$: or, as 2:1, or, in other words, ⅔ of the total current will pass through R and ⅓ through R′. The joint resistance of the two branches between A and B will be less than the resistance of either branch singly, because the current has increased facilities for travel. In fact, the joint conductivity will be the sum of the two separate conductivities.

Taking again the resistance of R = 10 ohms and R′ = 20 ohms, the joint conductivity is

$$\frac{1}{10}+\frac{1}{20}=\frac{3}{20}$$

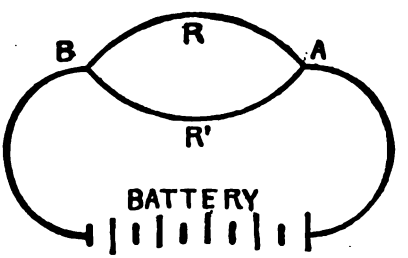


FIG. 83.—Divided circuit with two conductors *in parallel*.

nd the joint resistance is equal to the reciprocal* of $\frac{3}{20}$

or 6⅔

In most cases the resistance of the different branches will be like. This simplifies the calculations considerably. Take, for nstance, two branches of 100 ohms resistance each and find the oint resistance.

*NOTE.—*The reciprocal of a number is* equal to 1 + the number; for instance, the recip-*al of* $\frac{3}{20} = 1 + \frac{3}{20} = \frac{20}{3} = 6\frac{2}{3}$

SOLUTION: $\frac{1}{100}+\frac{1}{100}=\frac{2}{100}$; the reciprocal is $\frac{100}{2}=50$ ohms other words, the joint resistance is one-half of the resistance of a branch, and each branch, of course, will carry one-half of the tot rent in amperes.

With three branches of equal resistance, the joint resistance ⅓; with four branches ¼; with 100 branches $\frac{1}{100}$ of the resista a single branch.

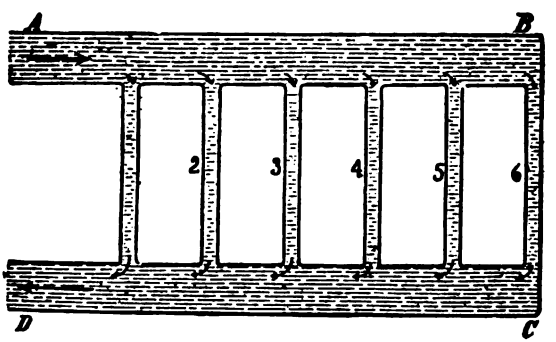


FIG. 84.—Hydraulic analogy for divided circuits. In the system of pipes shown, wat from A B to C D through the six vertical pipes 1 to 6, the greatest amount going the one which offers the least resistance. If pipes 1 to 6 all have the same dim equal quantities of water will flow through them. It follows that the resistanc the water encounters diminishes with the increase in the number of pipes betw and C D. The electrical circuit presents the same conditions: the greater the of parallel connections (corresponding to the pipes 1 to 6) the less is the resista countered by the current.

If, for instance, the resistance of an incandescent lamp h 180 ohms, the joint resistance of 100 such lamps connect multiple is

$$\frac{180}{100}=1.8 \text{ ohms.}$$

If the electromotive force of the system is to be, say 110 *then, according to* Ohm's law, the current for 100 lamps is

$$\frac{110}{1.8}=61.11 \text{ amperes.}$$

iving for each lamp a current of

$$\frac{110}{180}=.61 \text{ ampere.}$$

In the case of two branches only, the following rule may be pplied also:

Multiply the two resistances and divide the product by their sum.

Written as a formula:

$$\text{Joint resistance}=\frac{R\times R'}{R+R'}$$

Again, assuming that R = 10 ohms and R′ = 20 ohms:

$$\text{Joint resistance } \frac{10\times 20}{10+20}=\frac{200}{30}=6\tfrac{2}{3} \text{ ohms.}$$

This rule *cannot* be employed for more than two branches at time.

EXAMPLE—A current of 42 amperes flows through three conductors in *parallel* of 5, 10 and 20 ohms resistance respectively. Find the current in each conductor.

SOLUTION: Joint Conductance $=\frac{1}{5}+\frac{1}{10}+\frac{1}{20}=\frac{7}{20}$.

Supposing *the current to be divided* into 7 parts, 4 of these parts would *flow in the first conductor 2 in the* second and 1 in the third.



The whole current is 42 amperes.

$\frac{4}{7}$ of 42 = 24.
$\frac{2}{7}$ of 42 = 12.
$\frac{1}{7}$ of 42 = 6.

Current in first conductor = 24 amperes.
" " second " = 12 "
" " third " = 6 "

} Ans.

CHAPTER VII

ELECTRICAL AND MECHANICAL ENERGY

The production of electricity is simply a transformation of energy from one form into another, usually mechanical energy is changed into electrical energy and a dynamo is simply a device for effecting the transformation.

Prof. Fessenden truly remarks there are two independent properties of matter—gravity and inertia—and these give two ways of defining force and energy.

It should always be remembered that electricity is something real, although not easily defined. And then, too, while it is not matter and not energy, yet under proper conditions (it having the power of doing work) it is convenient to speak of its performances as electric energy. The following questions and answers, although few in number, may present the subject with clearness.

Ques. What is energy?

Ans. Energy is the capacity for doing work.

Steam under pressure is an example, a spring bent ready to be released is another form, again, water stored in an elevated tank has capacity for doing *work. These examples* illustrate *potential* energy, as *distinguished from kinetic energy.* Potential energy may be defined as *energy due to position,* and kinetic energy, as *energy due to momentum.*

Ques. What is matter?

Ans. Matter is anything occupying space, and which prevents other matter occupying the same space at the same time.

Ques. What name is given the smallest quantity of matter which can exist?

Ans. The atom.

An atom means that which cannot be cut, scratched, or changed in form and that cannot be affected by heat or cold or any known force; although inconceivably small, atoms possess a definite size and mass.

Ques. What is a molecule?

Ans. A molecule is composed of two or more atoms.

Ques. What is the behaviour of these minute bodies?

Ans. They are perpetually in motion, vibrating with incredible velocities.

Ques. Why at this point are definitions of energy and of matter most useful?

Ans. Because, as stated, all electric action is an exhibition of energy, and energy must act through matter as its medium.

NOTE.—A writer in the *New Science Review* undertakes to answer the question: "What is electricity?" In order to lead the reader up to the main question, he first considers the natural forces, gravitation and heat. Examples are given of how these forces are manifested and how energy is changed from one form to another. Every form of force, the author says, should be regarded as a different method in which energy makes itself known to the senses. He calls particular attention to the important fact that the "resistance of one kind or another is always the agent that acts to alter energy from one form to another," and suggests that electricity is simply a form or manifestation that energy may assume under given conditions, and generally is a mere transitory stage between the mechanical form and the heat form. "In most operations," he continues, "mechanical force passes to the heat form without passing through the electric form; but whenever magnetism is brought into play as a resistance that must be *overcome, then mechanical* power applied to overcome this resistance always becomes elec*tricity, if only momentarily* in its passage from the mechanical to the heat form." In con*clusion, he asks if the question*: "What is electricity?" cannot be answered in a fairly satis*factory way by saying* that it is simply a form that energy may assume while undergoing *transformation* from the mechanical or the chemical form to the heat form or the reverse.

Ques. **What is the difference between electricity and magnetism?**

Ans. The ultimate nature of neither is known. There are, however, some differences. To sustain a current of electricity requires energy. To sustain magnetism requires no energy. A current of electricity is always accompanied by a magnetic field of peculiar form. Magnetism alone cannot produce electricity. Electricity can do work; but magnetism cannot in the same sense—and alike with electricity, neither can it exist without contact with matter.

Ques. How is energy transmitted from one part of a material substance to another?

Ans. Gradually and successively. It requires a medium and also time.

Ques. What is the principal use or function in mechanics of electricity?

Ans. It is purely that of transmission. It corresponds to ropes, shafts and fluids as a medium of conveying and transmitting power or work.

Ques. What is work?

Ans. Work is the overcoming of resistance through a certain distance.

As a quantity of water moving from a higher to a lower level will do work, so also will a quantity of electricity falling through a difference of potential.

Ques. How is work measured?

Ans. *In foot pounds.*

Ques. What is a foot pound?

Ans. The amount of work done in raising a weight of one pound one foot or the equivalent, overcoming a pressure of one pound through a distance of one foot.

Ques. What is the electrical unit of work?

Ans. The *volt-coulomb.*

A volt-coulomb of work is performed when one ampere of current flows for one second in a circuit whose resistance is one ohm, when the pressure is one volt.

The Ampere-Hour.—A gallon of water may be drawn from a hydrant in a minute, or in an hour; it is still one gallon. So in electricity, a given amount of the current, say one *coulomb*, may be obtained in a second or in an hour.

The ampere is the unit rate of flow.

What is called the electric current is si ıply the relation of any quantity of electricity passed to the time it is passing; that is

quantity in coulombs = current in amperes × time in seconds,
or simply

coulomb = ampere × second.

Again:

10 coulombs = 2 amperes × 5 seconds
= 10 amperes × 1 second
= 1 ampere × 10 seconds, etc.

One *ampere hour* is simply another way of saying 3,600 coulombs. Of course 3,600 coulombs of electricity may be obtained in any desired time. It all depends on the rate of flow or the *current* strength in amperes.

For instance, 2 amperes in ½ hour, or 4 amperes in ¼ hour will also *give one* ampere-hour of 3,600 coulombs.

It is well to keep the distinction between coulombs and amperes n mind, as even in text books very lately published these units ire confounded. To illustrate further the difference between coulombs and amperes, the following example is given.

It is sometimes estimated that the quantity of electricity in a flash of lightning is $\frac{1}{10}$ coulomb, and the duration of the discharge $\frac{1}{10000}$ part of a second. What is the current in amperes?

Now since

$$\text{coulombs} = \text{amperes} \times \text{seconds} \tag{1}$$

solving (1) for the current,

$$\text{amperes} = \frac{\text{coulombs}}{\text{seconds}} \tag{2}$$

substituting the given values in (2),

$$\text{amperes} = \frac{\frac{1}{10}}{\frac{1}{10000}} = 2000$$

Power.—The term power means *the rate at which work is done;* it is usually expressed as *the number of foot pounds done in one minute*, that is

$$\text{power} = \frac{\text{foot pounds}}{\text{minutes}}$$

Power exerted for a certain time produces work.

Ques. What is the mechanical unit of power?

Ans. The horse power.

Ques. What is one horse power?

Ans. 33,000 *foot pounds* per minute.

The unit is due to James Watt as being the power of a strong London draught horse to do work during a short interval and used by him to measure the power of his steam engines. One horse power = 33,000 ft. lbs. per minute = 550 ft. lbs. per sec. = 1,980,000 ft. lbs. per hour.

Ques. What is one horse power hour?

Ans. Work done at the rate of one horse power for one hour.

Ques. What is the electrical unit of power?

Ans. The watt.

Ques. What is a watt?

Ans. It is the power due to a current of one ampere flowing at a pressure of one volt. One watt = one ampere × one volt. It is equal to one joule per second.

Ques. What is a kilowatt?

Ans. 1,000 watts.

The Watt Hour.—The elements which may be measured are, however, not only the volume of current, the unit of which is the ampere, and time, the unit of which is the hour, but also the *pressure*, the unit of which is the volt.

It is evident that a perfect system of electrical measurement should take account of the total amount of energy consumed, and should depend not only upon the volume of current, but *also upon the pressure* at which the current is applied.

The basis of such a system if provided in a unit which is the product of the two units of current and pressure, and which is termed a *volt-ampere* or *watt*.

The watt hour represents the amount of work done by an electric current of one ampere strength flowing for one hour under a *pressure of one volt.*

EXAMPLE.—An incandescent lamp taking one-half an ampere of current on a circuit having a pressure of 100 volts, or a lamp taking one ampere on a circuit having a pressure of 50 volts, would each be consuming 50 watts of energy, and this multiplied by the number of hours would give the total number of watt-hours for any definite time.

The watt, then, is an accurate and complete unit of measurement and is generally applicable to all forms of electrical consumption.

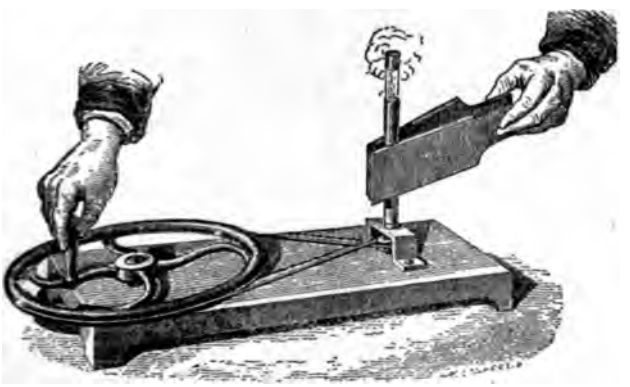


FIG. 85. — Tyndall's experiment illustrating the production of heat by friction. A brass tube about 7 inches in length and ¾ of an inch in diameter, is fixed on a small wheel. By means of a cord passing round a much larger wheel, this tube can be rotated with any desired velocity. The tube is three parts full of water, and is closed by a cork. In making the experiment, the tube is pressed between a wooden clamp, while the wheel is rotated with some rapidity. The water rapidly becomes heated by the friction, and its temperature soon exceeds the boiling point. The pressure caused by the formation of steam forces out the cork and projects it to a height of several yards.

A watt of electrical energy corresponds to $\frac{1}{746}$ of a horse power of mechanical energy; hence, if a lamp or motor require energy equivalent to $\frac{1}{746}$ of a horse power for one hour, it might be said to take one watt-hour.

Mechanical Equivalent of Heat.—The eminent English physicist, James Prescott Joule, worked for more than forty years in establishing the relation between *heat* and *mechanical work; he stated the doctrine of* the conservation of energy as

discovered the law, known as Joule's law, for determining the relation between the heat, current pressure, and time in an electric circuit.

Ques. What is heat?

Ans. A form of energy.

Heat is produced in the agitation of the molecules of matter—the energy expended in agitating these molecules is transformed into heat.

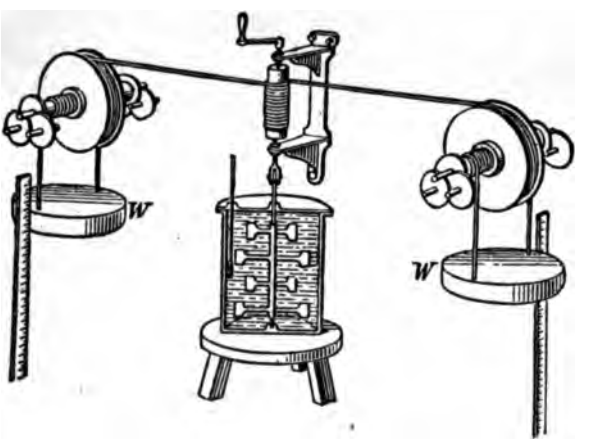


FIG. 86. — Joules' experiment on the mechanical equivalent of heat, in which he caused paddle-wheels to rotate in a vessel of water by means of falling weights *W*. The amount of work done by gravity upon the weights in causing them to descend through any distance *d* was equal to their weight *W* times the distance. If the weights descended slowly and uniformly, this work was all expended in overcoming the resistance of the water to the motion of the paddle wheels through it; that is, it was wasted in eddy currents in the water. Joule measured the rise in the temperature of the water and found that the mean of his three best trials gave 427 gram meters as the amount of work required to develop enough heat to raise a gram of water one degree. He then repeated the experiment, substituting mercury for water, and obtained 425 gram meters as the work necessary to produce a calorie of heat. The difference between these numbers is less than was to have been expected from the unavoidable errors in the observations. He then devised an arrangement in which the heat was developed by the friction of iron on iron, and again obtained 425. This corresponds to 772 foot pounds, but later experiments show that the correct value is 778 foot pounds.

***Ques. How is* heat measured?**

Ans. In British thermal units (B.t.u.).

Ques. What is the British thermal unit?

Ans. The quantity of heat required to raise the temperature of 1 lb. of pure water 1° Fahr., at or near 39.1° F., the temperature of maximum density.

Ques. What is the mechanical equivalent of heat?

Ans. The number of foot pounds of mechanical energy equivalent to one British thermal unit.

Joule's experiments 1843–50 gave the figure 772 ft. lbs. which is known as Joule's equivalent. Later experiments gave higher figures, and *the present accepted value is 778 ft. lbs.*, that is: 1 B. t. u. = 778 ft. lbs.

Electrical Horse Power.—It is desirable to establish the relation between *watts* and *foot pounds* in order to determine the *capacity* of an electric generator or motor in terms of *horse power*.

One watt is equivalent to one joule per second or 60 joules per minute. One joule in turn, is equivalent to .7374 ft. lbs., hence 60 joules equal:

$$60 \times .7374 = 44.244 \text{ ft. lbs.}$$

Since one horse power = 33000 ft. lbs. per minute, the electrical equivalent of one horse power is

$$33000 \div 44.244 = 746 \text{ watts.}$$

or,

$$\frac{746}{1000} = .746 \text{ kilowatts (K.W.)}$$

Again, one kilowatt or 1000 watts is equivalent to

$$1000 \div 746 = 1.34 \text{ horse power.}$$

The Farad.—The measure constructed to hold a gallon of water may be called the gallon measure. The capacity of a condenser which would contain a charge of one coulomb under one volt pressure is the *farad*. It may seem strange that there is a unit of quantity and another of capacity to hold that quantity, when in the case of water the term "gallon" may suffice for the measure and the liquid it can hold. Electricity in this respect, however, corresponds to a *compressible fluid* or a *gas*.

A gallon measure may hold a gallon of gas or ten; it depends entirely upon the pressure. So a condenser of a certain size may hold any number of coulombs, according to the electrical pressure.

The farad being inconveniently large for practical use, one-millionth of a farad, called a *microfarad*, is generally adopted.

CHAPTER VIII

EFFECTS OF THE CURRENT

The term "electric current," in the present state of our knowledge, should be regarded as denoting the existence of a state of things in which certain definite experimental effects are produced, for some of which there certainly is no analogy exhibited in ordinary hydraulic currents. The following are the most important of these effects:

1. Thermal effect;
2. Magnetic effect;
3. Chemical effect.

It is rather to these effects than to any imaginary current flow in the conductor that the mind of the reader should be directed.

With this prelimary caution, which should never be lost sight of, the use of familiar words and expressions connected with the flow of water in pipes is justified in order to avoid roundabout and cumbrous phrases which, though perhaps more nearly in accord with present knowledge of the facts, would not tend to clearness or conciseness.

The three most important effects of the current just mentioned, may be presented in more detail as follows:

1. The *Thermal effect*:—

The conductor along which the current flows becomes rise of temperature may be small or great according to c but some heat is always produced.

2. The *Magnetic effect;*

The space both outside and inside the substance of th but more especially the former, becomes a "magnetic fie delicately pivoted or suspended magnetic needles will tak positions and magnetic materials will become magnetized.

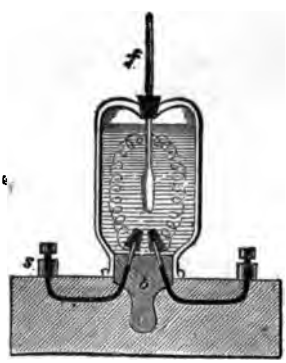



FIG. 87.—Lenz's apparatus for measuring the heat given off by an electric curre of a wide mouthed stoppered bottle fixed upside down, with its stopper box; the stopper was perforated so as to give passage to two thick platinum at one end with binding screws, *s*, while their free ends were provided with by which the wires under investigation could be readily affixed; the alcohol, the temperature of which was indicated by a thermometer fitted in in a hole made in the bottom of the vessel. The current is passed throu wires, and its strength measured by means of a galvanometer interpose By observing the increase of temperature in the thermometer in a given ti the weight of the alcohol, the mass of the wire, the specific heat, and values of the vessel, and of the thermometer, compared with alcohol, th which is produced by the current in a given time can be calculated.

3. The *Chemical effect;*—

If the conductor be a liquid which is a chemical compoun class called *electrolytes*, the liquid will be decomposed at the *the current* enters and leaves it.

rmal Effect.—If a quantity of electricity were set flowing osed circuit and the latter offered no *resistance*, it would rever, just as a wagon set rolling along a circular railway never stop if there were no *friction*.

n matter in motion is stopped by friction, the energy of tion is converted into heat by the friction thus causing

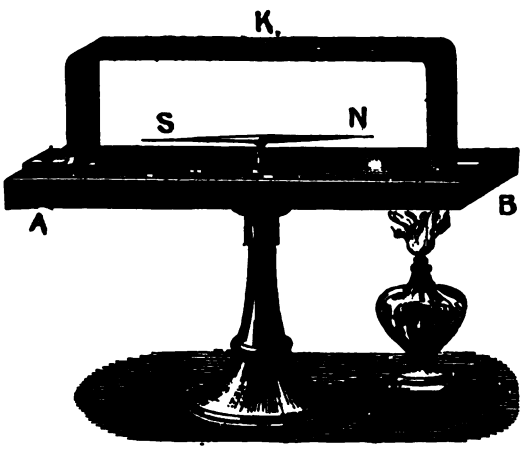

.—The Seebeck effect: If in a complete metallic circuit having junctions of dis-ilar metals, the junctions are at different temperatures, then generally a steady rent will flow in the circuit as long as the differences of the temperatures of the ction is maintained. To demonstrate this, a piece of copper K bent in the shape a in the figure, was placed on a block of bismuth A B, carrying a pivoted magnetic dle N S; as soon as the equality of temperatures was altered by either heating or ling one of the junctions of the two metals, the needle indicated a current which tinued to flow as long as the difference of temperature was maintained at the junctions. e movement of the needle indicated the direction in which the current flowed. If, for ance, the north junction B were heated, the N pole moved eastwards, showing that at heated junction the current flows from the bismuth to the copper, at the cold junction n the copper to the bismuth.

natter to come to rest. Similarly, when electricity in n, that is, an electric current is stopped by resistance, the y of its flow is transformed into heat by the resistance of rcuit.

If the terminals of a battery be joined by a short thick wire of low resistance, most of the heat will be developed in the battery, whereas, if a thin wire of high resistance be used it will become hot, while the battery itself will remain comparatively cool.

To investigate the development of heat by a current, Joule and Lenz used instruments on the principle of fig. 87, in which a thin wire joined to two stout conductors is enclosed within a glass vessel containing alcohol, into which is placed a thermometer. The resistance of the wire being known, its relation to the other resistances can be calculated. Joule found that the number of heat units developed in a conductor is proportional to:

1. The resistance;
2. The square of the current strength;
3. The time that the current lasts.

Joules' law may be stated as follows:

The heat generated in a conductor by an electric current is proportional to the resistance of the conductor, the time during which the current flows, and the square of the strength of the current.

The quantity of heat in calories may be calculated by use of the equation,

$$\text{calories per second} = \text{volts} \times \text{amperes} \times .24. \quad (1)$$

The total number of calories H developed in t seconds will be given by

$$H = \text{P. D.} \times C \times t \times .24. \quad (2)$$

EXAMPLE:—If a current of 10 amperes flow in a wire whose terminals are at a potential difference of 12 volts, how much heat will be developed in 5 minutes?

Substituting in equation (2):

$$10 \times 12 \times (60 \times 5) \times .24 = 8640 \text{ calories.}$$

Since by Ohm's Law potential difference $= I \times R$
substituting $I\,R$ *for* P. D. in (2)

$$H = I^2 R \times t \times .24$$

Use of Heat from Electric Current.—In the transmission of electricity from place to place, it is very desirable that none of the energy be expended in heating the conductor. Hence copper wires of the proper size must be used.

In wiring a building for electric lights, the insurance rules require that the wires be of a certain size and that they be put up in a certain manner. Otherwise they will not insure a building against fire.

It is often desirable, however, to use the electric current for the purpose of producing heat. The carbons of the arc and incandescent lamps are intensely heated that they may produce light. Coils of German silver wire or other high resistance wire are heated by the passage of a current through them. In this manner the electric stove is made.

Soldering coppers, smoothing irons, and baking ovens are heated in a similar manner.

Magnetic Effect.—An electric current flowing in a wire causes it to be surrounded by a *magnetic field*, which consists of *lines of force* encircling the wire. The field is strongest near the wire and diminishes gradually in strength at increasing distances therefrom. The presence of this magnetic field is shown by various experiments and the subject is fully explained in chapter IX on *Magnetism*.

Chemical Effect.—Pats van Trostwyk (1789) pointed out that an electric discharge was capable of decomposing water; to show this he used gold wires, which he allowed to dip in water, connecting one of them with the inner, and another with the outer coating of a Leyden jar, and passing the discharge through the water. The gas bubbles collected proved to consist of oxygen and hydrogen gas.

Nicholson and Carlisle (1800) dipped a copper wire which was connected with one of the poles of a voltaic pile into a drop of water, which happened to be on the plate connected with the other pole; gas bubbles appeared, and the drop of water became smaller and smaller.

This experiment was repeated in a somewhat different manner, the brass wires from a pile being brought under a tube filled with water and closed at the top. Gas bubbles were produced by the wire in connection with the negative pole of the pile, and the water was observed to diminish gradually. At the positive wire, on the contrary, no gas came off, but the

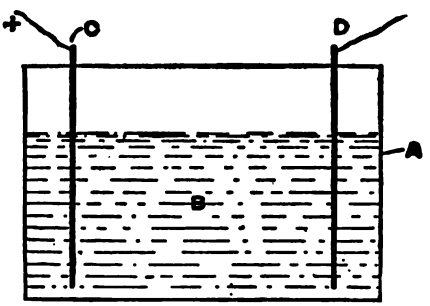


FIG. 89. — An electrolytic cell. The parts are: A, cell; B, electrolyte; C, positive electrode or cathode; D, negative electrode or cathode.*


metal lost its metallic lustre, became dark, and finally crumbled away. The gas which had collected in the tube proved to be hydrogen; while on examining the black mass it was found that the constituents of brass, viz., copper and zinc, had become oxidized.

Electrolysis.—*Electric analysis* or more briefly *electrolysis* was the term applied by Faraday to the process of decomposing a liquid by the passage of a current of electricity through it.

The vessel containing the liquid is known as an *electrolytic cell.* In fig. 89, A is the cell, which may be of glass or of any other

*NOTE.—*The cathode is the conductor by which current flows away as distinguished from the anode or conductor through which the current enters. The terms usually apply to conductors leading the current through a liquid or gas, as an electrotylic cell, or vacuum tube

aterial, and B is the liquid which is to be electrolyzed. nters by the *positive electrode* C, also known as the verses the liquid, and leaves by the *negative electrode*, D.

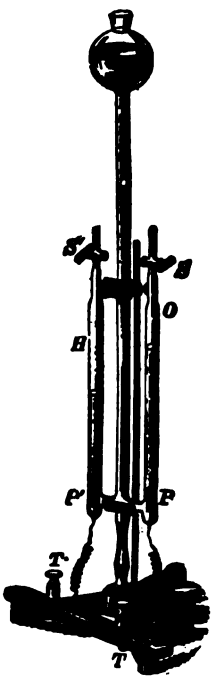

dern apparatus for decomposing water by electrolysis. Platinum electrodes P placed at the bottom of two upright tubes O and H, and are connected to the T and T' by platinum wires, which are fused through the glass of the tubes. es have glass stop cocks S and S' at their upper ends, and at their lower ends cted by a short glass tube, from the center of which rises the large central tube ands with a bulb at its upper end, which is open at the top. The three tubes ed with acidulated water from the central tube, the previously contained air wed to escape through the stop cocks, which are afterwards closed. If it be so the terminal T be attached to the positive and T' to the negative pole of a attery, bubbles of gas will be observed to rise from the plates P and P', and eir way to the top of the respective tubes, will displace the liquid, which will into the open central tube. The gas rising from the anode P is oxygen (O), rising from the kathode P' is hydrogen (H). If the tubes are graduated, the l be found to occupy about *twice* the volume of the former. The proportion ically 2 *to 1; however, on account* of the different solubilities of the two gases *oxygen being the more soluble of the two,* is deficient in quantity.

C77767 A

The passage of current through the water splits up its molecules into their constituent atoms of oxygen and hydrogen, the former being given off in bubbles at the anode, and the latter at the cathode.

When current is passed through a solution of copper sulphate between platinum electrodes, the liquid is decomposed, atoms

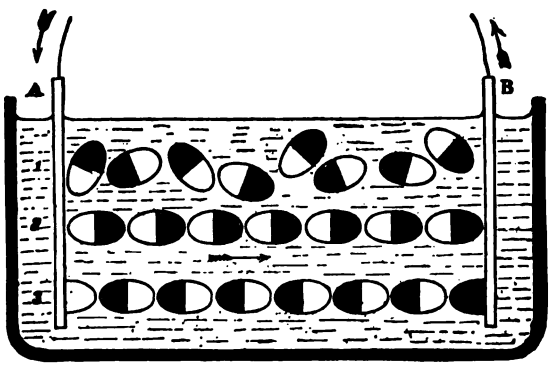


FIG. 91.— Grotthuss' theory of electrolysis. Grotthuss in (1806), announced his theory that the molecules in an electrolyte have their individual electro-positive and electro-negative atoms charged positively and negatively respectively. In an ordinary liquid, for instance in water, the molecules are arranged indifferently, like row 1, with their positive and negative ends pointing in all directions. When the charged plates A and B connected to the + and − poles of a battery are inserted in the water, the molecules under the action of the laws of electrostatic action turn as shown in row 2, so that all the hydrogen or shaded ends (+) are turned towards the (−) plate B and all the oxygen or unshaded ends (−) towards the (+) plate A. All along the row the electrical forces are supposed to tear the molecules asunder, depositing H on B and O on A. The atoms in the middle of the liquid, however, recombine, for the hydrogen atoms in their journey towards b meet the oxygen atoms travelling in the opposite direction, and we get the state of affairs represented in row 3. The next step is to rotate once more the atoms into the positions shown in row 2, and so on. In this way the theory accounts for the products only appearing at the electrodues and not in the body of the liquid.

of copper being deposited at the cathode, bubbles of oxyger *being given off at* the anode, and sulphuric acid being formed in *the liquid, which latter* becomes more and more acid as the copper *is withdrawn.*

If, however, the anode be of copper instead of platinum, no sulphuric acid will be formed, neither will oxygen be given off at the anode. As copper is deposited at the cathode, an equal quantity will be dissolved at the anode, so that the original constitution of the liquid is maintained.

The atoms separated from each other by the electric current were called *ions* by Faraday; those going to the anode being *anions*, and those going to the cathode being *kathions*.

Anions are generally regarded as *electro-negative*, because they move as if attracted to the positive electrode, while kathions are regarded as *electro-positive*.

In order to explain the transfer of electricity and the transfer of matter through the electrolyte, Grotthuss put forward the hypothesis that when two metal plates at different potentials are placed in a cell, the effect produced in the liquid is that the molecules of the liquid arrange themselves in innumerable chains, as shown in fig. 91, in which every molecule has its atoms pointing in a certain direction, the electro-positive atom being attracted towards the cathode and the electro-negative towards the anode. An interchange then takes place all along the line, the free atoms appearing at the electrodes, and every atom discharging a minute charge of electricity upon the electrode at which it is liberated.

Electro-chemical Series.—This is an arrangement of the metals in a series in such a manner that the most electro-positive is at one end and the most electro-negative at the other.

The order of the metals varies with the electrolyte in which the metals are tested.

The following table shows such series for the most common *metals, in three different solutions*:

Sulphuric acid.	*Hydrochloric acid.*	*Caustic potash.*
Zinc	Zinc	Zinc
Cadmium	Cadmium	Tin
Tin	Tin	Cadmium
Lead	Lead	Antimony
Iron	Iron	Lead
Nickel	Copper	Bismuth
Bismuth	Bismuth	Iron
Antimony	Nickel	Copper
Copper	Silver	Nickel
Silver	Antimony	Silver
Gold		
Platinum		

Faraday stated several laws of electrolysis, as follows:

1. *The quantity of an ion liberated in a given time is proportional to the quantity of electricity that has passed through the voltameter* in that time.*

2. *The quantity of an ion liberated in a voltameter is proportional to the electro-chemical equivalent of the ion.*

3. *The quantity of an ion liberated is equal to the electro-chemical equivalent of the ion multiplied by the total quantity of electricity that has passed.*

Electric Osmose.—Porret observed that if a strong current be led into certain liquids as if to electrolyze them, a porous partition being placed between the electrodes, the current mechanically carries part of the liquid through the porous diaphragm, so that the liquid is forced to a higher level on one side than on the other. This phenomenon is known as *electric osmose.*

Electric Distillation.—Closely connected with the preceding phenomenon is that of the *electric distillation of liquids.* It was noticed by Beccaria that *an electrified liquid evaporates more rapidly than one not electrified.*

*NOTE.—The name *voltameter* was given by Faraday to an electrolytic cell employed as a means of measuring an electric current by the amount of chemical decomposition the current effects in passing through the cell.

Gernez has recently shown that in a bent closed tube, containing two portions of liquid, one of which is made highly + and the other highly −, the liquid passes over from + to −. This apparent distillation is not due to difference of temperature, nor does it depend on the extent of surface exposed, but is effected by a slow creeping of the liquid along the interior surface of the glass tubes. Bad conductors, such as turpentine, do not thus pass over.

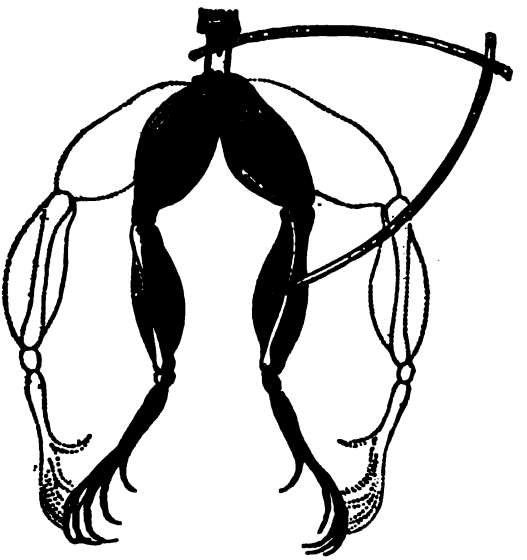


FIG. 92.—Effect of the electric current on a frog's legs; discovered in 1678 by Galvani.

Muscular Contractions.—It was discovered in 1678 that when a portion of muscle of a frog's leg, hanging by a thread of nerve bound with a silver wire, was held over a copper support so that both nerve and wire touched the copper, the muscle immediately contracted.

More than a century later Galvani's attention was drawn to the subject by his observation of spasmodic contractions in the legs of freshly killed *frogs under the influence* of the "return shock" experienced *every time a neighboring electric* machine was discharged.

The limbs of the frog, prepared as directed by Galvani, are shown in fig. 92. After the animal has been killed the hind limbs are detached and skinned; the crural nerves and their attachments to the lumbar vertebrae remaining. For some hours after death the limbs retain their contractile power. The frog's limbs thus prepared form an excessively delicate galvanoscope.

Electroplating.—This is the process of depositing a layer or coating of a rarer metal upon the surface of a baser, or of a metal upon any conducting surface, by electrolysis.

The electric current used may be obtained from a battery or other source. The battery has its positive plate connected to a rod extending across a trough or tank containing the plating bath.

Suspended from the rod are anodes of gold, silver, or copper or whatever metal from which a deposit is desired. The other plates of the battery or the negative elements, are connected with another rod across the trough, to which are suspended the articles to be plated.

Electrotyping.—This is the process by which, type, wood cuts, etc., are reproduced in copper by the process of electroplating. A mould is first made of the set type in wax; this mould is next coated with black lead to give it a metallic surface, as the wax is an insulator; the mould is then subjected to the process of electro deposition, resulting in the formation of a film of copper on the prepared surface.

The copper shell is removed from the mould by applying hot water; the shell is then backed up with electrotype metal to render it strong enough for use.

Almost all the illustrations in this book, for example, are *printed from electrotype* copies, and not from the original wood *blocks, which would not* wear so well.

CHAPTER IX

MAGNETISM

Magnetism.—The ancients applied the word "magnet," *magnes lapes*, to certain hard black stones which possess the property of attracting small pieces of iron, and as discovered later, to have the still more remarkable property of pointing



Fig. 92.—Simple compass. It consists of a magnetic needle resting on a steel pivot, protected by a brass case covered with glass, and a graduated circle marked with the letters N, E, S, W, to indicate the cardinal points; *a b* is a lever which arrests the needle by pushing it against the glass when the button *d* is pressed.

north and south when hung up by a string. At this time the magnet received the name of *lodestone* or "leading stone." It is commonly, though incorrectly, spelled loadstone.

Ques. Describe two kinds of magnetism.

Ans. Magnets have two opposite kinds of magnetism or magnetic poles, which attract or repel each other in much the same *way as would two opposite* kinds of electrification.


Ques. What is the nature of each kind of magnetism?


Ans. One has a tendency to move toward the north and the other toward the south.





FIGS. 94 to 96.—Simple *bar magnet* and *horse shoe magnet* with *keeper*. These are known as *permanent magnets* in distinction from *electro-magnets*. The horse shoe magnet will attract more than the bar magnet because both poles act together. A piece of soft iron, or keeper is placed across the ends of a horse shoe magnet to assist in preventing the loss of magnetism.

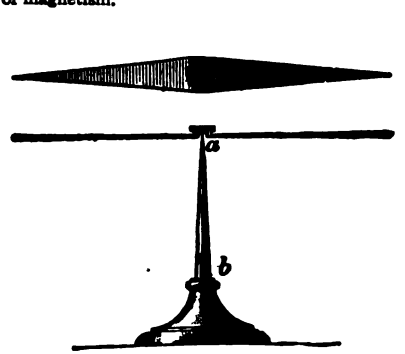

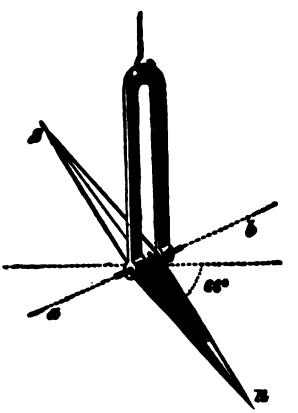

FIGS. 97 and 98.—Horizontal magnetic needle, and magnetic "dip" needle. A magnetic needle consists of a small bar magnet, supported upon a pivot or suspended so that it is free to turn in a horizontal or vertical plane. The form of magnetic needle illustrated in fig. 97 is arranged to show the magnetic meridian; the needle moves upon a perpendicular axis or pivot *ab*. In fig. 98, the needle *sn* turns upon a horizontal axis *ab*. This needle indicates the dip or inclination, that is, the angle which it makes with the horizontal *plane, due to the fact* that in most places the lines of force are not horizontal. In the *northern hemisphere the N* pole of the needle is depressed, in the southern hemisphere *the S pole is similarly affected.* When used, the dip needle must be set so that the plane in *which the needle swings* contains the magnetic meridian, as indicated by the horizontal *needle.*

Ques. Where is the magnetism the strongest?

Ans. In two regions called the *poles.*

Ques. Describe the distribution of magnetism in a long shaped magnet.

Ans. The strongest magnetism resides in the ends, while all around the magnet half way between the poles there is no attraction at all.

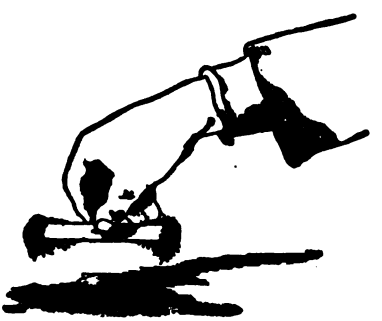


FIG. 99. — Magnetic poles. If a bar magnet be plunged into iron filings and then lifted, as illustrated in the figure, a mass of filings will cling to the ends of the magnet but not to the middle. The ends are called the *poles* of the magnet.

Ques. How are the poles designated?

Ans. They are called the *north pole* and the *south pole.*

Ques. What is the distinguishing feature of each?

Ans. The north pole points approximately to the earth's geographical north, while the south pole of a magnet points approximately to the earth's geographical south.

The north pole is the positive (+) pole and the south pole is the negative. *The north and south* poles were formerly called in France, *the austral and boreal poles* respectively.

Magnetic Field.—When a straight bar magnet is held under a piece of card board upon which iron filings are sprinkled, the filings will arrange themselves in curved lines radiating from the poles. If a horse shoe magnet be held at right angles to the plane of the card board, the filings will arrange themselves in curved lines, as shown in fig. 108. These lines are called *magnetic lines of force* or simply *lines of force;* they show that the medium surrounding a magnet is in a state of stress, the space so affected being called the *magnetic field*


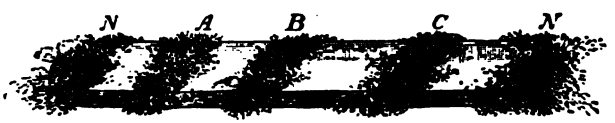


FIG. 100.—Badly magnetized bar. Properly magnetized magnets have only two poles; it is possible, however, by special or careless magnetization, to produce magnets with more than two poles, but no process will produce a magnet with a single pole. If an abnormal magnet with more than two poles be dipped into iron filings, the latter will adhere at places other than the two ends, as shown in the illustration. The polarities are alternately N and S; that is, the regions N, B, N, have north polarity, while A and C have south polarity. These are known as *consequent poles.*

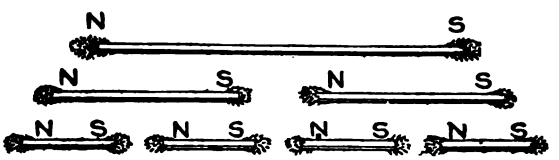

FIGS. 101 to 107.—Effect of breaking a magnet into several parts. If a magnetized needle be broken, each part will be found to be a complete magnet having a N and S pole. The sub-division may be continued indefinitely, but always with the same result as indicated in the figure. This is evidence of the correctness of the molecular theory of magnetism, which states that *the molecules of a magnet are themselves minute magnets arranged in rows with their opposite poles in contact.*

Ques. What is the extent and character of the magnetic field?

Ans. The influence of a magnet is supposed to extend in all *directions indefinitely*, however, the effect is very slight beyond *a comparatively limited* area.

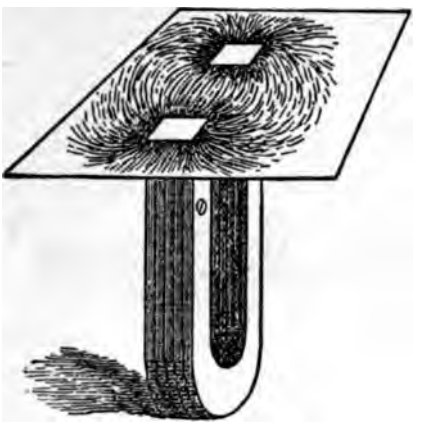


FIG. 108.—The region about a magnet in which its magnetic forces can be detected is called the *magnetic field*. This can be represented graphically by placing a piece of cardboard over the magnet and sprinkling iron filings on the paper, gently tapping at the same time. Each filing becomes a temporary magnet by *induction*, and sets itself, like the compass needle, in the direction of the *line of force* of the magnetic field.

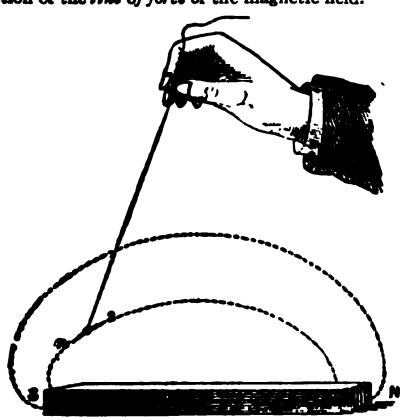


FIG. 109.—Tracing lines of force with a suspended magnet. If a small magnetic needle, suspended by a thread, be held near a magnet, it will point in some fixed direction depending on the proximity of the poles of the magnet. The direction taken by the magnet is called the direction of the force *at the point*, and if the suspended needle be moved forward in the direction *of the pole, it will trace* out a curved line which will be found to start from *one of the poles, and end at the other.* Any number of such lines can be traced; the space *filled by these lines of force is called the magnetic field.*

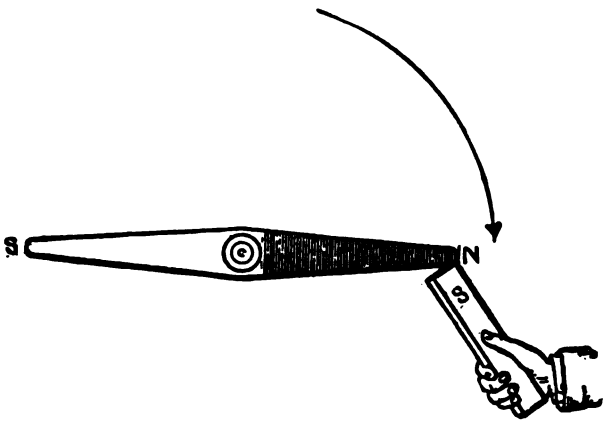


FIG. 110.—Magnetic action: *Unlike poles of magnets attract each other.*

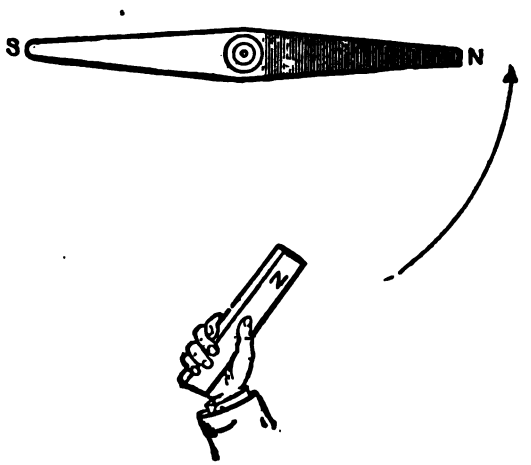


FIG. 111.—Magnetic action: Like poles of magnets repel each other.

Magnetic Force.—This is the force with which a magnet attracts or repels another magnet or any piece of iron or steel. The force varies with the distance, being greater when the magnet is nearer and less when the magnet is farther off. The following are the laws relating to magnetic force:

1. *Like magnetic poles repel one another; unlike magnetic poles attract one another.*

2. *The force exerted between two magnetic poles varies inversely as the square of the distance between them.*

Magnetic Circuit.—The path taken by magnetic lines of force is called a magnetic circuit; the greater part of such a circuit is usually in magnetic material, but there are often one or more air gaps included. The total number of lines of force in the circuit is known as the *magnetic flux.*

Ques. How is magnetic flux measured?

Ans. By a unit called the maxwell.

Named after James Clerk Maxwell the Scottish physicist.

Ques. What is the maxwell?

Ans. *The amount of magnetism passing through every square centimetre of a field of unit density.*

Ques. What is the unit of field strength?

Ans. The gauss.

Ques. What is a gauss?

Ans. *The intensity of field which acts on a unit pole with a force of one dyne. It is equal to one line of force per square*

centimetre. Named after Karl Friedrich Gauss, the German mathematician.

The Magnetic Effect of the Current.—Hans Christian Oerstead, the Danish scientist, discovered in 1819 that a magnet tends to set itself at right angles to a wire carrying an electric current. He also found that the way in which the needle turns, whether to the right or left of its usual position, depends: 1, upon the position of the wire that carries the current, whether

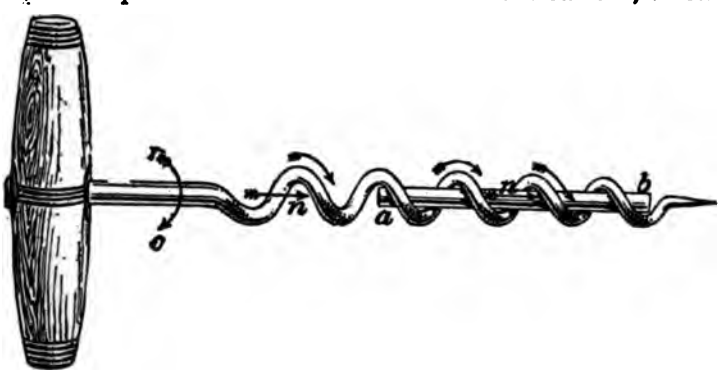


FIG. 112.—Illustrating Maxwell's "corkscrew rule" for relative directions of current and lines of force. According to the rule: *the direction of the current and that of the resulting magnetic force are in the same relation to each other as is the forward travel and rotation of an ordinary corkscrew.* Thus, in the figure, if a current flow through the wire *ab* in the direction from *a* to *b*, the magnetic lines will encircle the wire in the direction of the curved arrow *ro* which shows the direction in which the corkscrew must be turned to advance in the direction of the arrow *n*.

it be above or below the needle, and 2, on the direction in which the current flows through the wire.

To keep these movements in mind numerous rules have been suggested, of which the following will be found convenient:

Corkscrew Rule.—*If the direction of travel of a right handed corkscrew represent the direction of the current in a straight conductor, the direction of rotation of the corkscrew will represent the direction of the magnetic lines of force.*

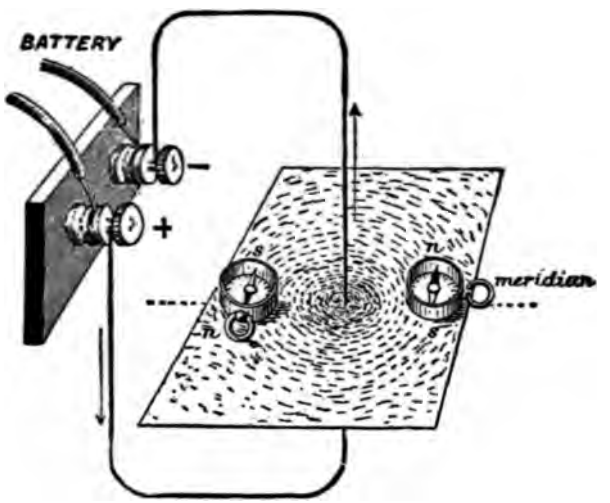


Fig. 113.—Experiment showing direction of lines of force in the magnetic field surrounding a conductor carrying an electric current. A piece of copper wire is pierced through the center of a sheet of cardboard, and carried vertically for two or three feet then bent around to the terminals of a battery or other source of current. If iron filings be sprinkled over the card while the current is passing, they will arrange themselves in circles around the wire, thus indicating the form of the magnetic field surrounding the conductor. Compass needles may also be used to show the direction of the lines of force at any point.

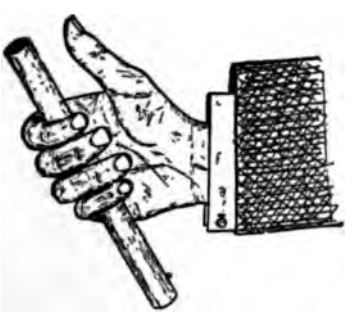


Fig. 114.—**Right hand** rule to determine the direction of magnetic field around a conductor carrying a current. The *thumb of the right hand* is placed along the conductor, pointing in the direction *in which the current is flowing*, then, if the fingers be partly closed, as *shown in the illustration, the finger tips will point* in the direction of the magnetic whirls

Ques. What is the effect of a current flowing in a loop of wire?

Ans. If, in figs. 116 and 117, the current flow in the direction indicated by the arrow, the lines for magnetic force are found to surround the loop as shown; all the lines leave on one side of the loop and return on the other; accordingly, a north pole is formed on one side, and a south pole on the other.

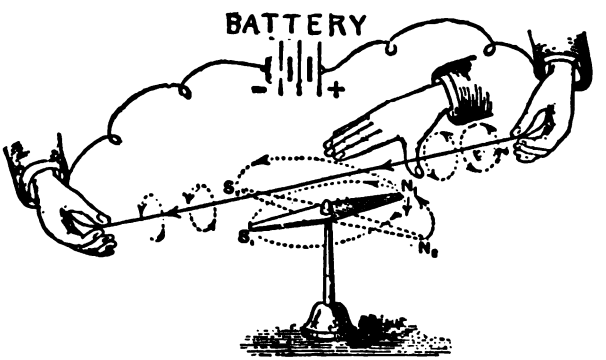


FIG. 115.—Right hand palm rule to determine the direction of the magnetic field around a conductor carrying a current: Place the palm of the outstretched right hand above and to the right side of the wire with the fingers pointing in the direction of the current, and the thumb extended at right angles, that is, pointing downward. The direction in which the thumb points will indicate the direction of the magnetic whirls.


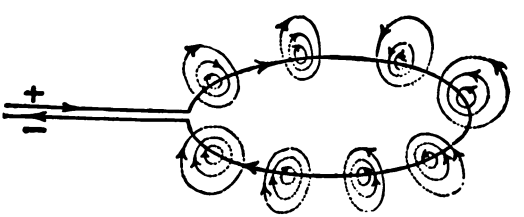


FIG. 116.—Lines of force of a circular loop. If a current flow through the loop in the direction indicated, the lines of force both inside and outside the loop, will cross the plane of the loop at right angles, and all those which cross the loop on the inside will pass through the plane in one direction (downwards in the figure), while all on the outside will return through the plane in the opposite direction.

enoids.—A solenoid consists of a spiral of conducting wire
l cylindrically so that, when an electric current passes
gh it, its turns are nearly equivalent to a succession of
el circular circuits, and it acquires magnetic properties
r to those of a bar magnet.

es. What is the character of the lines of force of a oid in which a current is flowing?

s. The lines of force must be thought of as closed loops
l with the current. The conductor conveying the current

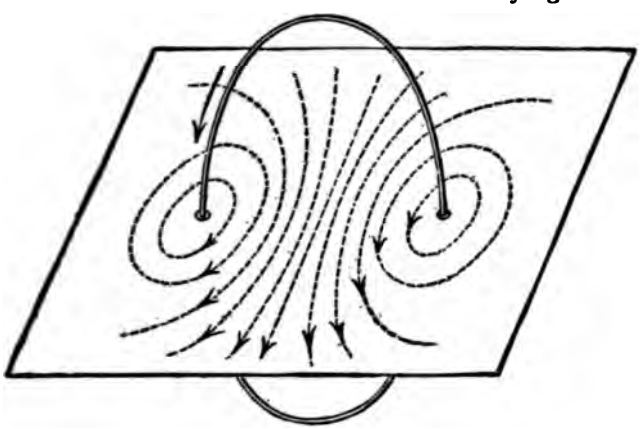

117.—Lines of force of a circular loop. If the loop pass through a piece of cardboard at right angles to its plane, and the current flow as indicated, the dotted lines on the cardboard will represent the direction of the lines of force in the plane of the cardboard. The student should verify the lines of force as here given by applying the corkscrew rule.

sses through all the loops of force, and these are, so to speak, readed or slung on the current line of flow, as in fig. 116.

Ques. What is the distribution of the lines of force?

Ans. The lines of force form continuous closed curves running rough the interior of the coil; they issue from one end and ter into the other end of the coil, as shown in fig. 117

Ques. What are the properties of a solenoid?

Ans. A solenoid has north and south poles, and in fact possesses all the properties of an ordinary permanent magnet, with the important difference that the magnetism is entirely under control.

Since a solenoid carrying a current attracts and repels by its extremities the poles of a magnet, two such solenoids will attract and repel each other.

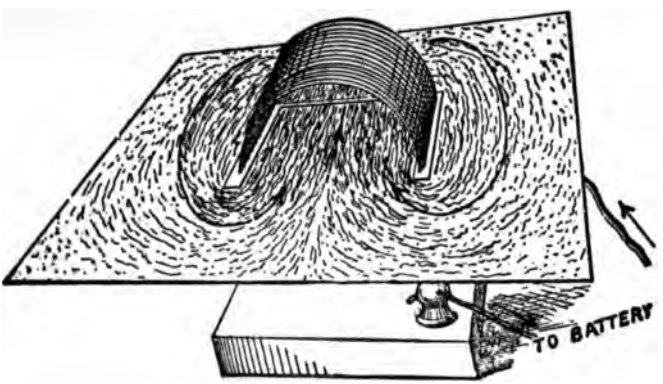


FIG. 118.—Magnetic field of a solenoid. This is best observed by cutting a piece of cardboard and fitting it around the solenoid, as shown. If iron filings be sprinkled on the cardboard and a current passed through the solenoid, the character of the field is indicated. With the current in the direction shown, it will be found that wherever small compass needles are placed, the direction in which their north poles turn is along arrows marked on the card. The card only exhibits the field in one of the sectional planes of the coil, but it is obvious that the field is the same for all sectional planes.

Ques. How does the magnetic strength of a solenoid vary?

Ans. It is proportional to the strength of the electric current passing through it.

Ques. On what, besides the current strength, does the magnetizing power of a solenoid depend?

Ans. *The magnetic effect or the magnetizing power is proportional to the number of turns of wire composing the coil.*

Ques. How may the magnetizing power of a solenoid be increased?

Ans. By inserting in the solenoid an *iron core* or round bar of soft iron.


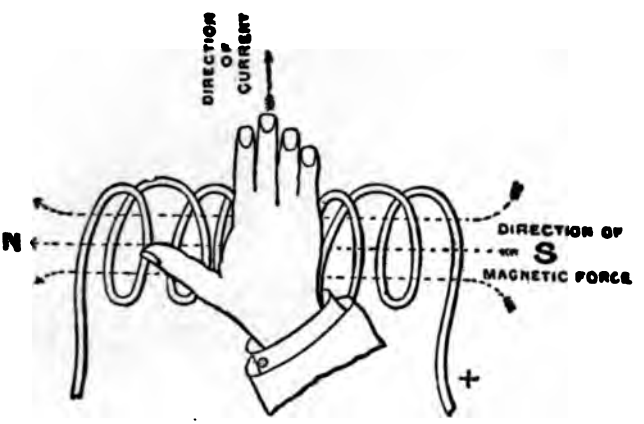


FIG. 119.—Right hand rule for polarity of a solenoid: If the solenoid be grasped in the right hand, so that the fingers point in the direction in which the current is flowing in the wires, the thumb extended will point in the direction of the north pole.

Ques. Describe the action of an iron core.

Ans. At first, the presence of an iron core greatly increases the strength of the field; after a time, however, as the strength of the current flowing in the exciting coils is increased, the *conductibility* of the iron for the lines of force appears to decrease, until a point is eventually reached when the presence of the iron core appears to have no effect in increasing the strength of the field.

Permeability.—Permeability is a measure of the ease with which magnetism passes through any substance. It is defined as: *the ratio between the number of lines of force per unit area passing through a magnetizable substance, and the magnetizing force which produces them.*

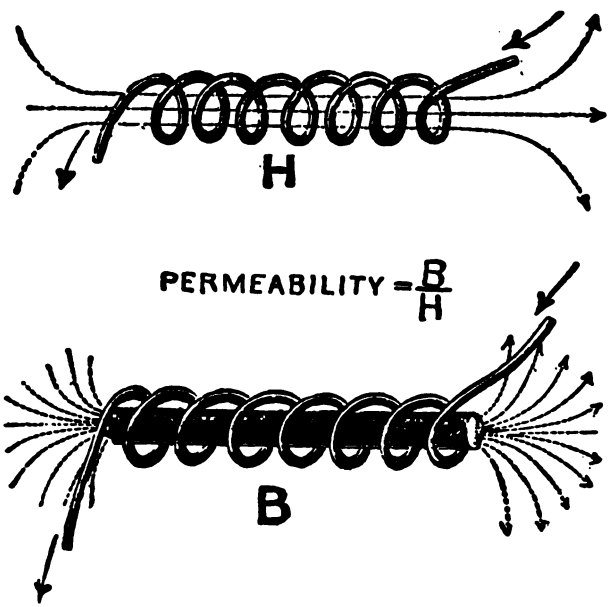

FIGS. 120 and 121.—Illustrating the effect of introducing an iron core into a solenoid. In the upper figure, the air space or "air core" surrounded by the solenoid offers considerable resistance to the passage of magnetic lines, allowing only a small number to pass through. If a piece of iron be introduced, as in the lower figure, the number of lines will be greatly increased. The number of lines B passing through a unit cross section of the iron core divided by the number of lines H, passing through a unit cross section of the air core is called the *permeability* and designated by the Greek letter μ.

In other words, it is the ratio of flux density to magnetizing force. *Permeability is a measure of the ease with which magnetism passes through any substance.* The permeability of good soft wrought iron *is sometimes 3000 times* that of air, varying with the quality of the *iron.*

Ques. What is the effect of increasing the magnetization?

Ans. The magnetic permeability decreases as the magnetization increases.

Ques. What is magnetic saturation?

Ans. The state of a magnet which has reached the highest degree of magnetization.

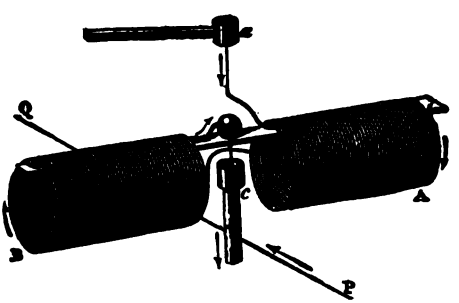


FIG. 122.—Action of currents on solenoids. To demonstrate this fact experimentally, a solenoid is constructed as shown, so that it can be suspended by two pivots in the cups *a* and *c*. The solenoid is ther movable about a vertical axis, and if a rectilinear current QP be passed beneath it, which at the same time traverses the wires of the solenoid, the latter is seen to turn and set at right angles to the lower current; that is, in such a position that its circuits are parallel to the fixed current; moreover, the current in the lower part of each of the circuits is in the same direction as in the rectilinear wire. If, instead of passing a rectilinear current below the solenoid, it be passed vertically on the side, an attraction or repulsion will take place, according as the two currents in the vertical wire, and in the nearest part of the solenoid, are in the same or in contrary directions.

A magnet, just after being magnetized, will appear to have a higher degree of magnetism than it is able to retain permanently; that is, it will appear to be super-saturated, since it will support a greater weight immediately after being magnetized than it will after its armature has been once removed.

For all practical purposes, magnetic saturation may be defined as: That point of *magnetization* where *a very large increase in the magnetising force does not produce any perceptible increase in the magnetisation.*

From tests it has been shown that permeability increases with the flux density up to a certain point and then decreases, indicating that the iron is approaching a state of saturation.

Magnetomotive Force.—This is a force similar to electromotive force, that is, magnetic pressure. When a coil passes around a core several times, its magnetizing power, or magnetomotive force, (m.m.f.) is proportional both to the strength of the current and to the number of turns in the coil. The product of the current passing through the coil multiplied by the number of turns composing the coil is called the *ampere turns.*

It is known by experiment that one ampere turn produces 1.2566 units of magnetic pressure, hence:

$$\text{magnetic pressure} = 1.2566 \times \text{turns} \times \text{amperes}$$

that is,

$$\text{magnetomotive force (m.m.f.)} = 1.2566 \times n \times I.$$

The unit of magnetic pressure is the *gilbert* (named after William Gilbert, the English physicist) and is equal to

$$1 \div 1.2566 \text{ ampere turn} = .7958 \text{ ampere turn.}$$

Reluctance.—The magnetic pressure (magnetomotive force) acting in a magnetic circuit encounters a certain opposition to the production of a magnetic field, just as electromotive force in an electric circuit encounters opposition to the production of a current. In the magnetic circuit this opposition is called the *reluctance;* it is simply *magnetic resistance* and may be defined as: *the resistance offered to the magnetic flux by the substance magnetized, being the ratio of the magnetomotive force to the magnetic flux.*

The unit of reluctance or magnetic resistance is the *oersted* (named after Hans Christian Oersted, the Danish physicist) and is defined as: *the reluctance offered by a cubic centimetre of vacuum.*

Analogy Between Electric and Magnetic Circuits.—The total number of magnetic lines of force, or magnetic flux, produced in any magnetic circuit will depend on the magnetic

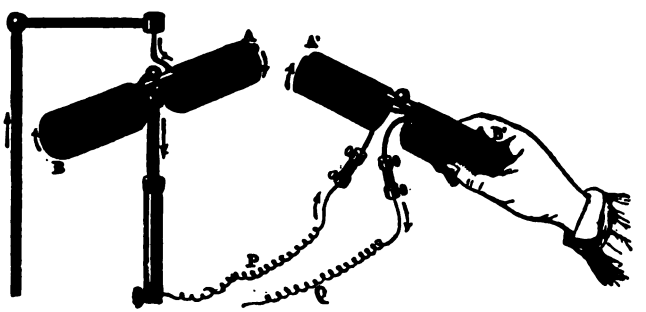


Fig. 123.—Mutual action of solenoids. When two solenoids traversed by a current are allowed to act on each other, one of them being held in the hand and the other being movable about a vertical axis, as shown in the figure, attraction and repulsion will take place just as in the case of two magnets (see figs. 110 and 111).

pressure (m.m.f.) acting on the circuit and the total reluctance of the circuit, just as the current in the electrical circuit depends upon the electrical pressure and the resistance of the circuit.

To make this plain, Ohm's law states that

$$\text{electric current} = \frac{\text{electromotive force}}{\text{resistance}} \text{ or } I = \frac{E}{R}$$

expressed in units

$$\textit{amperes} = \frac{\text{volts}}{\text{ohms}}$$

The resistance, as already explained, depends on the materials of which the circuit is composed, and their geometrical shape and size.

Similarly, in the magnetic circuit, the total number of magnetic lines produced by a given magnetizing solenoid depends on the magnetic pressure, the material composing the circuit, and its shape and size.

That is,

$$\text{magnetic flux} = \frac{\text{magnetomotive force}}{\text{reluctance}}$$

expressed in units, the equation becomes:

$$\text{maxwells} = \frac{\text{gilberts}}{\text{oersteds}}$$

The gilbert is the unit of magnetomotive force, equivalent to the magnetomotive force of .7958 *ampere turn.*

It should be noted that in the electric circuit resistance causes heat to be generated and therefore energy to be wasted, but in the magnetic circuit reluctance does not involve any similar waste of energy.

Ques. Upon what does the reluctance of a magnetic circuit depend?

Ans. *The reluctance is directly proportional to the length of the circuit, and inversely proportional to its cross sectional area.*


The reluctance of a magnetic circuit is calculated according to the *following* equation:

$$\textit{reluctance} = \frac{\text{length in centimetres}}{\text{permeability} \times \text{cross section in square centimetres}}$$

teresis.—The term hysteresis has been given by Ewing subject of *lag of magnetic effects behind their causes.* Hys- means to "lag behind," hence its application to denote *gging of magnetism, in a magnetic metal, behind the mag- g flux which produces it.*

a. What is the cause of hysteresis?

. It is due to the friction between the molecules of iron ier magnetic substance which requires an expenditure of r to change their positions.

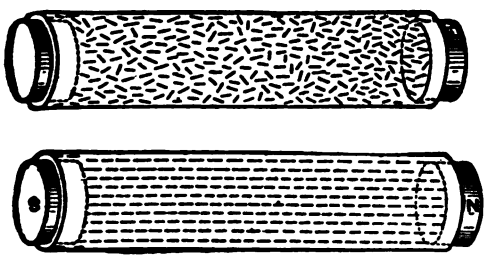

4 and 125.—Experiment illustrating the molecular theory of magnetism. Coarse steel gs are placed inside a small glass tube and the contents magnetized. It will be found : filings which at first had no definite arrangement will rearrange themselves under influence of magnetic force, and assume symmetrical positions, each one lying in line t, or parallel to its neighbor, as shown in the lower figure.

es. When do the molecules change their positions?

. Both in the process of magnetization and demagnetiza-

es. What becomes of the loss of energy due to hys- is?

. It is converted into heat in changing the positions of olecules during magnetization and demagnetization.

Ewing gives the value for the energy in ergs dissipated per cubic entimetre, for a complete *cycle of doubly* reversed strong magnetization or a *number of substances as follows:*

Substance	Energy dissipated (ergs)
Very soft annealed iron	9,300
Less " " "	16,300
Hard drawn steel wire	60,000
Annealed " "	70,000
Same steel glass hard	76,000
Piano steel wire annealed	94,000
" " " normal temper	116,000
" " " glass hard	117,000

Approximately 28 foot pounds of energy are converted into heat in making a double reversal of strong magnetization in a cubic foot of iron.

Residual Magnetism.—When a mass of iron has once be magnetized, it becomes a difficult matter to entirely remove traces when the magnetizing agent has been removed, and a general rule, a small amount of magnetism is permanen retained by the iron. This is known as *residual magnetism*, it varies in amount with the quality of the iron.

Well annealed, pure wrought iron, as a rule, possesses v little residual magnetism, while, on the other hand, wro iron, which contains a large percentage of impurities, or w has been subjected to some hardening process, such as hamm ing, rolling, stamping, etc., and cast iron, possess a very l amount of residual magnetism.

Residual magnetism in iron is of great importance in the wo ing of the *self-exciting* dynamo, and is, indeed, the essen principle of this class of machine.

That is, without residual magnetism in the field magnet core, dynamo when started would not generate any current unless it rec an initial excitation from an external source.

CHAPTER X

ELECTRO-MAGNETIC INDUCTION

The word *induction*, introduced by Faraday, has various meanings as it relates to electricity. It signifies, in general, a force produced in bodies by the influence of other bodies, without necessary material connection with them.

A body *charged with electricity causes or "induces" charges on neighboring bodies.* The process in this case is called *electrostatic induction.*

A magnet induces magnetism in neighboring masses of iron or other magnetic materials by the process of *magnetic induction.*

And a moving magnet induces electric currents in neighboring conductors by the process of *electromagnetic induction.*

Faraday's Discovery.—All dynamos of whatever form, are based on the discovery made by Faraday in 1831, which may be stated as follows:

Electric currents are generated in conductors by moving them in a magnetic field, so as to cut magnetic lines of force.

Faraday's own description of his discovery is as follows: "Two hundred and three feet of wire in one length were coiled round a large block of wood; another two hundred feet of similar wire were introposed as a spiral between the turns of the first coil, metallic contact everywhere prevented by twine. One of these helices was connected with a delicate galvanometer, and the other with a battery of one hundred pairs of plates, four inches square, well charged. When the contact was made there was a sudden and powerful effect at the galvanometer, and there was also a similar slight effect when the contact with the battery was broken."

Ques. What does the expression "cut lines of force" mean?

Ans. A conductor, forming part of an electric circuit, *cuts lines of force* when it moves across a magnetic field in such manner as to *alter* the number of magnetic lines of force which are embraced by the circuit.

It is important to clearly understand the meaning of this expression which will be later explained in more detail.

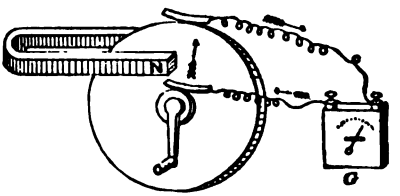


FIG. 126.—Faraday's dynamo which embodies his discovery in 1831 of *electromagnetic induction*, the principle upon which all dynamos work, as well as induction coils, transformers, and other electrical apparatus.

Faraday's Machine.—After various experiments, Faraday made his "new electrical machine" as shown in fig. 126. This piece of apparatus is preserved and was shown in perfect action by Prof. S. P. Thompson in a lecture delivered April 11th, 1891, after an interval of sixty years.

It consists of a horse shoe magnet and a copper disc attached to a shaft and supported so as to turn freely. The magnet is so placed that its inter-polar lines of force traverse the disc from side to side. There are two copper brushes, one bears against the shaft, and the other against the circumference of the disc. A handle serves to rotate the disc in the magnetic field.

Now, if the north pole of the magnet be nearest the observer and the disc be rotated clockwise, the current *induced* in the circuit will flow out at the brush which touches the circumference, and return through the *brush at the shaft.*

Faraday's Principle.—The principle deduced from Faraday's periment may be stated as follows:

When a conducting circuit is moved in a magnetic field so as alter the number of lines of force passing through it, a current induced therein, in a direction at right angles to the direction of motion, and at right angles also to the direction of the lines of ce, and to the right of the lines of force, as viewed from the point om which the motion originated.

Faraday's principle may be extended as follows to cover all ses of electromagnetic induction:

When a conducting circuit is moved in a magnetic field, so as to er the number of lines of force passing through it, or when the ength of the field is varied so as to either increase or decrease the mber of lines of force passing through the circuit, a current is duced therein which lasts only during the interval of change in number of lines of force embraced by the circuit.

Ques. Explain just what happens when a current is duced by electromagnetic induction.

Ans. In order to induce an electromotive force by moving a nductor across a uniform magnetic field, it is necessary that e conductor, in its motion, should so cut the magnetic lines s to alter the number of lines of force that pass through the rcuit of which the moving conductor forms a part.

Ques. What is the proper name for a "conductor" hich moves across the magnetic field?

Ans. An *inductor*, because it is that part of the electric cir- it in which induction takes place.

In the case of a *dynamo, an inductor* may be either a copper wire or copper bar.

Ques. How may a conducting circuit be moved across a magnetic field without having a current induced therein?

Ans. If a conducting circuit—a wire ring or single coil, for example—be moved in a uniform magnetic field, as shown in fig. 127, so that only the same number of lines of force pass through it, no current will be generated, for since the coil is moved by a motion of translation to another part of the field, as many lines of force will be left behind as are gained in advancing from its first to its second position.

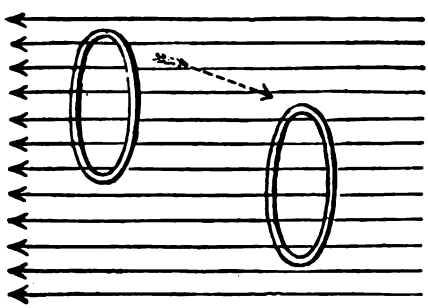


FIG. 127.—Electromagnetic induction: In order to induce a current by electromagnetic induction, a conductor must be so moved through a magnetic field *that the number of lines of force passing through it (that is, embraced) are altered.* If a coil be given a simple motion of translation in a uniform magnetic field as indicated in the figure, no current will be induced *because the number of lines of force passing through it are not changed,* that is, during the movement as many lines are lost as are gained.

Ques. Describe another movement by which no current will be induced.

Ans. If the coil be merely rotated on itself around a central *axis, that is,* like a fly wheel rotating around a shaft, the number *of lines of force* passing through the coil will not be altered, hence *no current* will be generated.

Ques. State the essential condition for current induction in a uniform field.

Ans. The coil in which a current is to be induced, must be tilted in its motion across the uniform field, or rotated around any axis in its plane as in fig. 128, *so as to alter the number of lines of force which pass through it.*

Ques. In what direction will the current flow in the coil, fig. 128?

Ans. The current induced in the coil will flow around it in a clockwise direction (as observed by looking along the magnetic

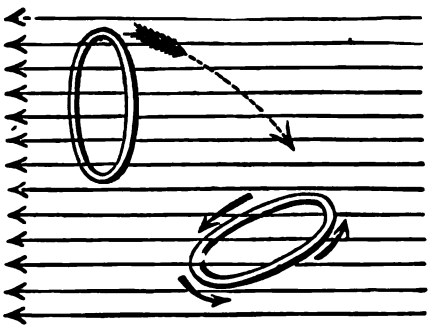


FIG. 128.—Electromagnetic induction: If a coil be given a motion of rotation from any point within its own plane so that it passes through a uniform magnetic field, a current will be induced in the coil *because the number of lines of force passing through it is altered.*

field in the direction in which the magnetic lines run) if the effect of the movement be to diminish the number of lines of force that pass through the coil. The current will flow in the opposite direction, (counter-clockwise) if the movement be such as to increase the number of intercepted lines of force.

Ques. If the magnetic field be not uniform, as in fig. 129, what will be the result?

Ans. The effect of moving the coil by a simple motion of *translation from a dense* region of the field to one less dense, o

vice versa, will be to induce a current because in either case, the number of lines of force passing through the coil is altered.*

Laws of Electro-magnetic Induction.—There are certain laws of electro-magnetic induction which, on account of the importance of the subject, it is well to carefully consider. The facts presented in the preceding paragraphs are embodied in the following fundamental laws:

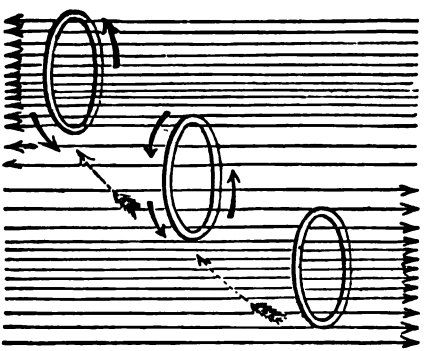


FIG. 129.—Electromagnetic Induction: If a coil be given a simple motion of translation in a non-uniform or variable magnetic field, a current will be induced in the coil, whether the motion be from the dense to the less dense region of the field or the reverse, *because the number of lines of force passing through the coil is altered.*

1. *To induce a current in a circuit, there must be a relative motion between the circuit and a magnetic field, of such a kind as to alter the number of magnetic lines embraced in the circuit.*

2. *The electromotive force induced in a circuit is proportional to the rate of increase or decrease in the number of magnetic lines embraced by the circuit.*

*NOTE.—*In reality* it would be impossible to have a magnetic field exactly like fig. 129, for *in the less dense part,* the magnetic lines would be of curved complex form.

For instance, if n equal the number of magnetic lines embraced by the circuit at the beginning of the movement, and n' the number embraced after a very short interval of time t, then

$$\text{the average induced electromotive force} = \frac{n - n'}{t}$$

It would require the cutting of 100,000,000 lines per second to produce an electromotive force equal to that of one Daniell cell.

The unit of electromotive force, called the *volt*, is the electric pressure produced by cutting 100,000,000 lines per second, usually expressed 10^8.

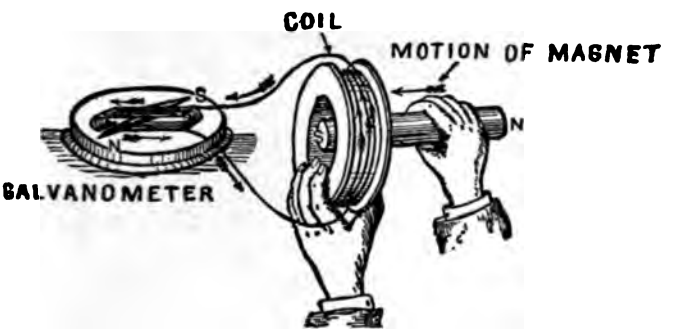


Fig. 130.—Experiment illustrating Lenz's law which states that in all cases of electromagnetic induction, *the direction of the induced current is such as to tend to stop the motion producing it.* In the experiment, in order to produce the induced current, energy must be expended in bringing the magnet to the coil and in taking it away, which is in accordance with the law of conservation of energy.

3. *By joining in series a number of conductors or coils moving a magnetic field, the electromotive forces in the separate parts are added together.*

The reason for this is apparent by considering a coil of wire having several turns and moving in a magnetic field so as to cut magnetic lines. During the movement, the lines cut by the first turn are successively cut by all the other turns of the coil, hence, the total number of lines cut is equal to the number cut by a single turn multiplied by the number of turns. The electromotive forces therefore of the separate turns are added.

EXAMPLE:—If a coil of wire of 50 turns cut 100,000 lines in $\frac{1}{100}$ of a second, what will be the induced voltage?

The number of lines cut per second per turn of the coil is

$$100{,}000 \times 100 = 10{,}000{,}000.$$

The total number of lines cut by the coil of 50 turns is

$$10{,}000{,}000 \times 50 = 500{,}000{,}000.$$

which will induce a pressure of

$$500{,}000{,}000 \div 10^8 = 5 \text{ volts.}$$

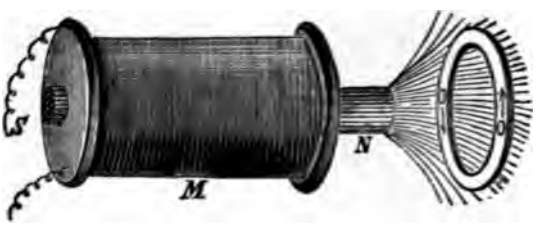


FIG. 131.—Experiment illustrating Lenz s law. If a copper ring be held in front of an ordinary electromagnet, and the current circulating through the coil of the magnet be in such a direction as to magnetize the core as indicated by the latters S N, then as the current increases in the coil more and more of the lines of force proceeding from N pass through the ring O O from left to right. While the field is thus increasing currents will be induced in the copper ring in the direction indicated by the arrows, such currents tending to set up a field that would pass through the ring from right to left, and would therefore retard the growth of the field due to the electromagnet M.

4. *A decrease in the number of magnetic lines which pass through a circuit induces a current around the circuit in the positive direction.*

The term positive direction is understood to be the direction along which a free N pole would tend to move.

5. *An increase in the number of magnetic lines which pass through a circuit induces a current in the negative direction around the circuit.*

The reason for the change of direction of the current for decrease or increase in the number of lines cut, as stated in the fourth and fifth laws, will be seen by aid of the formula given under the second law, viz:


$$\text{electromotive force} = \frac{n - n'}{t} \quad \ldots\ldots\ldots\ldots\ldots\ldots (1)$$

's law

$$\text{current} = \frac{\text{electromotive force}}{\text{resistance}} \text{ or, } I = \frac{E}{R} \quad \ldots\ldots\ldots\ldots(2)$$

ıting (1) in (2)

$$\text{current} = \frac{\frac{n - n'}{t}}{R} \text{ or, } \frac{n - n'}{Rt} \quad \ldots\ldots\ldots\ldots(3)$$

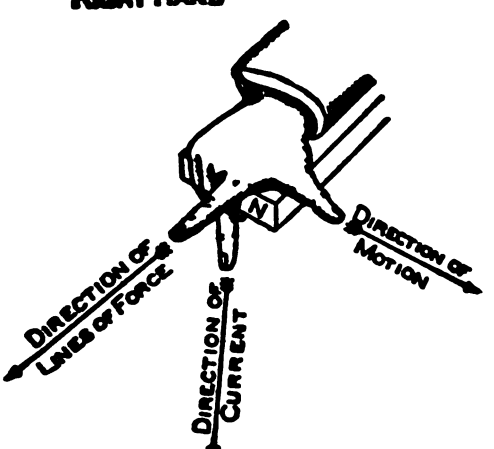

lemming's rule for direction of induced current. Extend the thumb, forefinger and nger of the right hand so that each will be at right angles to the other two. Place in such position that the thumb will point in the direction in which the conductor he forefinger in the direction of the lines of force (N to S), then will the middle int in the direction in which the induced current flows.

w in equation (3) if there be a *decrease* in the number of lines cut l be less than n hence the current will be positive (+); again, if the *increase* n' will be greater than n, which will give a minus value, s, the current will be negative or in a reverse direction.

he approach and recession of a conductor from a magnet yield currents alternating in direction.

Since the strength of the field depends on the proximity to the pole, the approach and recession of a conductor involve an *increase* and *decrease* in the rate of cutting of magnetic lines, hence a reversal of current.

7. *The more rapid the motion, the higher will be the induced electromotive force.*

In other words, the greater the number of lines cut per unit of time, the higher will be the voltage.

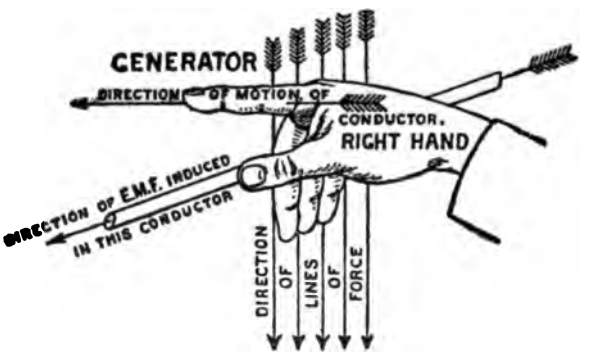


FIG. 133.—A rule for direction of induced current which, in some cases, is more conveniently applied than Fleming's rule: Hold the thumb, forefinger and remaining fingers of the right hand at right angles to each other; place the hand in such position that the forefinger points in the direction of motion of the conductor, the three fingers in the direction of the lines of force, then will the thumb point in the direction of the induced current.


8. *Lenz's law. The direction of the induced current is always such that its magnetic field opposes the motion which produces it.*

This is illustrated in figs. 130 and 131.

Rules for Direction of Induced Current.—There are a number of rules to quickly determine the direction of an induced current, when the direction of the lines of force, and motion of the conductor are known. The first rule here given was devised by *Fleming* and is very useful. It is sometimes called the *"dynamo rule."*

Fleming's Rule.—*If the forefinger of the right hand be pointed in the direction of the magnetic lines, and the thumb (at right angles to the forefinger) be turned in the direction of the motion of the conductor, then will the middle finger, bent at right angles to both the thumb and forefinger, show the direction of the induced current.*

The application of this rule is shown in fig. 132. Here the right hand is so placed at the north pole of a magnet, that the forefinger points in the direction of the magnetic lines; the thumb in the direction of motion of the conductor; the middle finger pointed at right angles to the thumb and forefinger indicates the direction of the current induced in the conductor.

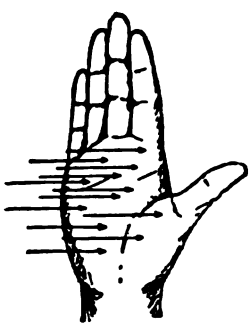

134.—The palm rule for direction of induced current: If the palm of the right hand be held against the direction of the lines of force, the thumb in the direction of the motion, then the fingers will point in the direction of the induced current.

Ampere's Rule.—*If a man could swim in a conductor with the current, then the north seeking (+) pole of a magnetic needle placed directly ahead of him, will be deflected to the left, while the south seeking (−) pole will be urged to the right.*

For certain particular cases in which a fixed magnet pole acts on a movable circuit, the following converse to Ampere's rule will be found useful: If a man swim in the wire with the current, and turn so as to look along the direction of the lines of force of the pole (that is, as the lines of force run, *from* the pole if it be north seeking, *toward* the pole if it be south seeking), *then* he and the conducting wire with him will be urged toward his left

The palm rule.—*If the palm of the right hand be held facing against the lines of force, and the thumb in the direction of motion, then will the fingers point in the direction of the induced current.*

Self-induction.—This term signifies *the property of an electric current by virtue of which it tends to resist any change of value.* Self-induction is sometimes spoken of as *electromagnetic inertia* and is analogous to the mechanical inertia of matter.

It is on account of self-induction of the induced current in the armature winding of a dynamo, that sparks appear at the brushes when the latter are not properly adjusted, hence the importance of clearly understanding the nature of this peculiar property of the current.

Self-induction is fully explained in the chapter following.



CHAPTER XI

INDUCTION COILS

induction coil has always been a popular piece of ap-
with those interested in electrical science; the experi-
which can be performed with its aid are very numerous.
considerable importance, especially in its application to
seful purposes as X ray work, wireless telegraphy and
for gas engines. The latter has caused manufacturers
much attention to the development of the induction coil,
ig in many refinements of design and construction.

ction coils may be divided into two general classes:

rimary coils;
econdary coils.

subject of electromagnetic induction has been fully ex-
in chapter X, but it may be said, with special reference
ction coils, that the operation of the two classes just men
is respectively due to:

elf-induction;
lutual induction.

-induction.—This is the property of an electric current
ue of which *it tends to resist any change in its rate of flow.*
metimes spoken *of as electromagnetic inertia* and is analo-
the mechanical inertia of matter.

Self-induction is due to the action of the current during variations in strength. It becomes especially a coil of wire, in which the adjacent turns act induct each other upon the principle of *mutual induction* arisi two separate adjacent circuits. Self-induction mani by giving "*momentum*" to the current so that *it ca stantly stopped when the circuit is broken*, the result bei

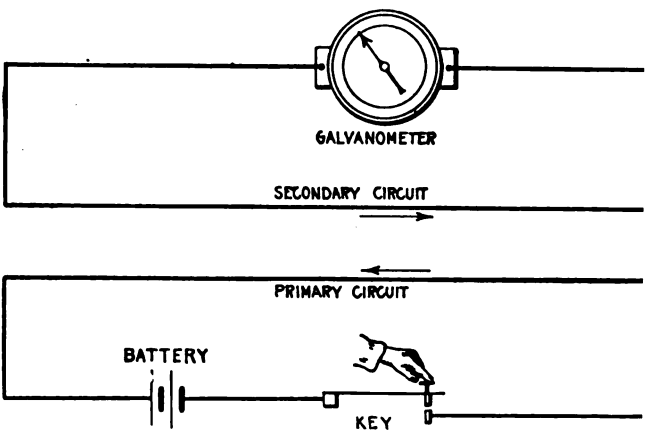


FIG. 135.—Diagram illustrating the action of mutual induction between tw one including a source of electrical energy and a switch; the other including but having no cell or other electrical source. During the increase or strength of the current as on closing or opening the key a current is *induced* i circuit in a direction opposite to that of the primary current as indicated by

spark at the moment of breaking the circuit. On this spark a primary induction coil is used in low "make and break" ignition systems.

In a single circuit, consisting of a straight wire and return wire there is little or no self-induction. Whe containing a primary induction coil and a battery is cl is no spark because at the instant of closing the circuit t *is at rest* and on account of self-induction *the curren nce rise to its full value.*

Mutual Induction.—This is a particular case of electromagnetic induction in which the magnetic field producing an electromotive force in a circuit is due to the current in a neighboring circuit.

The effect of mutual induction may be explained with the aid of fig. 135. If, as illustrated, a circuit including a battery and a switch, be placed near another circuit, formed by connecting the two terminals of a galvanometer by a wire, it will be found that whenever the first circuit, 1, is closed by the switch, allowing a current to pass in a given direction, a momentary current will be induced in the second circuit, 2, as shown by the galvanometer. A similar result will follow on the opening of the battery circuit, the difference being that the momentary induced current occurring at closure moves in a direction opposite to that in the battery circuit, while the momentary current at opening moves in the same direction.

Currents, besides being induced in circuit 2 at *make* or *break* of circuit 1, are also induced when the current in 1 is fluctuating in intensity.

The most marked results are observed when the make or break is sudden, *the action being strongest at the break of the current in* 1. The inductive effect of the current in the arrangement shown in fig. 135 is very weak.

Ques. What name is given to circuit 1?

Ans. The *primary circuit.*

Ques. What name is given to circuit 2?

Ans. The *secondary circuit.*

Ques. What names are given respectively to the currents in *circuits 1 and 2?*

Ans. The primary and secondary or *induced currents*

Primary Induction Coils.—These represent the simplest form of coil, and are used chiefly in low tension ignition to intensify the spark when a battery forms the current source.

A primary coil consists of a long iron core wound with a considerable length of low resistance insulated copper wire, the length of the core and the number of turns of the insulated wire winding determining the efficiency. The effect of the iron core is to increase the self-induction.





FIG. 136.—Primary induction coil as used for low tension ignition. Coils of this type are made in a great variety of form and size. Ordinarily the winding consists of about six convolutions of No. 14 copper wire. The winding is usually covered and the ends capped with ebonite heads so that the core wires are not exposed.

The spark produced, as previously explained, is due to self-induction, and it should be remembered that in the operation of the coil, the *spark occurs at the instant of breaking the circuit not at the instant of making.*

Secondary Induction Coils.—The arrangement shown in fig. 137, may be considered as a very simple or rudimentary form of secondary induction coil. In the actual coil, the primary and secondary circuits (corresponding to 1 and 2 in fig. 135) are made up of coils of insulated wire, as shown in fig. 143, the primary coil P, being wound over a core C and the secondary coil S being wound over the primary.


The one property of such an arrangement that makes it of *great value for most purposes* is that the voltage of the induced



nts may be increased or diminished to any extent depending he relation between the number of turns in the primary and ndary winding.

his relation may be expressed in the following rule:

he voltage of the secondary current is (approximately) to the ge of the primary current as the number of turns of the secondary ding is to the number of turns of the primary winding.

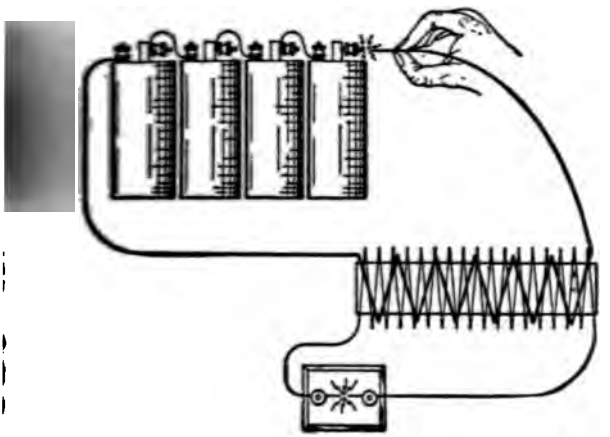

LIT.—Production of spark with plain coil. Connect the ends or leads of the secondary winding to fixed insulators and bend the ends so they are from one-sixteenth to one-eighth inch apart. Connect one end of the primary winding to an electric battery, and with the other lead of the primary winding brush against the other terminal of the battery, as indicated. When the contact is broken there will be a spark both at the point of rupture in the primary circuit and at the gap. An electric impulse is also induced in the secondary circuit when the primary circuit is closed and the current flowing in it gradually rises to its maximum value, but this impulse is too feeble to cause a spark to jump across the gap. Only the impulse induced in the secondary during the dying out of the current in the primary is utilised.

For instance, if the voltage of the primary current be 5 volts, the primary winding have 10 turns and the secondary 100 turns, then

Secondary voltage: 5 :: 100 : 10

from which

Secondary voltage = 50 volts (approximately)

The watts in each circuit are approximately the same for instance, the current strength in the primary circuit b the watts in primary circuit are $5 \times 5 = 25$. Accordingly, fo ary circuit the current strength is:

$$25 \text{ watts} \div 50 \text{ volts} = \tfrac{1}{2} \text{ ampere (approximately)}$$

From this, it is seen that where the voltage is raised in t circuit, the current flow is small as compared to that in circuit; therefore, heavy wire is used in the primary winc wire in the secondary, as indicated in figs. 137 and 143.

For most purposes a very much higher secondary voltag than in the example just given.

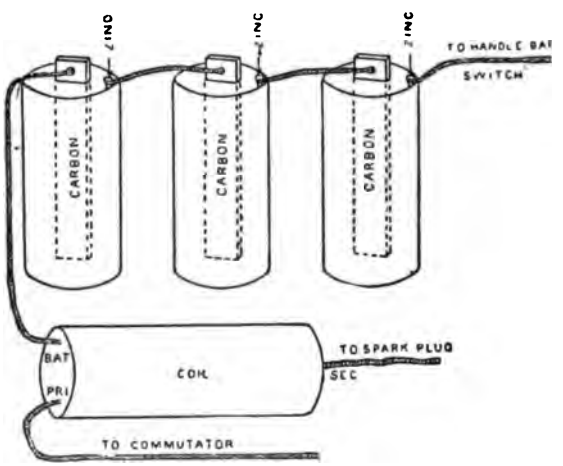


FIG. 138.—Diagram of battery and coil connections for jump spark ignition motor cycle. Coils are usually plainly labeled with the abbreviations: "Sec.," indicating that the wires are to be connected to the battery, the or contact maker, and the spark plug. The battery and primary wire low tension circuit are easily distinguished from the secondary wire by th of insulation surrounding them.

Secondary induction coils may be divided into thr classes:

1. Plain coils;
3. Vibrator coils;
2. Condenser coils.

The plain coil gives but one spark when the primary circuit is made and broken, while the vibrator coil gives a series of sparks following each other in rapid succession.

Plain Secondary Induction Coils.—Coils of this class are very simple and consist of:

1. Core;
2. Primary winding;
3. Secondary winding.

The construction of a plain coil, such as would be suitable for ignition service, is about as follows:

The core is made of soft annealed iron wires (No. 20 B and S gauge) from one-half to three-quarters of an inch in diameter and about six inches long. Over this core is slipped a spool of insulating material (hard rubber or composition), on which is wound first the primary winding of the coil, which consists of several layers of about No. 18 B and S gauge silk insulated magnet wire.

After the *primary winding* has been wound over the insulated core, and the ends have been properly brought out through the heads of the spool to be connected to binding posts thereon, a layer of insulating material is applied over the primary wire, and the secondary winding is then wound on.

The wire for the secondary winding consists of about No. 36 B and S gauge silk covered magnet wire, the amount used varying considerably, depending on the desired voltage of the secondary current.

When all the wire has been wound on, the ends are brought out to the binding posts, the coil is soaked in shellac dissolved in alchool and baked, or in melted paraffin or a paraffin compound, and allowed to cool. It is then placed in either a cylindrical hard rubber shell or in a hard wood box.

The proportions of such coils vary greatly; for motor cycle use they are made long and of small diameter (10x2½ inches for instance), while for some other purposes short and thick coils are found more convenient,

Ques. How may the coil just described be connected for demonstrating purposes?

Ans. Connect the ends of the secondary winding to fixed insulators *and bend the ends so* they are about ⅛ inch or less

apart. Connect one end of the primary winding to a b and brush the other end of the primary winding again other terminal of the battery as indicated in fig. 137.

Ques. What happens when the primary circuit is r

Ans. An electric pressure is induced in the secondary c but of not enough intensity to cause a spark to jump acr air gap.



FIG. 139.—A Medical coil with armature and attachments consisting of electrc place, sponge, induction coil etc. A current of any degree of intensity obtained. The currents furnished are: 1, primary, 2, secondary; and 3, pri secondary combined.

Ques. What happens when the primary circuit is denly broken?

Ans. A spark is produced both at the point of break *primary circuit* and at the air gap in the secondary circuit

Ques. Why is a spark produced at the air gap at break and not at make of the primary current?

Ans. Because when the current is flowing it cannot be stopped instantly on account of self induction, that is, it acts as though it possessed weight.

If the reader has charge of a gas engine with a make and break ignition system, he will often avoid vexatious delays in locating ignition troubles, if he remember that one of the most important conditions for obtaining a good spark is that the *break take place with great rapidity.* This, of course, involves that the ignition spring be adjusted to the proper tension.

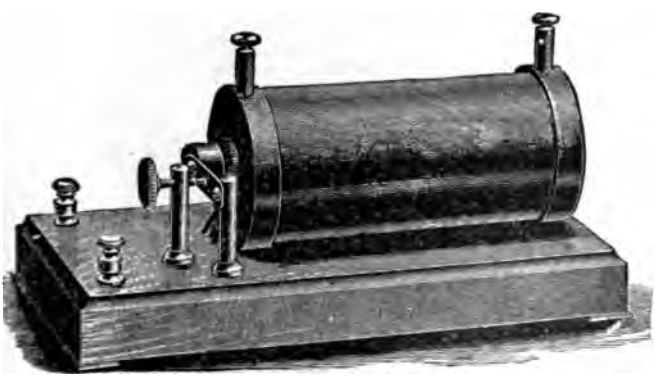


FIG. 140.—Rhumkorff induction coil. A secondary coil with vibrator and condenser; a type generally used in the laboratory. The name Rhumkorff was formerly very widely applied to induction coils for the reason that some of the earliest coils were constructed by Rhumkorff.

Secondary Induction Coils with Vibrator and Condenser.—A plain secondary coil, such as just described, will only give feeble sparks for its size for the following reasons: The inductive effect of the primary winding in the secondary depends as *previously explained on the* rate at which the current in the *primary winding decreases or* dies out.

If a strong inductive effect is to be produced in the secondary, the current in the primary must stop suddenly. This is prevented by self-induction in the primary winding, which opposes any change in the current strength. The direct result is that, as the primary circuit is broken, a spark appears at the break, which means that the current continues to flow after the break has occurred, dying down comparatively slowly, hence, the inductive effect on the secondary winding is small.

The spark at the break in the primary circuit is even larger than that in the secondary circuit, and as this primary spark

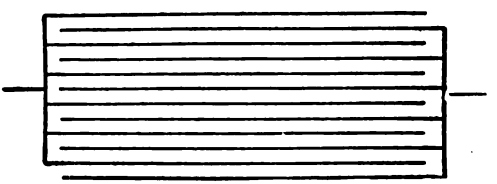


FIG. 141.—Conventional diagram of a condenser. A condenser is a device designed to absorb or hold an electric charge in about the same manner as a vessel will hold a liquid. Every conductor of electricity forms a condenser and its capacity for holding a charge depends upon the extent of its surface. A condenser is therefore made of conductive material formed into such shape as to present the maximum surface for a given amount of material.


serves no useful purpose, but, on the contrary, quickly burns away the contact points, such an arrangement is obviously defective.

The vibrator-condenser coil is designed to overcome this trouble and also to give a series of sparks following in rapid succession instead of one.

It should be noted that a series of sparks following each other with considerable rapidity may be obtained with a plain coil by placing *mechanical vibrator* in the primary circuit, as used on some motor cycl ignition circuits.

The object of the vibrator, of a vibrator-condenser coil, is t *rapidly make* and break the primary circuit during the time

circuit is closed externally. It consists of a flat steel ecured at one end, with the other free to vibrate. At a out midway between its ends, contact is made with the an adjusting screw, from which it springs away and in vibrating. The points of contact of blade and screw ed with platinum. One wire of the primary circuit is d to the blade and the other to the screw, hence, the s made when the blade is in contact with the screw and when it springs away.

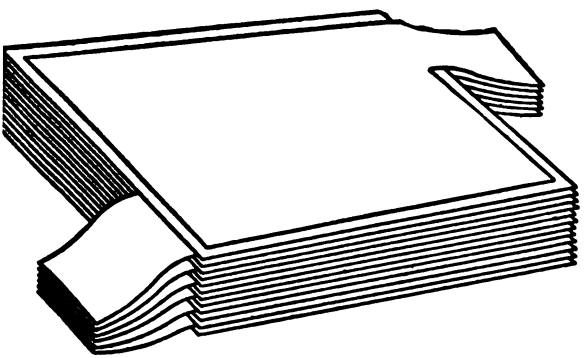

-Construction of condenser for an induction coil. The conducting material used il, of which a large number of sheets are prepared, all cut to the same size. These ced, one on top of the other, like the pages of a book, with a thin layer of insulating al between, usually two sheets of paraffined paper. Numbering the successive of tinfoil serially, all sheets of even number are connected together and all of odd number are connected together, these connections forming the terminals condenser. The condenser is then connected across the break in the primary

ndenser is used to absorb the self-induced current of the y winding and thus prevent it opposing the rapid fall primary current.

Every conductor of electricity forms a condenser and its capacity absorbing a charge depends upon the extent of its surface. Hence, ondenser is constructed of conductive material so arranged as to sent the *greatest surface for a given* amount of material.

The usual form of condenser for induction coils as shown in figs. 141 and 142 is composed of a number of layers of tin foil separated by paraffin paper, each alternate layer being connected at the ends.

Fig. 143 is a diagram of a vibrator coil, CC represents the core composed of soft iron wires. PP is the primary winding and SS the secondary. There is no connection between these


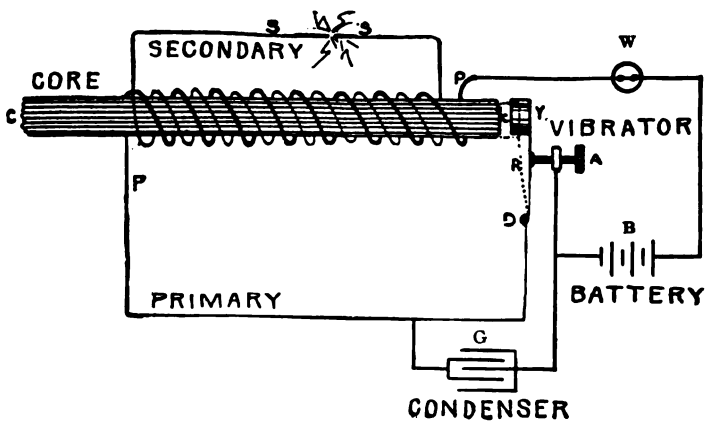


FIG. 143.—Diagram of a vibrator coil. The parts are as follows: A, contact screw; B battery; C, core; D, vibrator terminal; G, condenser; P, primary winding; S, secondary winding; W, switch; Y, vibrator. When the switch is closed, the following cycle of actions take place: 1, the primary current flows and magnetizes core; 2, magnetized core attracts the vibrator and breaks primary circuit; 3, the magnetism vanishes, including a momentary high tension current in the secondary winding; 4, magnetic attraction of the core having ceased, vibrator spring renews contact; 5, primary circuit is again completed and the cycle begins anew.

windings and they are carefully insulated. Y is the vibrator or *trembler* and D the center about which it vibrates. W is a switch used for opening and closing the primary circuit; B, a battery *of five cells.* The point of adjusting screw A rests against a *platinum point* R soldered upon the vibrator.

If the switch W be closed, the electric current generated by the battery B will flow through the primary winding. This will cause the core CC to become magnetized, and the vibrator Y will at once be drawn toward it. This will break the connection at R. The core, being made of soft iron, immediately upon the interruption of the current, will again lose its magnetism, and

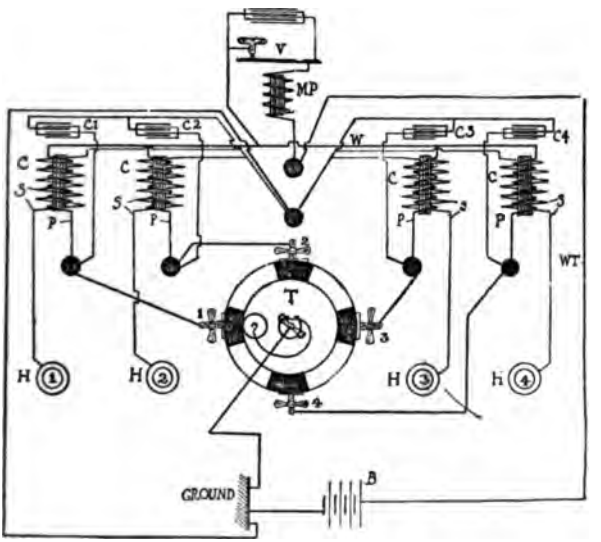

144.—Circuit diagram of a master vibrator coil. B, is the battery; C, the unit coils; C1, C2, etc., the condensers; P, the primary windings and S, the secondary windings; H1, H2, etc., the spark plugs; T, the timer; MP, the master primary; V, the vibrator; W, the common primary connection; 1, 2, etc., the stationary contacts of the timer.

the vibrator will return to its original position. This again closes the circuit, after which the operation of opening and closing it is repeated with great rapidity so long as the switch W remains closed.

The cycle of actions may be briefly stated as follows:

1. A primary current flows and magnetizes the core;

2. The magnetized core attracts the vibrator which breaks the primary circuit;

3. The core loses its magnetism and the vibrator springs back to its original position;

4. The vibrator, by returning to its original position, closes the primary circuit and the cycle begins again.

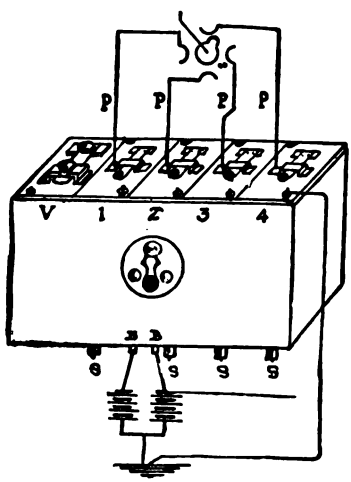


FIG. 145.—The Splitdorf master vibrator coil. As shown in the illustration the several unit coils are indicated by the figures 1, 2, 3, and 4. A fifth unit V at the left contains the master vibrator. The primary wires P connect with the timer and the secondary wires S with the plugs. B B shows the battery connections.

Magnetic Vibrators.—Many types of vibrator are used on induction coils, the most important requirement being that *the break occur with great rapidity.* In order to render the break as sudden as possible, different expedients have been resorted to, *all tending to make* the mechanism more complicated, yet having *sufficient merit in* some cases to warrant their adoption.

In the plain vibrator, the circuit is broken at the instant the spring begins to move, hence, the operation must be comparatively slow.

In order to render the break more abrupt some vibrators have two moving parts, one of which is attracted by the magnetic core of the coil and moved a certain distance before the break is effected. A vibrator of this type is shown in fig. 146 and described under the illustration.

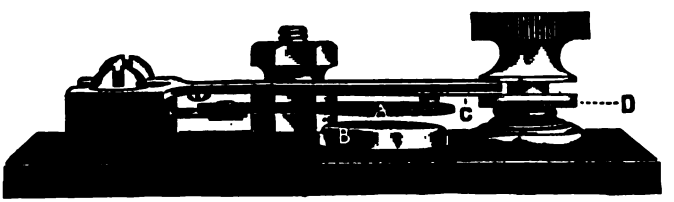


FIG. 146.—A hammer vibrator. When at rest, the upward tension of the spring, which carries the armature A, holds the platinum points in contact and causes the upper spring C, to leave shoulder of adjusting screw D, and rest against the heavy brass plate above it. When the iron core B, attracts the armature A, the downward tension on the upper spring, C, causes the latter to follow the armature down, holding the platinum point in contact, until the end of the upper spring C, strikes the lower shoulder of the adjusting screw, D, which gives it a "hammer break." The adjusting screw is held firmly in position by a bronze spiral spring under shoulder D.

Vibrator Adjustment.—When a vibrator coil is used, the quality of the spark depends largely upon the proper adjustment of the vibrator. The following general instructions for adjusting a plain vibrator should be carefully noted:

1. Remove entirely the contact adjusting screw.
2. See that the surfaces of the contact points are flat, clean and bright.
3. Adjust the vibrator spring so that the hammer or piece of *of iron on the end of the* vibrator spring stands normally *about one-sixteenth* of an inch from the end of the core

4. Adjust the contact screw until it just touches the platinum contact on the vibrator spring—be sure that it touches, but very lightly. Now start the engine; if it miss at all, tighten up, or screw in the contact screw a trifle further—just a trifle at a time, until the engine will run without missing explosions.

TABLE OF INDUCTION COIL DIMENSIONS.

Length of spark.....	$\frac{1}{8}$ inch	$\frac{1}{4}$ inch	1 inch	2 inches
Size of bobbin ends...	$2\frac{1}{8}\times1\frac{1}{4}$	$2\frac{1}{2}\times\frac{7}{16}$	$3\times\frac{3}{8}$	$4\times2\frac{1}{4}\times\frac{1}{2}$
Length of bobbin.....	4	$5\frac{1}{2}$	$6\frac{1}{2}$	$6\frac{1}{2}$
Length and diameter of core.....	$4\frac{1}{4}\times\frac{7}{16}$	$6\times\frac{5}{8}$	$6\frac{1}{2}\times\frac{3}{4}$	—
Size of base.....	$7\frac{1}{4}\times3\frac{1}{4}\times1\frac{1}{2}$	$9\times5\times2$	$14\frac{1}{2}\times6\times1\frac{3}{4}$	$12\times7\frac{1}{2}\times3\frac{1}{2}$
Size of tinfoil sheets...	4×2	$5\frac{1}{2}\times3\frac{1}{4}$	6×4	6×6
Number of tinfoil sheets.....	36	40	40	60
Size of paper sheets...	5×3	$6\frac{1}{2}\times4\frac{1}{4}$	9×5	—
Primary coil.....	No. 18	No. 18	2 layers No. 16, silk covered.	2 layers 14B. W. G. silk covered.
Secondary coil.....	$\frac{1}{4}$ lb. No. 40	1 lb. No. 40	$1\frac{1}{4}$ lbs. No. 38	$2\frac{1}{2}$ lbs. No. 36.

TABLE OF SPARKING DISTANCES IN AIR.*


Volts.	Distance. (Inches.)	Volts.	Distance. (Inches.)
5000.....	.225	60000.....	4.65
10000.....	.47	70000.....	4.85
20000.....	1.00	80000.....	7.1
30000.....	1.625	100000.....	9.6
35000.....	2.00	130000.....	12.95
45000.....	2.95	150000.....	15.00

Points Relating to Ignition Coils.—1. Most ignition induction coils or "spark coils" as they are called, have terminals *marked "battery,"* "ground," etc., and to short circuit the timer

*NOTE.—These values are correct for effective sinusoidal voltages.

r the purpose of testing the vibrator, it is only necessary to ridge with a screw driver from the "battery" binding post to he "ground" binding post.

2. In adjusting the vibrator of an ignition coil, the latter hould not require over one-half ampere of current.

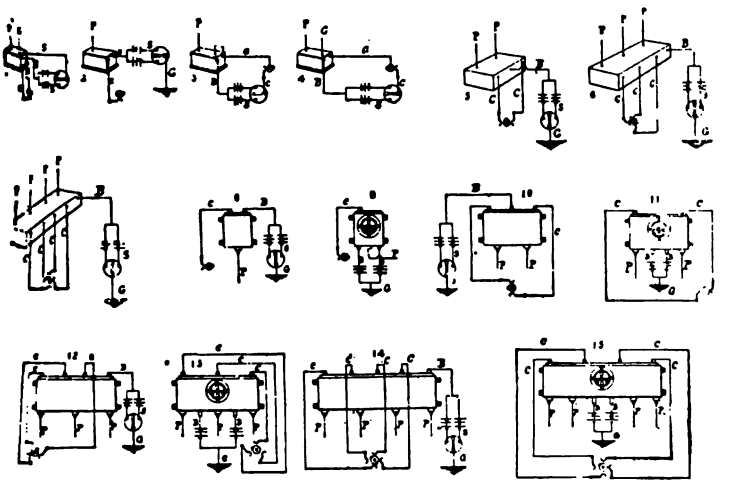

. 147 to 161.—Wiring diagrams showing connections of some standard spark coils. Key: B, to battery; C, to commutator or timer; G, to ground (engine frame); P, to plugs; S, to switch. 1, 6 terminal standard non-vibrator coil; 2, 3 terminal standard vibrator coil; 3 and 4, terminal standard vibrator coil; 5, standard double vibrator coil; 6, standard triple vibrator coil; 7, standard quadruple vibrator coil; 8, single dash coil; 9, single dash coil with switch; 10, double dash coil; 11, double dash coil with switch; 12, triple dash coil; 13, triple dash coil with switch; 14, quadruple dash coil; 15, sextuple dash coil.

3. A half turn of the adjusting screw on a coil will often in- ease the strength of the current four or five times the original nount, hence, the necessity of carefully adjusting the vibrator. hen the adjustment is not properly made it causes, 1, short e of *the battery, 2, burned* contact points, and 3, poor running *the engine.*

4. In adjusting a multi-unit coil, if any misfiring be noticed, hold down one vibrator after another until the faulty one is located, then screw in its contact screw very slightly.

5. The number of cells in the circuit should be proportioned to the design of the coil.

If the coil be described by the maker as a 4 volt coil, it should be worked by two cells of a storage battery or four dry cells. The voltage of the latter will be somewhat higher, but since their internal resistance is also greater, the current delivery will be about the same. Most coils are made to operate on from 4 to 6 volts.

6. It is a mistake to use a higher voltage than that for which the coil is designed, because it does not improve the spark and the contact points of the vibrator will be burned more rapidly, moreover, the life of the battery will be shortened.

CHAPTER XII

THE DYNAMO

The dynamo is a machine which converts mechanical energy into electrical energy by electromagnetic induction.

The word dynamo is used to designate a machine which produces *direct current* as distinguished from the *alternator* or machine generating an *alternating current.* In a broader sense, the word *generator* is used to denote any machine generating electric current by electromagnetic induction; the term therefore includes both dynamos and alternators.

Operation of a Dynamo.—A dynamo does not create electricity, but generates or produces an *induced electromotive force* which causes a current of electricity to flow through a circuit of conductors in much the same way as a force pump causes a current of water to flow in pipes. The electromotive force generated in the dynamo causes the current of electricity to pass from a lower to a higher potential in the machine, and from the higher back to the lower potential in the external circuit; that is, the dynamo generates electrical pressure which overcomes the *resistance* or opposition to the current flow in the circuit. The pump produces a *mechanical* pressure which, for instance, may be used to force water into an elevated reservoir against the back pressure due to its weight.

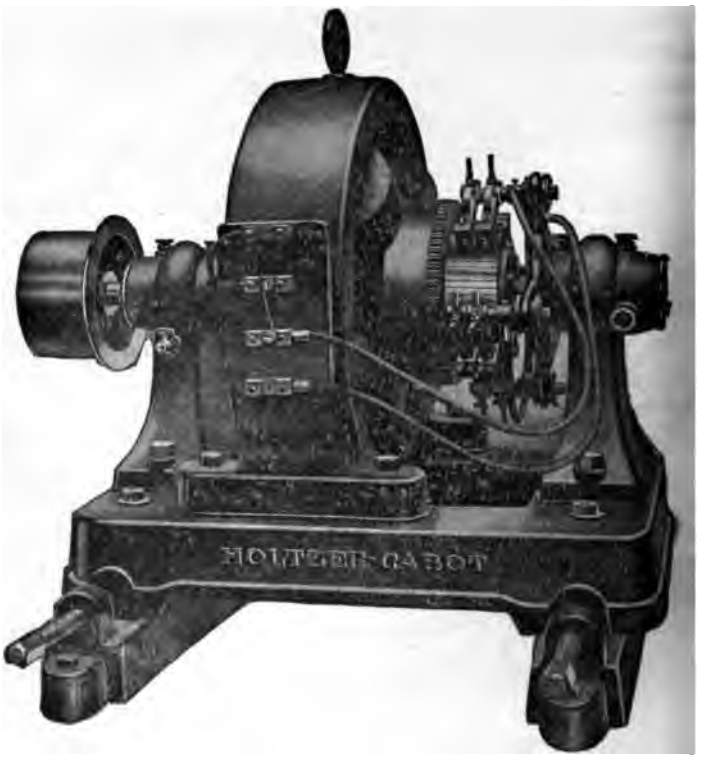


FIG. 162.—Holzer Cabot type "M" dynamo. The design of the base is such that it allows the field ring or frame to drop down, lowering the center of gravity, which gives increased stability. The pedestals are bolted directly to the base. Both front and rear pedestals are removable, so that the armature may be taken out from either end without disturbing the brushes or connections. The journals are provided with oil rings which keep the oil in continual circulation around the shaft by means of oil grooves in the journal. The pole pieces are cylindrical in shape and are fitted with shoes which retain the field coils in place and assist commutation. The field coils are former wound, the insulation being reinforced with mica. They are soaked in varnish and baked for 24 hours at 225° Fahr. The armature is wound as desired, series, shunt or compound. The armature core is of the drum type and is laminated, the discs being held by end plates locked without through bolts. The armature coils are formed of round, ribbon or bar copper, and are without joint except at the commutator; they lie in troughs of insulating material, the upper layers being insulated from the lower layers; they are retained in place by mica wedges secured by binding wires, soldered throughout their length. The commutator segments are drop forged in the smaller, and hard drawn in the larger sizes. Radial brushes are used. The efficiency of this type machine is stated by the maker at from 80% to 90% according to size.

oint to be emphasized is that *the dynamo does not create* y (nor the pump water) *but sets into motion something existing by generating sufficient pressure to overcome the on to its movement.*



General Electric 16 K W multipolar dynamo designed to operate at moderate and peeds. The outer structure of the machine consists of a magnet frame having feet casting. Adjustment is provided for moving the machine on its bed plate to tighten t. The field coils are former wound and the series windings permit of any degree pounding up to 10% by the use of suitable German silver shunts connected across ies field.

ıtial Parts of a Dynamo.—The dynamo in its simplest nsists of two principal parts:

ıe field magnet;
ıe armature



FIG. 164.—General Electric dynamo with end shield and armature removed showing construction. The core of the armature is built up of laminations keyed to spider with spaces between sections to provide ventilating ducts.

s. What is the object of the field magnet?

To provide a field of magnetic lines or lines of force to by the armature inductors as they revolve in the field.

s. What is an armature?

A collection of *inductors* mounted on a shaft and ar- l to rotate in a magnetic field with provision for collecting rrents induced in the inductors.

A simple loop or turn or wire may be considered as the simplest form armature.

es. How do armatures and field magnets differ in mos and alternators?

A characteristic feature is that in the dynamo the field et is the stationary part and the armature the rotating rhile in the alternator the reverse conditions usually obtain.

es. With respect to this feature, what names are times given to the armature and field magnet?

The *stator* and the *rotor* depending on which moves.

es. What is the real distinction between an armature field magnet?

The name field magnet is properly given to that part , whether stationary or revolving, *maintains its magnetism during operation;* the name armature is properly given to part which, whether revolving or fixed, *has its magnetism ed in a regularly repeated fashion when the machine is in m.*

onstruction of Dynamos.—In the make up of a dynamo, ctually constructed, there are five principal parts, as follows:



1. Bed plate;
2. Field magnets;
3. Armature;
4. Commutator;
5. Brushes.

CHAPTER XIII

THE DYNAMO: BASIC PRINCIPLES

A dynamo is a machine for converting mechanical energy into electrical energy, by means of electromagnetic induction, the amount of electric energy thus obtained depending upon the mechanical energy originally supplied.

The word dynamo is properly applied to a machine which generates* direct current, as distinguished from the alternator, which generates alternating current.

Ques. Define a dynamo with respect to its principle of operation.

Ans. A dynamo is *a machine for filling and emptying conducting loops with magnetic flux, and utilizing the electromotive force thus induced in them for the production of current in the external circuit.*

The fitness of this definition is apparent, having in mind the principles of electromagnetic induction.

Ques. What are the three essential parts of a dynamo?

Ans. The field magnet, armature, and commutator.

*NOTE.—It should be understood that a dynamo does not generate electricity, for if it were only the quantity of electricity that is desired, it would be of no use, as the earth may be regarded as a vast reservoir of electricity. However, electricity without pressure is incapable of doing work, hence a dynamo, or so called "generator," is necessary to create an electromotive force by electromagnetic induction in order to cause the current to flow against the resistance of the circuit and do useful work.

Ques. What is the object of the field magnet?

Ans. To provide a magnetic field, through which the conducting loops arranged on a central hub and forming the *armature* are carried, or the flux carried through them, so that they are successively filled and emptied of magnetic lines.

Ques. What is a commutator?

Ans. A device for causing the alternating currents generated in the armature to flow in the same direction in the external circuit.

Ques. Upon what does the voltage depend?

Ans. Upon the *rate* at which each conducting loop is filled and emptied of lines of force and the number of such loops with their grouping or connection.

Ques. How is the operation of a dynamo best explained?

Ans. By considering first the action of the simplest form of current generator, or elementary alternator.

Ques. Describe an elementary alternator.

Ans. It consists, as shown in fig. 165, of a single rectangular loop of wire A B C D, one end being attached to a ring F and the other to the shaft G, and arranged so as to revolve around the axis X X′, which is located midway between the two poles of the magnet. Two metallic strips or *brushes* M and S connected with the external circuit, bear on the ring F and shaft G, *respectively*, in order to "collect" the current generated in the *armature when the* machine is in operation. The long, straight, *horizontal* arrows joining the two poles of the magnet, represent

the *lines of force* which make up the magnetic field between the poles. The field is here assumed to be uniform, as indicated by the equal spacing of the arrows.

Ques. What happens when the loop is rotated?

Ans. According to the law of electromagnetic induction, when the loop is rotated around its horizontal axis in the direc-

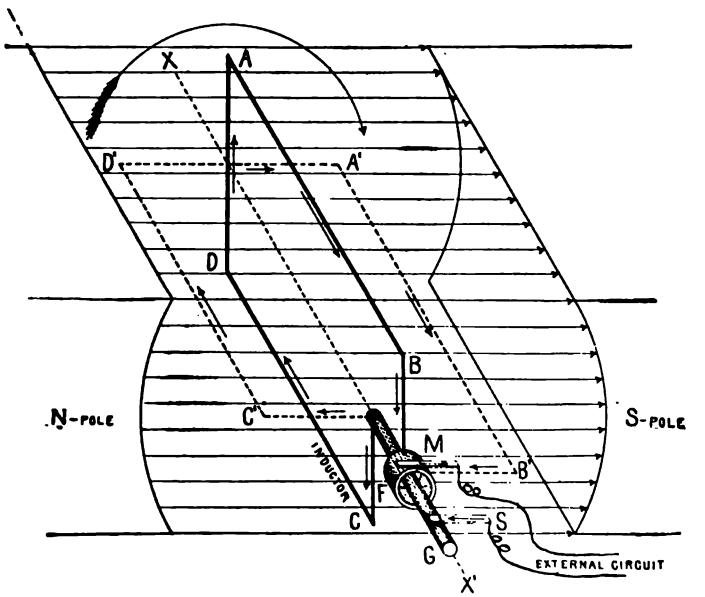


FIG. 165.—Simple elementary alternator. Its parts are a single conducting loop, A B C D, placed between the poles of a permanent magnet, and having its ends connected with a ring, F, and shaft, G, upon which bear brushes M and S, connected with the external circuit. When the loop is rotated clockwise the induced current will flow in the direction indicated by the arrows during the first half of the revolution.

tion indicated by the curved arrow, an electromotive force will be induced in the loop, the magnitude of which depends on the *rate of change of the number of lines* of force threading through, *or embraced by the loop.*

That is, if the number of lines embraced by the loop be increased from, say, 0 to 1000, or decreased from 1000 to 0, in one second, the electromotive force generated will be two times as great as if the increase or decrease were only 500 lines per second.

Ques. Upon what does the direction of the induced current depend?

Ans. Upon the direction of the lines of force and direction of rotation of the loop.

Ques. How is Fleming's rule applied to determine the direction of current?

Ans. In applying this rule, the horizontal portion of the loop, such as A B or C D (fig. 165), is to be considered as moving up or down; that is, the component of its motion at right angles to the lines of force is taken as the direction of motion. When the loop is in the position A B C D, such that its plane is vertical or perpendicular to the lines of force, the maximum number of magnetic lines thread through it, but when it is in a horizontal position, A′ B′ C′ D′, so that its plane is parallel to the lines of force, no lines pass through the loop. During the rotation from position A B C D to A′ B′ C′ D′, the number of lines passing through the loop is *reduced* from the maximum to zero, the reduction taking place with *increasing rapidity* as the loop approaches the horizontal position, the electromotive force thus induced *increasing in like proportion*. Continuing the rotation from the horizontal position A′ B′ C′ D′ to the inverted vertical position A B C D (fig. 166), the number of lines passing through the loop is increased from zero to the maximum, the increase *taking place with decreasing rapidity* as the loop approaches the *inverted* vertical position, the electromotive force thus induced *decreasing in like proportion.*

during the fourth quarter of the revolution, which causes the electromotive force to increase and decrease during these intervals.

The cycle of events just described may be summed up as follows: During the revolution of the loop:

1. From 0° to 90°, the electromotive force increases from 0 to maximum;
2. From 90° to 180°, the electromotive force decreases from maximum to zero;
3. From 180° to 270°, current reverses and the electromotive force increases from zero to maximum;
4. From 270° to 360°, the electromotive force decreases from maximum to zero.

It was stated that, during the revolution of the loop, the magnetic lines were cut "with increasing or decreasing rapidity," causing the electromotive force to rise or fall. The reason for this is illustrated in fig. 167. The loop is here shown in a horizontal position at right angles to the direction of the magnetic field; the latter, as indicated by the even spacing of the vertical arrows representing the magnetic lines, is assumed to be uniform.

The wire C D of the loop, as it rotates at *constant speed*, cuts the magnetic lines at the points 0, 1, 2, 3, etc., but the distances 0–1, 1–2, 2–3, etc., between these points, are unequal; that is, the wire C D travels farther in cutting the lines 0 and 1, than it does in cutting 1 and 2, and still less in cutting the lines 2 and 3. After cutting the line 4, which passes through the axis of revolution, the opposite conditions obtain.

If the arcs 0–1, 1–2, etc., of the dotted circle, which are intercepted by the magnetic lines and passed through by the wire, be rectified and laid down under each other, as lines 0–1, 1–2, etc., the time of passage of the wire between successive magnetic lines will vary as the length, since the speed is uniform. Thus the wire in passing from line 0 to line 1, takes much more time than in passing from 1 to 2, as indicated at the left of the figure by 0–1 and 1–2, and still less in passing from 2 to 3; that is, the rate of cutting the lines increases as C D rotates from 0 to 4 and decreases from 4 to 8.

Since similar conditions prevail with respect to A B, for its corresponding movement, it is evident that the number of lines which thread through the loop are *decreased with increasing rapidity* as the loop rotates through the *first quarter of a revolution*, and *increased with decreasing rapidity during the second quarter* of the revolution. Moreover, it must be evident that the *reverse* conditions obtain for the third and fourth quarters of the revolution.

The Sine Curve.—In the preceding paragraph it was shown that an alternating current is induced in the armature of either an alternator or dynamo; that is, the current: 1, begins with zero electromotive force, 2, rises to a maximum, 3, decreases again to zero, 4, increases to a maximum in the opposite direction, and 5, decreases to zero.

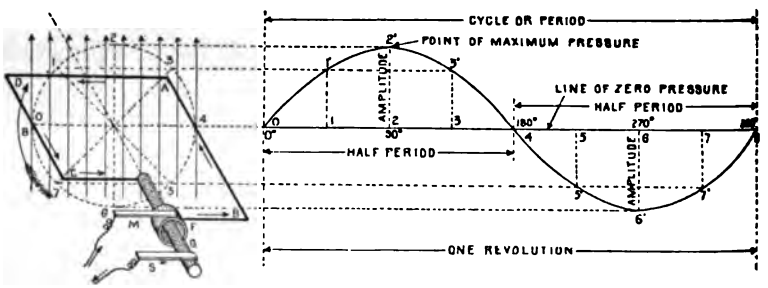


FIG. 168.—Application and construction of the sine curve. The sine curve is a wave-like curve used to represent the changes in strength and direction of an alternating current. An elementary alternator is shown at the left to illustrate the application of the sine curve to the alternating current cycle. It consists of a loop of wire A B C D, whose ends are attached to the ring F and shaft G, being arranged to revolve in a uniform magnetic field indicated by the vertical arrows which represent magnetic lines at equidistances. The alternating current induced in the loop is carried to the external circuit through the brushes M and S. Now, as the loop rotates, the induced electromotive force will vary in such a manner that its *intensity at any point of the rotation is proportional to the sine of the angle corresponding to that point*, this is represented by the wave-like curve. The mean value of the sine curve, or *average electromotive force* developed during the revolution, or *period*, is equal to $2 \div \pi$, or .637 of that of the maximum ordinate, that is, average electromotive force = .637 × *amplitude*. The sine curve lies above the horizontal axis during the first half of the revolution and below it during the second half, which indicates that the current flows in one direction for a half revolution and in the opposite direction during the remainder of the revolution.

A wave-like curve, as shown in fig. 168, is used to represent these several changes, in which the horizontal distances represent time, and the vertical distances, the varying values of the electromotive force. It is called the sine curve because a perpendicular at any point to its axis is proportional to the sine of the angle corresponding to that point.

Ques. Describe the construction and application of the sine curve.

Ans. In fig. 168, at the left, is shown an elementary armature in the horizontal position, but at right angles to the magnetic field. The dotted circle indicates the circular path described by A B or C D during the revolution of the loop. Now, as the loop rotates, the induced electromotive force will vary in such a manner that *its intensity at any point of the rotation is proportional to the sine of the angle corresponding to that point.* Hence, on the horizontal line which passes through the center of the dotted circle, take any length, as 08, and divide it into any number of parts representing fractions of a revolution, as 0°, 90°, 180°, etc. Erect perpendiculars at these points, and from the corresponding points on the dotted circle project lines parallel to 08; the intersections with the perpendiculars give points on the sine curve. Thus the loop passes through 2 at the 90° point of its revolution, hence, projecting over to the corresponding perpendicular gives 2 2′, a point whose elevation from the axis is proportional to the electromotive force at that point. In like manner other points are obtained, and the curved line through them will represent the variation in the electromotive force for all points of the revolution.

At 90°, the electromotive force is at a maximum; hence, by using a pressure scale such that the length of the perpendicular 2 2′ for 90° will measure the maximum voltage the length of the perpendicular at any other point will represent the actual pressure at that point.

The curve lies above the horizontal axis during the first half of the revolution, and below it during the second half, which indicates that the current flows in one direction for a half revolution and in the opposite direction during the remainder of the revolution.

The application of the sine curve to represent the alternating *rcle, is further illustrated* in figs. 169 to 173, which show the *sition of the armature* at each quarter of the revolution.

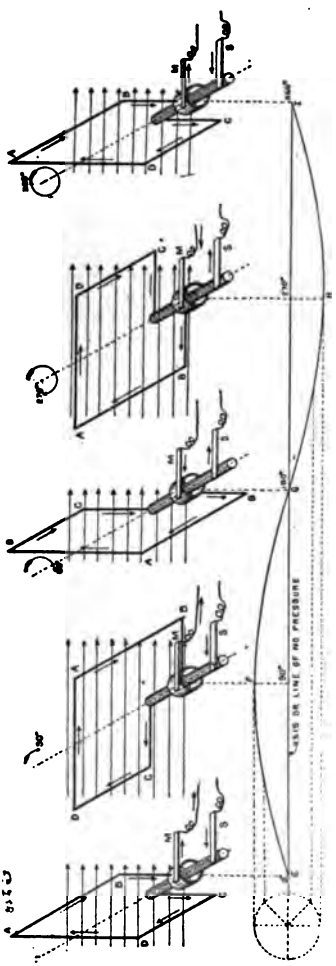


FIG. 169 to 173.—The sine curve, with view of armature for each 90° of the revolution, showing progressively the application of the sine curve to the alternating current cycle.

In fig. 179, the loop A B C
the vertical position at the b
of the revolution At this ins
electromotive force is zero, h
sine curve as shown begins
the zero point—that is, on the
line of no pressure.

As soon as the loop rotates o
vertical plane, the electromoti
rises and the current begins to
the direction indicated by the
going out to the external circuit
brush M, and returning throug
S.

Continuing the rotation, the
motive force increases in propo
the sine of the angle made by t
of the loop with the horizontal,
loop comes into the horizontal
illustrated in fig. 170. This in
indicated by the gradual rise of
curve from E to F. The loop
made one quarter of a revolut
the electromotive force reac
maximum value.

As the loop rotates past the
tal position of fig. 170, the
motive force gradually decrea
tensity, reaching the zero poin
end of the second quarter—
when the loop has turned one h
lution. This is indicated by the
fall of the curve from F to G.

When the loop turns out
vertical position shown in fig.
current reverses, because the
ment of A B and C D is reversed
instant the brush M becomes n
and S positive. This reversal of
is indicated by the curve fallin
the axis from G to I.

During the second half of the revolution, figs 171 to 173, the chang
occur are the same as in the first half, with the exception that the cu
in the reverse direction; these changes are as shown by the curve from

CHAPTER XIV

THE DYNAMO: CURRENT COMMUTATION

How the Dynamo Produces Direct Current: The Commutator.—The essential difference between an alternator and a dynamo is that the alternator delivers alternating current to the external circuit while the dynamo delivers direct current. In both machines, as before stated, alternating currents are induced in the armature, but the kind of current delivered to the external circuit depends on the manner in which the armature currents are collected.


In the case of an alternator, the method is quite simple. As previously explained, each end of the loop is connected with an insulated collector ring carried by the shaft, the current being collected by means of brushes which bear against the rings. This principle, rather than the actual construction, is shown in the preceding illustrations. Its important point, as distinguished from other methods of collecting the current, is that *each end of the loop is always in connection with the same brush.*

Ques. How is direct current obtained in a dynamo?

Ans. A form of switch called the *commutator* is placed between the armature and the external circuit and so arranged that it will reverse the connections with the external circuit at the instant of each reversal of current in the armature.

Ques. How is a commutator constructed?

Ans. It consists of a series of copper bars or segments *arranged side by side forming* a cylinder, and insulated from *each other by sheets of mica* or other insulating material.

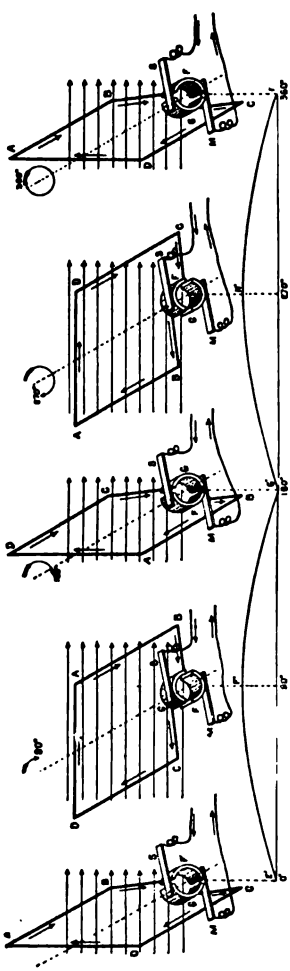

FIGS. 174 to 178.—Commutation of the current. These figures show how a dynamo transforms alternating into the so called direct current. During the first half of the revolution the current flows in the direction A B, out through segment F of the commutator and brush M, returning through brush S and segment G, figs. 174 and 175. At the beginning of the second half of the revolution, fig. 176, the current in the armature reverses and flows around the loop in the direction B A. At this instant the brushes M and S pass the gaps between the commutator segments, thus reversing contact with the segments, and causing the current in the external circuit to remain in the same direction.

Ques. Where commutator p

Ans. It is at to the shaft at th end of the armat

Ques. What ductors?


Ans. The in wires wound c armature core, which the electr rent is induced.

Ques. How inductors con to the commu

Ans. The e each conducting coil must be co with the comm segments in a order to correspo the type of win

Ques. Explain in detail how direct current is obtained in a dynamo.

Ans. It will be easily seen by the aid of a series of illustrations just how the alternating armature currents are transformed into direct current. Figs. 174 to 178 show, in several positions, a single loop of wire with its ends joined to a commutator; the latter has only two segments, one for each end of the loop. In fig. 174 the loop is shown in the vertical position, and it should be noted that the division between the two segments forming the commutator is in the same plane as the

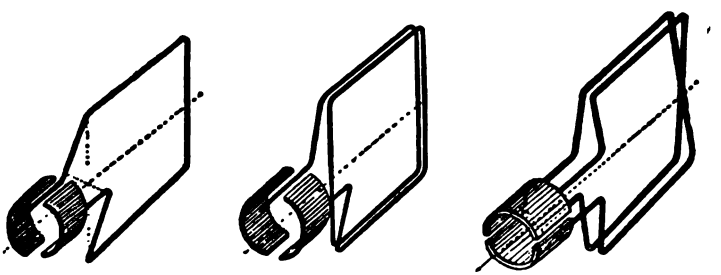

gs. 179 to 181. Elementary dynamo armatures. Fig. 1, single turn loop; fig. 2, coil of two turns *in series*; fig. 3, coil of two turns *in parallel*. In operation the amplitude or maximum pressure induced with the two turn coil, fig. 180, is double that of a single turn loop, fig. 179. In fig. 180, the pressure is double that induced in fig. 181, while the amount of current generated with series turns, fig. 180, is only half that generated with turns in parallel fig. 181.,

op. When the loop is in the vertical position, as shown in ; 174, brush M is in contact with segment F, and S with G. : the armature rotates, the current flows for one half revolution the direction A B, through segment F and out to the external cuit through brush M as shown in figs. 174 and 175, returning rough brush S and segment G. At the beginning of the ond half of the revolution, fig. 176, the current in the loop verses *and flows in the opposite* direction B A as indicated *the arrows. At this instant,* however, the brushes M and S

pass out of contact with segments F and G, and come into contact with G and F respectively; that is, M leaves F and contacts with G, while S leaves G and contacts with F. The effect of this is *to reverse the connections with the external circuit at the instant the alternation or reversal of current in the armature takes place*, thus keeping the current in the external circuit in the same direction.

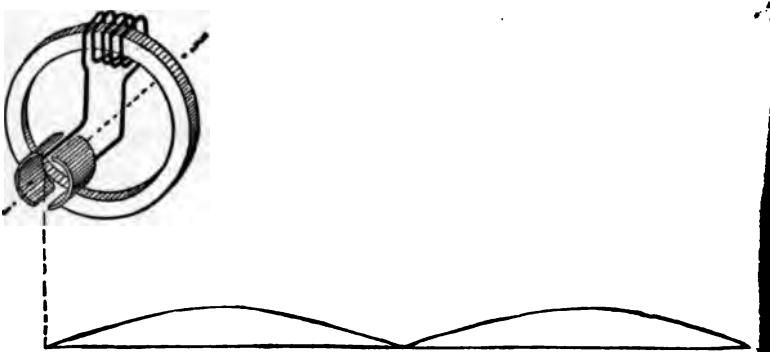


FIG. 182.—Gramme ring armature with one coil, and characteristic sine curve below. With one coil as shown, there are two pulsations of the current per revolution of the armature.

Ques. How is this indicated by the sine curve?

Ans. The sine curve, instead of falling below the axis, as in figs. 169 to 173, again rises as in the first half of the period, that is G′H′I′ is identical with E′F′G′.

Ques. Is the direct current indicated by the sine curve in figs. 174 to 178 continuous?


Ans. *No;* it is properly described as a *pulsating current or one, constant* in direction, but periodically varying in intensity *so as to progress* in a series of throbbings or pulsations instead *of with uniform* strength.

ies. What is generally understood by the word "con-ɔus" as applied to the current obtained from a ımo?

s. It is usually accepted as meaning a steady or non-ting direct current; one that has a uniform pressure and ant direction of flow as opposed to an alternating current.

ies. Is a continuous current ever obtained with a ımo?

s. *No.*

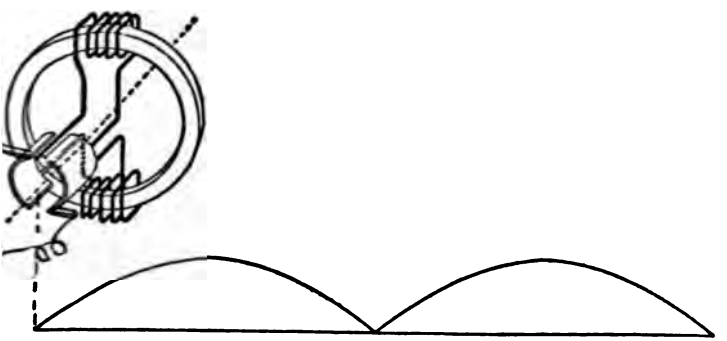

l.—Gramme ring armature with two coils placed 180° apart. This arrangement gives ible the pressure of the one coil armature, fig. 182.

It should be clearly understood at the outset that it is impossible to btain a continuous current with a dynamo. The so called continuous urrent which it is said to produce is in reality a pulsating current, but ith pulsations so minute and following each other with such rapidity hat the current is practically continuous, and as such is generally called ɔntinuous.

es. How is the so called continuous current pro-d by a dynamo?

s. In order to obtain a large number of small pulsations evolution of *the armature instead* of two large pulsations,

as with the single loop armature, the latter must be repla by one having a great number of loops properly connec to commutator segments and so arranged that the success loops begin the cycle progressively.

The difficulties encountered in connecting up numer loops were overcome by Gramme, who, in 1871 invented "ring" armature. His method consists in winding a ring w a continuous coil of wire, connections being made at suita intervals with the commutator.

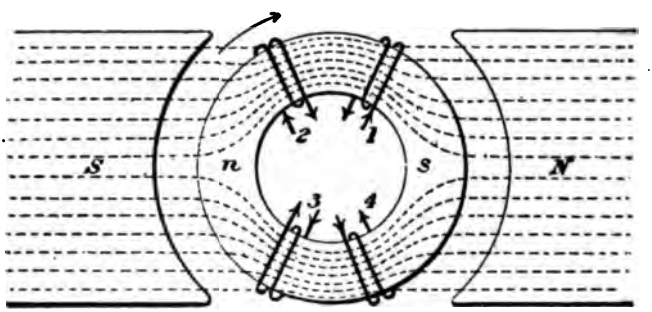


FIG. 184.—Four separate coils wound on ring to illustrate the action of a Gramme ring a ture. If the ring be rotated the electromotive forces induced in adjacent coils wi equal and tend to produce currents in opposite directions; hence, if the inner end joined, the junctions would be at a higher potential (+ or −) than the loose ends. proper connections current may be collected at the junctions.

In order to understand the action of such an arrangeme it will be well to first consider four separate coils wound o ring as shown in fig. 184. These coils are all similar, but the moment occupy different magnetic positions on the ri The rotation being clockwise, 1 is about to enter the fi adjacent to the north pole, while 2 is emerging from the fi in the region of the south pole. Again, 3 is approach *the south* pole and 4 receding from the north pole.

Ques. Describe in detail the action of the four coils wound around the ring as in fig. 184.

Ans. According to the laws of electromagnetic induction, pressures are set up at the ends of the coils such as tend to produce currents in the directions indicated by the arrows. Now, assuming the electromotive forces in coils 1 and 2 to be equal, if the adjacent ends be joined, no flow of current will take place, but the junction will be at a higher pressure

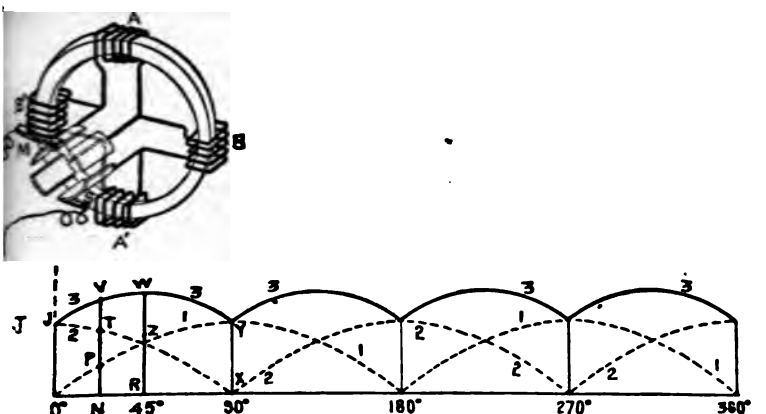


Fig. 185.—Gramme ring armature with four coils. The electromotive force induced in coils A, A' reaches the zero point at the instant that of coils B, B' is at a maximum; hence, the curve No. 1, beginning at zero, and No. 2, at the maximum, show the pressure changes for A, A' and B, B', respectively. The summation of these curves gives *the resultant curve* No. 3, showing changes in pressure of current delivered to the external circuit.

than the loose ends of the coils and if a wire be attached to this junction, and the necessary circuits completed, a current will flow along the wire outward from the junction. Similarly, the adjacent ends of coils 3 and 4 be joined, there will be no flow of current, but the junction will be at a lower pressure than the loose ends, and if a wire be attached to the junction and the necessary circuits completed, current will flow from the junction around *the coils.*

Ques. What may be said with respect to the four-coil Gramme ring armature shown in fig. 185?

Ans. According to the laws of electromagnetic induction, with the north pole of the field at the left and clockwise rotation, the induced currents flow *upward* on both sides of the ring, hence *the electromotive forces oppose each other at only two of the junctions, namely: at the one connected to brush M where the pressures*

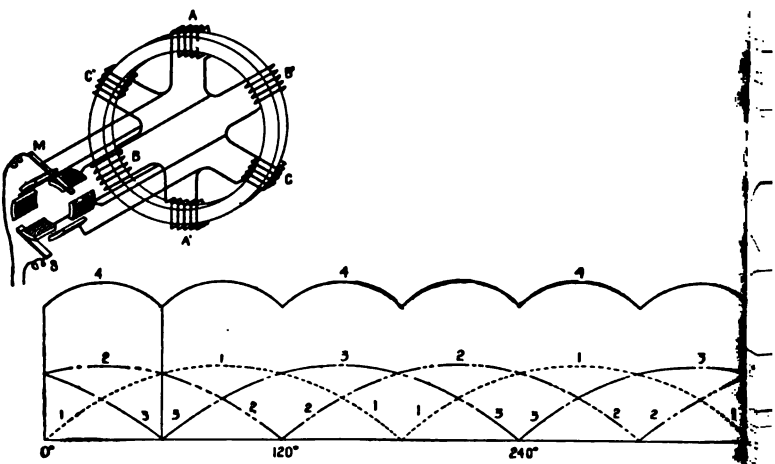


FIG. 186.—Gramme ring armature with six coils. The sine curves 1, 2 and 3, represent conditions due to coils AA', BB' and CC', respectively, and 4, the resultant pulsations.

either side are both directed toward the junction and the other the junction connected to brush S, at which the pressures are both directed from the junction.

It is evident, then, that the pressure at M is higher than at S; that M is positive and S negative; consequently, the current flows from to the external circuit and returns through S.

Ques. In what other way may the four coils of the armature in fig. 185 be regarded?

Ans. They may be considered as two pairs A A′ and B B′, the action of either pair being identical with the two coil armature shown in fig. 183; this, in turn, produces the same effect as the one coil armature of fig. 182, with the exception that the amplitude of the current generated with two coils is twice as great as that with one coil of the same number of turns.

Again considering the action of the four ring coil shown in fig. 185, and starting at the beginning of the revolution, the variation of electromotive force induced in coils AA′ is indicated

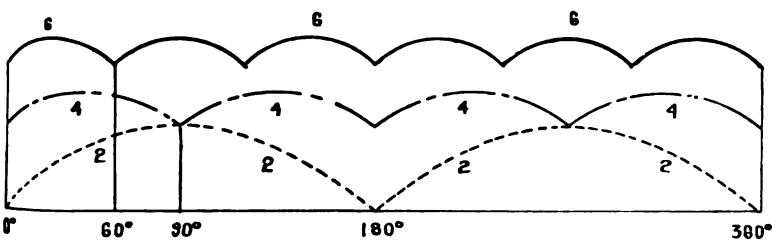


FIG. 187.—The resultant curves of figs. 183, 185 and 186 are here shown for comparison to illustrate the approach to uniform pressure as the number of coils are increased. It should be noted that the number of pulsations per cycle depends on the number of coils, and that as the pulsations increase in number, the variation in pressure decreases.

by the dotted sine curve 1, and of BB′ by dotted curve 2. It will be seen that 1 begins at the axis or line of no pressure, and 2 at maximum pressure.

The two curves overlap each other, and in order to determine the effect of this it is necessary to trace the resultant curve, 3. This is easily done, as the resultant electromotive force induced at any point in the revolution of the armature is equal to the sum of the pressures induced in *AA′ and BB′*. Thus, at the beginning of the revolution *the pressure induced in AA′* is at zero point, and in BB′ at its maximum *J, hence, the resultant curve* begins at the point J. Again, for any point

in the revolution, as N, the height of the resultant curve is equal N P+N T=N V. For 45° or ⅛ revolution, the resultant curve reach its amplitude, which is equal to 2×R Z=R W, and at 90° it again reach its minimum, X Y.

Ques. State the conditions upon which the steadine of the current depends.

Ans. *It depends on the number of coils and the manner which they are connected.*

Comparing curves 1 and 3, in fig. 185, it will be noted that with coils the variation of pressure or amplitude of the pulsations is less half that obtained with two; moreover, with four coils the numb pulsations per cycle is doubled.

In order to further observe the approach to continuous current tained by increasing the number of coils, the effect of a six coil arm is shown in fig. 186, the resultant curve being obtained in the same ma as just explained. For comparison, the curves for the three cases of four, and six coils are reproduced under each other in fig. 187.

As the number of coils is further increased, the amplitude of pulsations decreases so that the resultant curve approaches nearer form of a straight line.

In the actual dynamo there are a great many coils, hence the ampli of the pulsations is exceedingly small; accordingly, it is customar speak of the current as "continuous," although as previously menti such is not the case.



CHAPTER XV

CLASSES OF DYNAMO

. order to adapt the dynamo to the varied conditions of ice, its design is modified in numerous ways, giving rise he different "types." These may be classified with respect

. Fie'd magnets;
. Field excitation;
. Field winding.

he first division relates to the number of magnetic poles, as polar, bipolar, and multipolar dynamos; also interpolar amos. Under the second division are included the following:

. *Self-exciting machines* of which the magneto is the sim- t. Its magnetic field is obtained from permanent magnets, ce the electromotive force generated is comparatively small. more important type of self-exciting machine is provided ı electro-magnets in which the field of force is "built up" ı the residual magnetism of the soft iron or steel cores of field magnets of the dynamo itself. Nearly all commercial es of dynamo are of this class.

Separately excited machines in which the field magnets magnetized when the machine is in operation by current olied from a separate source such as a battery or magneto erator.

With respect to the third division, based on the field winding, dynamos are classed as:

1. Series wound;
2. Shunt wound;
3. Compound wound.

In addition to the foregoing there are further distinctions with respect to the mechanical features. Most dynamos have a revolving armature and stationary field magnets; however, in some cases, both the armature and field magnets are stationary, a revolving iron inductor being provided to intercept the magnetic lines intermittently which produces the same effect as is obtained in cutting the magnetic lines by a revolving armature.

Ques. What may be said of bipolar and multipolar dynamos?

Ans. Dynamos with bipolar field magnets were universally used prior to 1890, but since that time machines of this type are only made in very small sizes; the multipolar dynamo is the type now in general use.

Ques. State some of the features of the multipolar dynamo.


Ans. In this class of machine, the armature and field magnets are surrounded by a circular frame, or *ring yoke* to which the field magnets are attached. This ring arrangement has the advantages of strength, simplicity, symmetrical appearance, and minimum magnetic leakage, since the pole pieces have the least possible surface and the path of the magnetic flux is shorter.

Ques. What important advantage is gained by the use of multi-pole field magnets?

Ans. Commercial voltages are obtained at moderate armature speed.

The difficulty experienced with bipolar machines is that, with a dynamo of large output, the speed at which its armature would have to rotate to generate commercial voltages would be excessive.

It is evident that with two or more magnetic fields, secured by increasing the number of poles, the armature inductors revolving between them cut more magnetic lines in one revolution than with a single field,

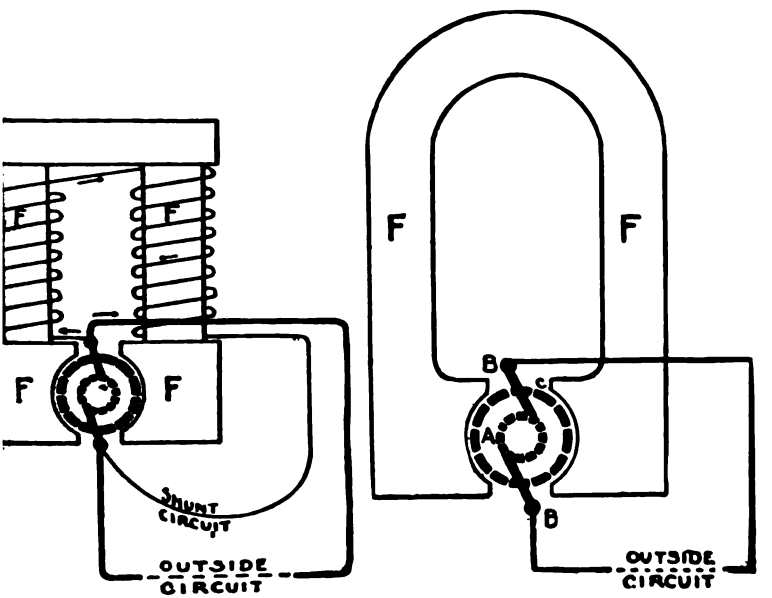

Figs 188 and 189.—Circuit diagrams to illustrate the difference between a dynamo and a magneto. The former has its field magnets F F magnetized by means of a small current flowing around a shunt circuit. In a magneto the field magnets are permanently magnetised. The strength of the magnet field of a magneto is constant while that of a dynamo varies with the output.

hence, a given voltage is obtained with less speed of the armature than in the bipolar machine.

For instance, if a bipolar dynamo be required to run at say 900 revolutions per minute to generate 125 volts, a four pole machine of equal output will *require only 450* revolutions, and one of eight poles *only 225 revolutions per minute.*

Ques. What is a self-exciting dynamo?

Ans. A machine in which the initial excitation of the field is due to the residual magnetism retained by the cores.

Ques. What may be said of the field due to this residual magnetism?

Ans. It presents a very weak field, and the voltage that could be generated by the armature revolving in such a field would be only about two to ten volts.

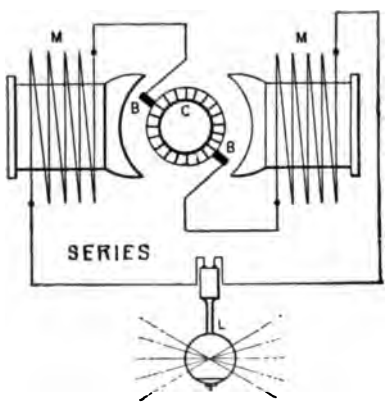


FIG. 190.—Series wound dynamo, used for series arc lighting, and as a booster for increasing the pressure on a feeder carrying current furnished by some other generator. The coils of the field magnet are in series with those of the armature and external circuit, and consists of a few turns of heavy wire. The characteristic of the series dynamo is to furnish current with increasing voltage as the load increases. If overloaded, the voltage will drop.

Ques. How then can commercial voltages such as 100 or more volts be obtained with a self-exciting dynamo?

Ans. Part or all of the current induced in the armature *is passed through* the windings of the field magnets, thus *strengthening* the field. The voltage, therefore, will "build up," *increasing until* the maximum has been reached.

The maximum voltage will depend upon the capacity of the field magnets as determined by the construction, and upon the strength of current used to excite them.

Ques. How long does the process of "building up" require?

Ans. The time required to fully excite the field magnets is from ten to twenty seconds, the rise in field strength being indicated on the voltmeter or by the gradual increase in the brilliancy of the *pilot lamp*.

Ques. Name three important classes of dynamo.

Ans. Series wound, shunt wound, and compound wound.

Ques. Describe the winding of a series dynamo.

Ans. In this machine, the field magnets are wound with a few turns of thick wire joined in series with the armature brushes as shown in fig. 190.

Ques. What is the effect of this arrangement?

Ans. All of the current generated by the machine passes through the coils of the field magnets to the external circuit. The current in passing through the field magnets, energizes them and strengthens the weak field due to the residual magnetism of the magnet cores, resulting in the gradual building up of the field.

Ques. For what service is the series dynamo adapted?

Ans. It may be used for series arc lighting, series incandescent lighting, and as a *booster* for increasing the pressure on a feeder carrying current furnished by some other generator.

Ques. What is the effect of the series winding in the operation of the machine?

Ans. Its characteristic is to furnish current at an increased voltage as the load increases. If sufficient current be drawn to overload the machine, the voltage will drop.

Since the armature coils, field magnets and external cir in series, any increase in the resistance of the external circu the power of the machine to supply current, because it dimir current in the coils of the field magnets and therefore dimin effective magnetism. Again, a decrease in the resistance of the circuit will increase the voltage because more current will flow the field magnets. Accordingly, when the external circuit h in series (as is common in an arc light circuit) the switching additional lamp both adds to the resistance of the circuit and d the power of the machine to supply current. When the lam parallel, the switching on of additional lamps not only dimir resistance of the circuit, but causes the field magnets to b excited by the increased current, so that the greater the number put on, the greater becomes the risk of inducing too much curr

The series dynamo has also the disadvantage of not starti until a certain speed has been attained, or unless the resistan external circuit be below a certain limit.

Regulation of Series Dynamos.—The series dyr ordinarily used for operating arc lamps connected in The current generally consumed is about 10 amperes, is necessary that it should remain at this strength t the lights burning steadily. If it increase, the ligh be too bright, and if it decrease, they will be too dim or

With all the lamps connected in series it is evide the resistance of the circuit will vary widely as they are on or off, the resistance increasing as the lamps are tur and decreasing as they are turned off. It is necessary, th that some means of regulation be provided to enable the to increase or decrease the voltage in proportion to tl There are several methods of regulation, as by:

1. Variation of armature speed;
2. Variation of position of brushes;
3. Variation of field strength.

Whatever method be used the necessary regulation be accomplished by automatic devices, as it would *practical to station* a man in constant attendance to

the voltage every time one or more lamps were thrown on or off.

Ques. When is the first method of regulation used?

Ans. It is only used in special cases, as for constant load; if the voltage be not just right to give the required current, it may be adjusted by changing the speed of the engine.

Ques. What may be said of the second method?

Ans. In both the "ring" and "drum" types of armature, rotating in a bipolar field, there are two points situated at opposite extremities of a diameter of the commutator, at one of which the potential is a maximum and at the other a minimum, and it is at these points that the brushes must be placed in order to obtain the greatest difference of pressure, the difference being less at other points. Hence, by rocking the brushes around the commutator the pressure at the terminals of the machine may be varied and regulated as required.

Ques. What difficulty is experienced in rocking the brushes to regulate the voltage?

Ans. Sparking takes place at the brushes when they are moved any considerable distance from the neutral position.

Special dynamos have been designed to overcome this objectionable feature, still this method of regulation is not extensively used.

Ques. What may be said of the third method of regulation?

Ans. The third method, that of variation of field strength, is the one in general use.

Ques. How is the field strength varied?

Ans. *This may be done by the two path method, or by the variable field coil method.*

Ques. Describe the two path method of field regulation.

Ans. An adjustable resistance or *rheostat* is connected in parallel with the field winding as shown in fig. 191. This shunts more or less of the current from the field winding according to the amount of resistance made active by the lever, *L*.

Thus, if the current in the armature and main circuit be 10 amperes and the resistance of the field winding 10 ohms, a resistance of 40 ohms in parallel with the winding would cause the current to split in the ratio of 40 to 10, or 4 to 1; 2 amperes would pass through the resistance and 8 amperes through the field.

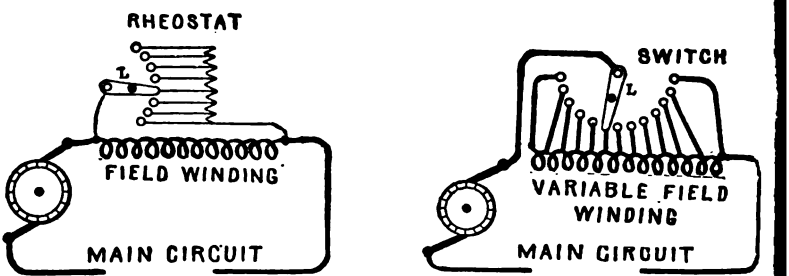


FIG. 191.—The two path method of regulating a series dynamo. The ends of the series winding are connected by a shunt containing a rheostat. The current induced in the armature divides and flows through the two paths thus offered, the amount flowing through the shunt being regulated by the rheostat. In this way the field strength is easily regulated.

FIG. 192.—Regulation of series dynamo by variable field. A multipoint switch is provided with connections to the field winding at various sections, thus permitting more or less of the field winding to be cut out to regulate its strength.

Ques. Describe the variable field coil method of field regulation.

Ans. This consists in dividing the field winding into a number of sections and throwing the sections in and out of circuit as shown in fig. 192.

Since the strength of any magnet depends on the number of ampere-turns in its field winding, reducing or increasing the number of turns will respectively reduce or increase the field strength, the current being kept constant.

Ques. What is the objection to this method?

Ans. This arrangement is undesirable for magnets of large size, because of the tendency to flashing at the contacts of the regulating switch.

The Shunt Dynamo.—The shunt wound dynamo differs from the series wound machine, in that an independent circuit is used for exciting its field magnet. This circuit is composed of a large number of turns of fine insulated copper wire, which

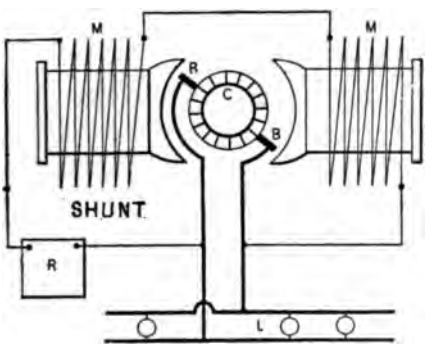


FIG. 193.—Shunt wound dynamo for parallel circuit incandescent lighting, and for mill and factory power. The coils of the field magnet form a shunt to the main circuit; they consist of many turns of fine wire and consequently absorb only a small fraction of the current induced in the armature. The characteristic of the shunt dynamo is that it gives practically constant voltage for all loads within its range. If overloaded the pressure will drop and the machine cease to generate current.

is wound round the field magnets and connected to the brushes, so as to form a shunt or "by pass" to the brushes and external circuit, as shown in fig. 193. Two paths are thus presented to the current as it leaves the armature, between which it divides in the inverse ratio of the resistance. One part of the current flows *through the magnetizing coils, and the other portion through the external circuit.*

In all well designed shunt dynamos, the resistance of t shunt circuit is always very great, as compared with the resi ance of the armature and external circuit, the strength of t current flowing in the shunt coils being very small even in t largest machines.

Ques. For what service is the shunt dynamo adapte

Ans. It is used for constant voltage circuits, as in incand cent lighting.

Ques. In the operation of a shunt dynamo what i its characteristic feature?

Ans. The voltage at the dynamo remains practically u changed, and the current varies according to the load.

Ques. Does the voltage remain constant for all load

Ans. There is a certain maximum load current that t shunt dynamo is capable of supplying at constant volta beyond this, the voltage will decrease, the machine fina demagnetizing itself, and ceasing to generate current.

Ques. Why does the voltage not remain constant f a'l loads?


Ans. Because there is a drop in the voltage in forcing t current through the armature windings which increases wi the load.

Ques. What is the usual method of regulation f shunt dynamos?

Ans. The method of varying the current through the coils by means of a rheostat inserted in series with the *winding* as shown in fig. 194.

Moving the lever L of the rheostat to the right increases the resistance in series with the field winding, and this reduces the amount of current in that winding, thus reducing the strength of the magnet and consequently the voltage at the brushes. The contrary movement of the lever, by cutting out the resistance, produces the opposite effect.

he **Compound Dynamo.**—This class of generator is ;ned to automatically give a better regulation of voltage ›onstant pressure circuits than is possible with a shunt ıine. It possesses the characteristics of both the series shunt machines, of which it is in fact a combination.

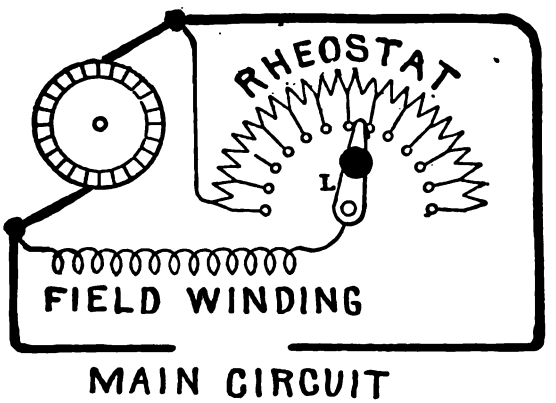

4.—Regulation of shunt dynamo by method of varying the field strength A rhıostat placed in series with the field coils, and by varying the resistance, more or less current ll flow through the coils, thus regulating the field strength.

ıe field magnets of the compound dynamo, as shown in 95, are wound with two sets of coils, one set being connected ries, and the other set in parallel, with the armature and nal circuit. The purpose of the series winding is to strengthhe magnets by the current supplied from the armature he circuit, and thus automatically sustain the pressure. ıe series *winding were not* present, the pressure at the

terminals would fall as the load increased. This fall of pressure is counteracted by the excitation of the series winding, which increases with the load and causes the pressure to rise. The number of turns and relative current strengths of the series and shunt windings are so adjusted that the pressure at the terminals is maintained practically constant under varying loads.

With respect to the ratio between the number of turns of the two field windings, the dynamo is spoken of as:

1 Compound;
2. Over compounded.

Ques. What is the difference between a compound and an over compounded dynamo?

Ans. In the first instance, there are just enough turns in the series winding to maintain the voltage constant at the brushes for variable load. If a greater number of turns be used in the series winding than is required for constant voltage at the brushes for all loads, the voltage will rise as the load is increased, and thus make up for the loss or drop in the transmission lines, so that a constant voltage will be maintained at some distant point from the generator. The machine is then said to be *over compounded.*

Ques. For what service is over compounding desirable?

Ans. For incandescent lighting where there is considerable length of transmission lines.

Ques. What is the usual degree of over compounding?

Ans. Generally for a rise of voltage of from five to ten *per cent.*

In construction, the field coils are wound with a greater number of turns than actually required, the machine being accurately adjusted by a running load test after completion.

Ques. How is the degree of over compounding varied?

Ans. A rheostat is placed in shunt with the series winding so that the current passing through the winding may be regulated to control the voltage of the machine.

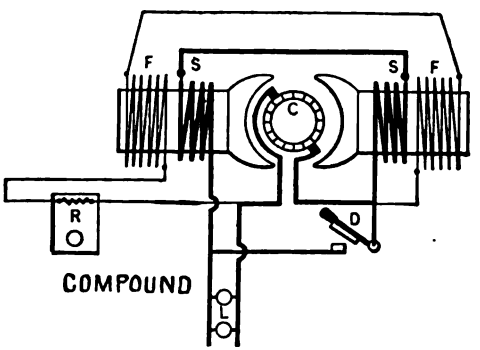


Fig. 195.—Compound wound dynamo, used when better automatic regulation of voltage on constant pressure circuits is desired than is possible with the shunt machine. The compound dynamo is a combination of the series and shunt types, that is, the field magnet is excited by both series and shunt windings. With a proper selection of the number of turns in the series coils, the voltage may be kept automatically constant for wide fluctuations in the load. When the machine is *over compounded* its characteristic is to slightly increase the voltage with increase of load, a desirable feature for long transmission lines in order to compensate for the line drop.

Ques. How are the ends of the shunt winding of a compound dynamo connected?

Ans. There are two methods of connection, being known as the short shunt and the long shunt.

Ques. Describe the short shunt.


Ans. In the short shunt, the ends of the shunt winding are connected *directly to the brushes* as in fig. 196.

Ques. Describe the long shunt.

Ans. In the long shunt, one end of the shunt winding connected to one of the brushes and the other end to the termin connecting the series winding with the external circuit as i fig. 197.

Ques. Which is the more desirable?

Ans. Theoretically, the long shunt is preferable as beir the more efficient; however, in practice, the gain is not ver appreciable and the short shunt is generally used.

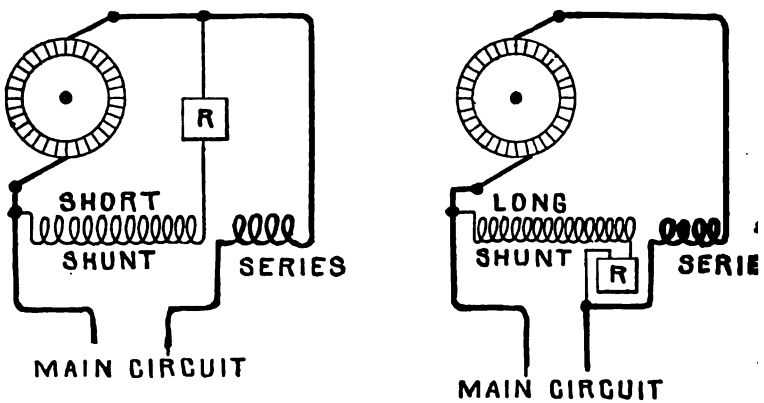

FIGS. 196 and 197.—Short and long shunt types of compound wound dynamos. The d tinction between the two is that the ends of the short shunt connect direct with the bru terminals, while in the long shunt type, fig. 197, one end of the shunt connects with a brush terminal and the other with the terminal connecting the series winding with t external circuit. R is the shunt field rheostat for regulating the current through the shun

Ques. What may be said regarding the voltage i short, and long shunt machines?

Ans. In a short shunt machine, the shunt winding is sul jected to a higher voltage than with a long shunt. The pressu *applied through* a shunt winding with a long shunt, for

articular load, is equal to the voltage at the brushes plus he drop in the series winding.

Ques. For what other service besides incandescent ighting are compound dynamos adapted?

Ans. They are employed in electric railway power stations here the load is very fluctuating.

Ques. What is the effect of a short circuit on a compound dynamo?

Ans. It overloads the machine, since the excessive current lowing through the series field tends to keep the voltage at s normal value.

Unless the line be automatically opened under such a condition either by a fuse or circuit breaker, the machine and its driving engine may be damaged. To avoid this danger fuses or automatic circuit breakers are employed.

Ques. Mention another service for which the compound dynamo is used.

Ans. In some isolated plants, as small country residences here it is frequently necessary to have a dynamo capable of harging a storage battery during the day, and of furnishing urrent for lighting during a certain portion of the evening.

Under such conditions the compound machine with slight modification is used, the ordinary shunt dynamo not being capable of maintaining the necessary consistency of voltage, without attention to the shunt regulator in driving the lamps direct, the ordinary compound dynamo on the other hand, being unsatisfactory for charging storage batteries.

Ques. How is the compound dynamo modified to adapt t to the dual service of lighting and battery charging?

Ans. It is furnished with *alternative compound winding*, a which the series winding is provided with a switch, which

may be fixed either upon the machine itself or upon the swit board. This switch permits the series coils to be either sh circuited in part or cut out of the circuit entirely while machine is charging the storage battery, being again cut i circuit when the machine is required to furnish current the lamps.

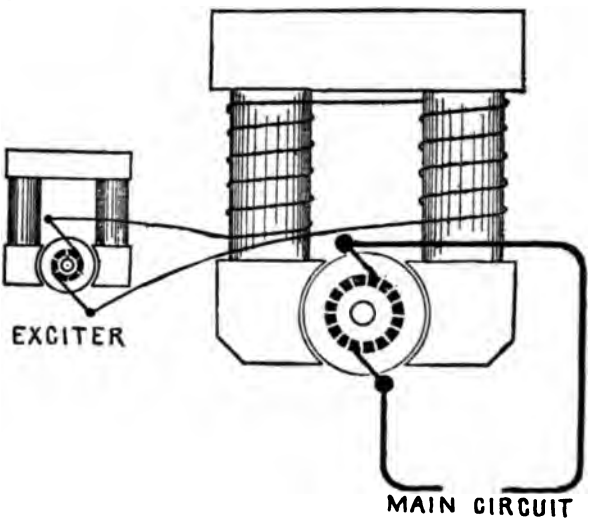


FIG. 198.—Separately excited dynamo. Current for field excitation is supplied by a se and smaller generator.

Separately Excited Dynamos.—In this class of mach the current required to excite the field magnets is obtai from some independent external source. Though used Faraday, the separately excited dynamo did not come i favor until, in 1866, Wilde employed a small auxiliary magn machine to furnish currents to excite the field magnets o larger dynamo.

A separately excited dynamo is shown in fig. 198. T

method of field excitation is seldom used except for alternators; it is, however, to be found occasionally in street railway power houses, the shunt fields of all the dynamos being separately excited by one dynamo.

In common with the magneto, the separately excited machine possesses the property that, with the exception of armature reactions, the magnetism in its field and therefore the total voltage of the machine is independent of variations in the load.

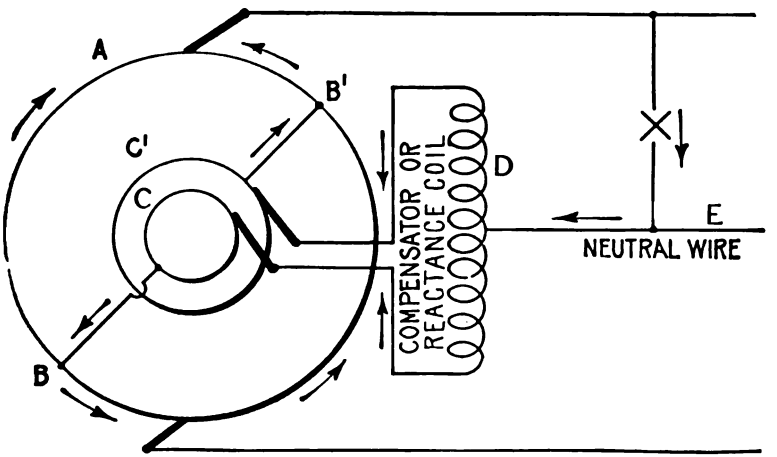


FIG. 199.—Diagram showing principle of Dobrowolski three wire dynamo. This type of machine is shown in more detail in fig. 795 on page 708.

Dobrowolski Three Wire Dynamo.—This type of dynamo was designed to operate a three wire system of distribution without a balancer. The armature is provided with insulated slip rings connected to suitable points in the armature winding and (by means of brushes) with choking coils meeting at a common point, to which the neutral wire of the system is connected, the main terminals being connected with the outside wires.

The machine is capable of feeding unbalanced loads without serious disturbance of the pressure on either side of the system.

The principle of the Dobrowolski three wire dynamo is illustrated in fig. 199. The armature A is tapped at two points, B and B′, and connected to slip rings C C′. A compensator or reactance coil D, between the two halves of which there is minimum magnetic leakage, is connected to C and C′ by brushes, and has its middle point tapped and connected to the neutral wire E.



FIG. 200.—Armature of Westinghouse three wire dynamo. Collector rings are mounted at one end of the armature as shown, and the leads to them with the armature winding are similar to those employed on the alternating current side of a rotary converter armature. The connections from the armature to collector rings may be either single phase, two phase, or three phase. The two phase connection with four collector rings and two balance coils is used in the Westinghouse three wire dynamo.

It is clear, from the symmetry of the arrangement, that the center point of the coil must always be approximately midway in pressure between that of the brushes, and hence any unbalanced current will return into the armature, dividing equally between the two halves of the coil.

The arrangement forms a cheap and effective substitute for a balancer set, but lacks the adjustable properties of the latter.

There are various modifications of the arrangement. Thus more than two slip rings may be used. The compensator windings, however, should always be arranged so that the magnetizing effect of the neutral *current is self-neutralized* in the windings, as otherwise saturation occurs *causing a very* heavy alternating magnetizing component.

CHAPTER XVI

FIELD MAGNETS

The object of the field magnet is to produce an intense magnetic field within which the armature revolves. It is constructed in various forms, due in a large measure to considerations of economy, and also to the special conditions under which the machine is required to work.

Electromagnets are generally used in place of permanent magnets on account of: 1, the greater magnetic effect obtained, and 2, the ability to regulate the strength of the magnetic field by suitably adjusting the strength of the magnetizing current flowing through the magnet coils.

The field magnet, in addition to furnishing the magnetic field, has to do duty as a framework which often involves considerations other than those respecting maximum economy.

The Make Up of a Field Magnet.—In construction, the electromagnet, used for creating a field in which the armature of a dynamo revolves, consists of four parts:

1. Yoke;
2. Cores;
3. Pole pieces;
4. Coils.

These are shown assembled in figs. 201 to 204.

Ques. What is the object of the yoke?

Ans. The yoke serves to connect the two "limbs," th is, the cores and po e pieces, and thus provide a continuo metall'c circuit up to the faces of the pole pieces.

Ques. How is the yoke constructed?

Ans. It usually forms the frame of the dynamo as shov in figs. 205 and 206.

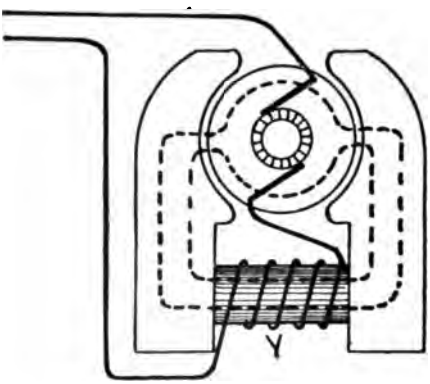


FIG. 201.—Salient pole, bipolar field magnet with single coil wound around the yoke.

Ques. What may be said of the cores?

Ans. The cores, which are usually of circular form, carr the coils of insulated wire used to excite the magnets.

Classes of Field Magnet.—Although numerous forms c field magnet have been devised, they can be classed into tw groups according to the type of pole, as:

1. *Salient pole;*
2. *Consequent* pole.

The distinction between these two types of pole is shown in figs. 201 to 203. By inspection of the figures, it will be seen that the term *salient* applies to poles produced when the pole pieces form the *ends* of the magnet, as distinguished from *consequent* poles, or those formed by coils wound on a continuous metal ring or equivalent.

In the salient pole bipolar magnet, the winding may be either upon the limbs, M M fig. 202, or upon the yoke, Y as shown in fig. 201. The magnetic circuit of salient and consequent poles is indicated in the figures by the dotted lines.


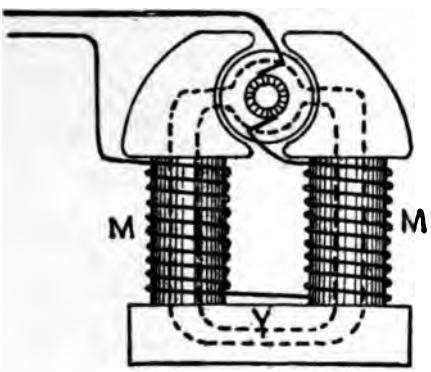


Fig. 202.—Salient pole, bipolar field magnet with two coils wound around the cores.

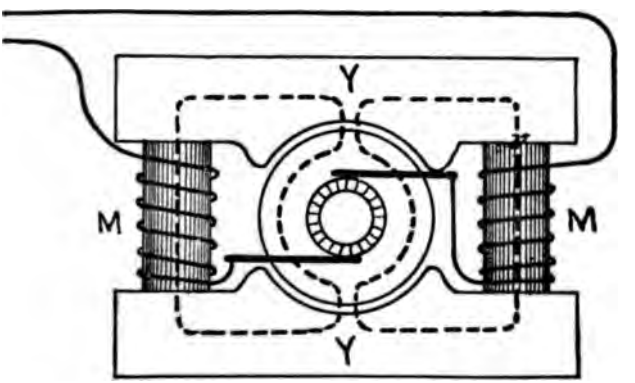

203.—Consequent pole bipolar field magnet with two coils on the cores. This is known as the "Manchester" type in which the cores are connected at the ends by two yokes—so named from its *original place of manufacture* at Manchester, England.

Multi-Polar Field Magnets.—In the multi-polar machine, the subdivision of the magnetic flux reduces the amount of material of both magnet and armature. Moreover, there is less heating on account of the greater capability of dissipating the heat, offered by the increased area of surface per unit of volume in each magnet pole and winding.

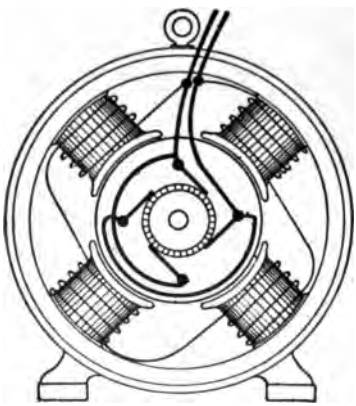


FIG. 204.—Modern dynamo with four consequent pole field magnets. In this construction the ring shaped yoke also serves as a frame; the circular form of yoke gives the least chance for magnetic leakage.

There may be four, six, eight, or more poles, arranged in alternate order around the armature. Fig. 204 shows a four pole field magnet having a common yoke or iron ring, with four pole pieces projecting inwardly, and over which the exciting coils are slipped.

In the larger machines the yoke is made in two parts bolted together as shown in fig. 206, so that the upper portion may be lifted off for examination of the armature.

Ques. Can the number of poles in a multi-polar machine be advantageously increased to 16, 32, or more?


Ans. A large number of poles is not advisable except in very large machines, since it involves an increase in the expense

of machine work, fittings, etc., somewhat out of proportion to the reduction in cost of material and increase in efficiency.

Ques. What materials are generally used for field magnets?

Ans. Wrought iron, steel and copper.

There are a number of considerations which govern the selection of the materials to be used in a particular machine, such as initial cost, weight, efficiency, etc.

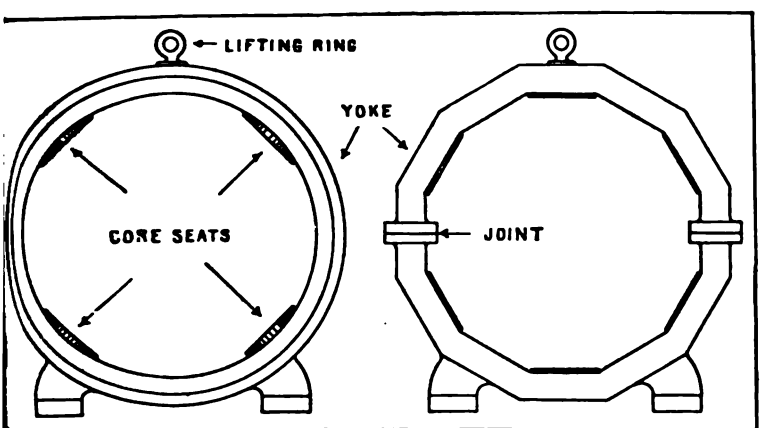


Figs. 205 and 206.—Solid and split construction of yoke for multi-polar dynamos. In the latter type the yoke is in two halves joined along a horizontal diameter; while the upper half may be conveniently removed to give access to the armature, it has the disadvantage of the joint, which, no matter how well made, will add to the reluctance of the magnetic circuit. The figures also illustrate the circular and segmental forms of yoke construction.


Ques. In the construction of field magnets, what governs the choice of materials?

Ans. For cores, wrought iron is most desirable, as requiring the smallest amount of material for a given flux. There is a saving in copper due to using wrought iron for the core since, on account *of its small size,* the length of each turn of the

magnetizing coil is reduced. For heavy yokes, where lightn not essential, but very often the reverse, cast iron is us its cross section can be made larger than that of the core ncrease in area serving to give strength and rigidity t machine. Cast steel occupies a place intermediate be cast iron and wrought iron both in cost and magnetic erties.

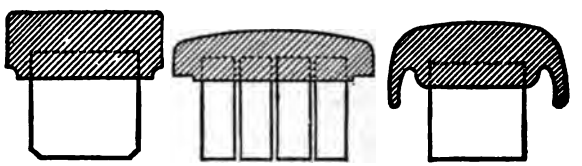

Figs. 207 to 209.—Various sections of cast iron yoke. In form, these yokes may be circular or segmental as shown in figs. 205 and 206.

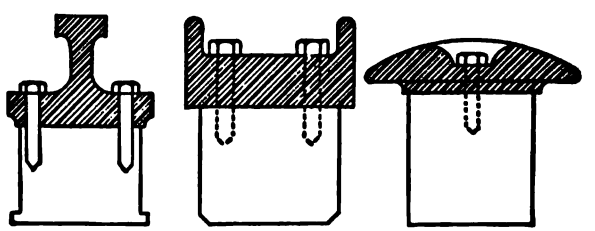

Figs. 210 to 212.—Various sections of cast steel yoke. The ribs shown in figs. 210 a provided to secure stiffness.

Ques. Name two forms of yoke in general u

Ans. The solid, and divided types as shown in figs. 2 206.

Ques. What is the object of dividing a yoke


Ans. To permit access to the armature, where *struction* does not admit of removal of the latter from

Ques. How is the yoke usually divided?

Ans. Across its horizontal diameter into an upper and lower half, as shown in fig. 206, the lower half being seated on, or more frequently cast in one piece with the bed plate.

Ques. What is the objection to dividing a yoke?

Ans. The joints introduced, even if carefully faced and well bolted together, add a little reluctance to the magnetic circuit.

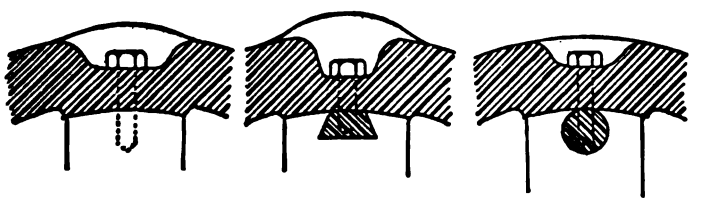

FIGS. 213 to 215.—Some methods of attaching detachable cores. The core seat is machined to receive the core, it being necessary to secure good contact in order to avoid a large increase in the reluctance of the magnetic circuit.

Ques. How does this affect the poles adjacent to the points, and what provision is made?

Ans. It weakens them, and in order to overcome this, the coils of these poles are given a few extra turns.

Ques. How is the reluctance of a yoke joint reduced?


Ans. By enlarging the area of contact; the flange for the bolts furnishes the necessary increase.

Ques. What determines chiefly the cost of field magnets?

Ans. *The material used in* making the cores and their shape.

Ques. How does this affect the cost?

Ans. Since considerable cross sectional area of core is required, the problem confronting the designer is to design the core by judicious selection of material and shape, that the required number of turns in the magnetizing coil is obtained with the shortest length of wire.

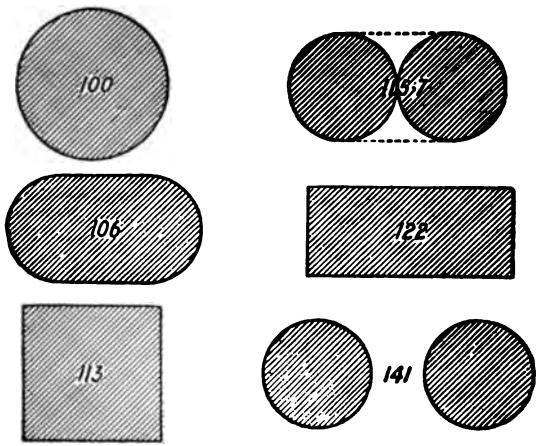

FIGS. 216 to 221.—Comparison of field magnet core sections. The shorter the perimeter or outside boundary of the core for a given cross sectional area, the less will be the amount of copper required for the magnetizing coils. All the above sections are of equal area, and the figures marked on each represent relative values for the perimeters, the circle for convenience being taken at 100.

Ques. What is the principal objection to the use of cast iron for core construction?


Ans. Since its sectional area must be considerably more than wrought iron, a much greater quantity of copper is required for the magnetizing coils.

Copper is expensive, while cast iron cores are less expensive than *equivalent* ones of wrought iron; in this connection, it is interesting to *observe* how different designers aim at true economy in construction.

Steel is sometimes used in place of wrought iron, and though less efficient magnetically, it can be cast into the desired shape, thus avoiding the somewhat expensive processes of forging and machining, which are necessary in the case of wrought iron.

Ques. What form of core requires the least amount of copper for the magnetizing coils, and why?

Ans. The cylindrical core, because it has the shortest periphery or boundary for a given area enclosed.

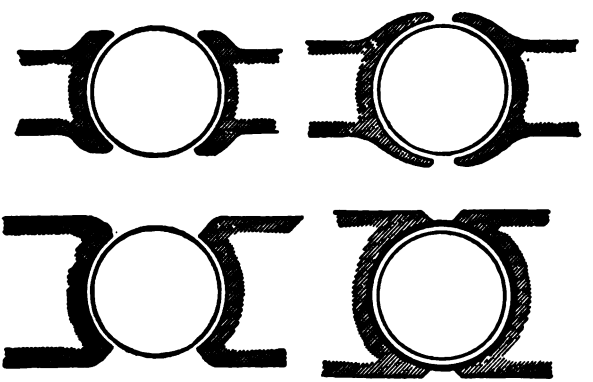

Figs. 222 to 225.—Several forms of pole piece. Where the extremities project as in figs. 222 and 223, they are called *horns*. The object of these is to reduce the reluctance of the air gap. The width of "fringe" of the magnetic field is influenced by the shape of the pole piece; the margin of fringe should be such that the flux density will vary from zero to a high value where the inductors enter.

Figs. 216 to 221, show a series of cross sections, all of the same area. The number marked on each section indicates the length of the boundary line, that of the circle being taken for convenience as 100.

Ques. What are the pole pieces?

Ans. These are the end portions of the field magnets, joined to, or cast together with the core and placed adjacent to the armature.

The faces of the pole pieces are of circular shape, thus form sides of the so-called armature chamber within which the ar rotates.

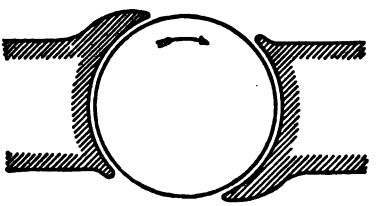


FIG. 226.—Unsymmetrical pole piece introduced by Gravier to concentrate the magn When the dynamo is working at small loads, the flux in the gap is nearly unif at heavy loads, the distortion due to the armature current forces the flux forw saturates the forward horn, thus preventing much change in its flux density, on of the saturation, and the diminishing area. Lundell combined the unsymmetr slotted forms of pole piece as shown in fig. 237.

Ques. Why are the pole faces made larger thar coils?

Ans. In order to reduce the reluctance of the air gap be the face and the armature, thus enabling fewer magne coils to be used.

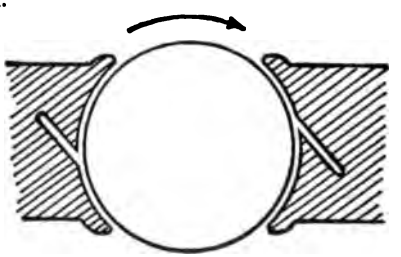



FIG. 227.—Pole piece with oblique slots; a modification of Lundell's form of pole suggested by Thompson. In operation, the neck of the casting becomes satur offers considerable reluctance, which tends to prevent distortion of the magneti

It is important that the field should be magnetically rigid, that easily distorted. This stiffness of field can be partially secu *judicious* shaping of the pole pieces. A few forms of pole pi *shown in figs.* 222 to 231.


If the projecting tips of the pole pieces, *or horns* as they are called, be widely separated, as in fig. 222, they are not always good, even though thin. It is better that they should be extended as in fig. 223 so that they may be saturated by the leakage field or else cut off as in fig. 224.

An extreme design, suggested by Dobrowolsky, as shown in fig. 225, surrounds the armature with iron.

Another scheme, proposed by Gravier, employed the unsymmetrical form shown in fig. 226. In this pole piece the forward horn is elongated. The action due to this arrangement is such that when the machine is

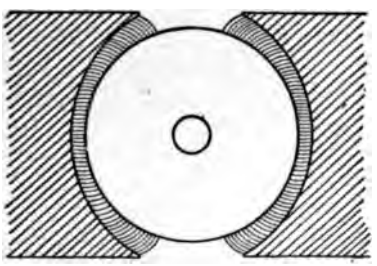

228—Non-concentric pole faces; one method of securing suitable magnetic "fringe" with fair magnetic rigidity of field.

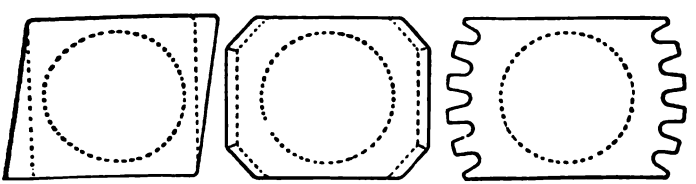

. 229 to 231.—Various shapes of pole piece for securing a gradual entrance of the armature nductors into the magnetic field.

working at small loads, the field in the gap is nearly uniform, but at heavy loads with distorting reactions which have a tendency to drive the flux into the forward horn, the small section of the latter causes it to become saturated, thus reducing the distortion to a minimum.

Eddy Currents; Laminated Fields.—The field magnet res and pole pieces, as well as the armature of a dynamo are ecially *subject to eddy currents*, that is, induced electric

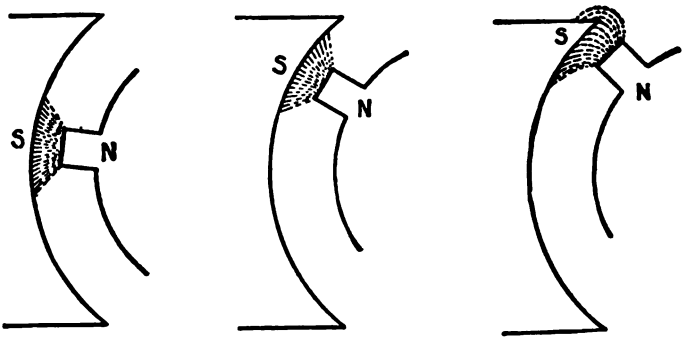


FIG. 232.—Illustrating the alteration of magnetic field due to movement of mass of iron in the armature. If the masses of iron in the armature are so disposed that as it rotates, the distribution of the lines of force in the narrow field between the armature and the pole piece is being continually altered, then, even though the total amount of magnetism of the field magnet remain unchanged, eddy currents will be set up in the pole piece and will heat it. This is shown in the above figures, which represent the effect of a projecting tooth, such as that of a Pacinotti ring, in changing the distribution of magnetism in the pole piece.

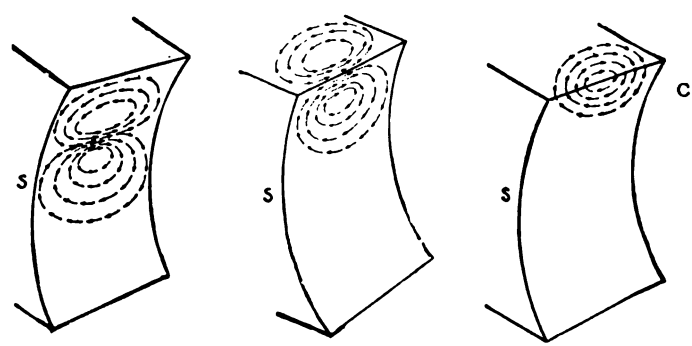


FIG. 233 — Eddy currents induced in pole pieces by movement of masses of iron. These diagrams, which correspond to those of fig. 232, show the eddy currents grouped in pairs of vortices. The strongest current flows between the vortices and is situated just below the projecting tooth, where the magnetism is most intense; it moves onward following the tooth. At C is shown what occurs during the final retreat of the tooth from the pole piece. These eddy currents penetrate into the interior of the iron, although to no great *depth. Clearly* the greatest amount of such eddy currents will be generated at that part *of the pole piece* where the magnetic perturbations are greatest and most sudden. A *glance at the figures* shows that this should be at the forward horn of the pole piece. How*ever, when* a dynamo, with horned pole pieces, has been running for some time as a motor *the forward horns* are cool and the hindward horns hot.

currents occurring when a solid metallic mass is rotated in a magnetic field. These currents consume a large amount of energy and often occasion harmful rise in temperature. This loss may be almost entirely avoided by laminating the pole piece, or both pole piece and core; in the latter case, both form one part without any joint.



FIG. 234.—Fort Wayne laminated pole piece before being cast welded into frame. In the faces of solid pole pieces there exist minute electric currents called *eddy currents* which cause heating of the iron and increase the energy required to maintain a magnetic circuit in much the same manner as does reluctance. This loss is reduced by dividing the magnetic circuit in the line of flux into numerous parallel paths separated by some material of relatively high resistance. In construction, the above core and pole piece is made up of sheets of annealed steel of two different widths assembled together to form proper size and shape. The minute spacing between these laminations and the slight oxidizing on each surface is sufficient to reduce considerably the eddy currents. By cast welding the pole piece into the frame, a low reluctance is secured.

Ques. What is a laminated pole?

Ans. One built up of layers of iron sheets, stamped from sheet metal and insulated, as shown in fig. 234.

Ques. What may be said of this construction?

Ans. It is a *most approved* method, and one frequently *in the construction* of cores and pole pieces.

Fig. 234 shows a combined core and pole piece made entirely of she iron punchings assembled and riveted together, and fig. 235, a core be used with separate pole piece. It should be noted that in both cas there is a longitudinal slot extending from the end into the core. Tl was first suggested by Lundell, the object being to prevent, as far possible, the distortion of the magnetic field due to armature reacti especially on heavy overloads.

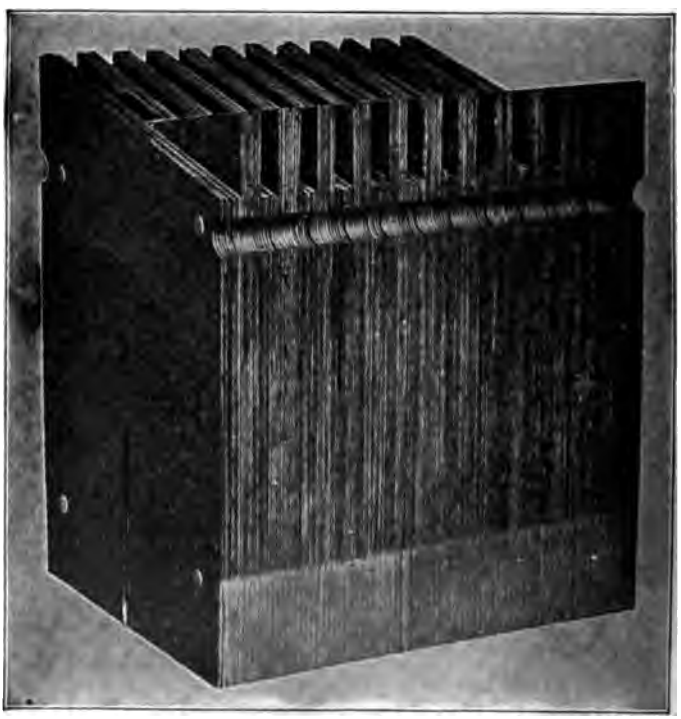


FIG. 235.— Fort Wayne laminated core without pole piece, as used on large dynamos. It consists of punchings of sheet iron, and riveted under pressure. The alternate e projections and grooved base insure good mechanical union of metal in cast welding magnet frame. Reluctance between core and yoke is reduced to a minimum by ca welding. The core is slotted parallel with the shaft to prevent, as far as possible, the di tortion of the magnetic field, especially on heavy overloads.



Ques. What mode of construction is adopted to reduce the reluctance of the magnetic circuit when laminated poles are used?

Ans. They are cast welded into the frame.

The frame end of the core as shown in the illustrations has irregularities in the heights of the different sheets, as well as grooved undercut



Fig. 226.—Fort Wayne one piece frame with cast welded combined cores and pole pieces. In any electrical apparatus a magnetic circuit of low reluctance requires less energy to maintain a given flux than one having a comparatively high reluctance. To reduce this to a minimum the pole pieces and cores are combined into one part and then cast welded into the yoke or *frame. Thus the continuity* of the magnetic circuit is practically unbroken *save for the air gap.*

surfaces, in order to enable the molten metal of the frame to key well into the laminations of the core, making a good joint, both mechanically and electrically. By this construction, the continuity of the magnetic circuit is practically unbroken save for the air gap between the pole piece and armature.

Fig. 236 shows a one piece frame of a six pole dynamo having cast welded into it, combined cores and pole pieces.

Ques. What is the disadvantage of laminating a core?

Ans. It necessitates a nearly square or rectangular section, which requires more copper for the winding than the cylindrical form.

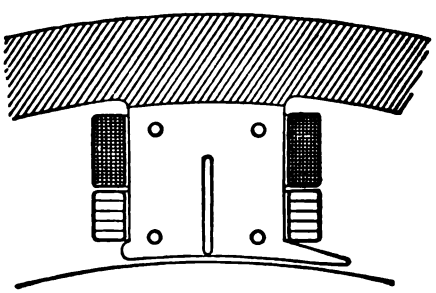


FIG. 237.—Lundell type of combined core and pole piece; a combination of Gravier's unsymmetrical horns and longitudinal slot designed to prevent distortion of field.

The Magnetizing Coils.—The object of the magnetizing coils, is to provide, under the various conditions of operation, the number of *ampere turns* of excitation required to give the proper flux through the armature to produce the desired electromotive force.

With respect to the manner in which magnetizing coils are wound they are said to be:

1. *Spool* wound;
2. *Former* wound.



Ques. Describe the methods of constructing spool ound coils.

Ans. The spool is made in various ways, sometimes entirely brass, or of sheet iron with brass flanges, or of very thin cast n. Some builders use sheet metal with a flange of hardwood, h as teak. If a spool be simply put upon a lathe to be nd, the inner end of the wire, which must be properly se- ed, should be brought out in such a way that it cannot sibly make a short circuit with any of the wires in the upper



238.—Method of winding magnet spool so that the two ends of the coil will come to th utside. This method has also been used for induction coils, where it is desirable to keep he ends of the wire away from the core and primary coil.

rs. To avoid this difficulty, the wire is sometimes wound he spool in two separate halves, the two inner ends of which united, so that both the working ends of the coil come to outside as shown in fig. 238.

ues. Describe the construction of former wound s.

ns. Former wound coils are wound upon a block of wood ing temporary flanges to hold the wire together during the ding. *Such coils have pieces of* strong tape inserted between

the layers and lapped at intervals over the windings to bind them together. Coils are usually soaked with insulating varnish and stove dried.

Ques. What may be said with respect to the coil ends?

Ans. Several methods of bringing out the ends of coils are shown in figs. 238 to 241. In fig. 239 copper strip, laid in behind an end sheet of insulating material, makes connection to the inner end, as shown in the right side of the figure, while

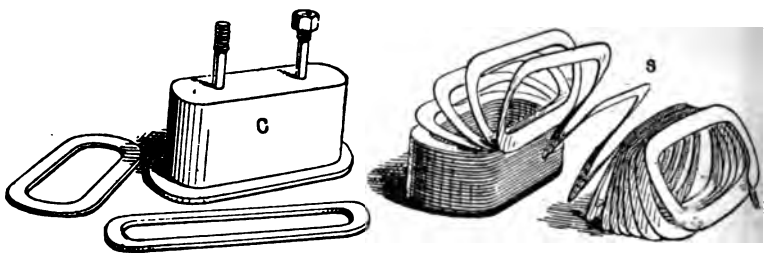


FIG. 239.—Core and edge strip winding for shunt field coils of large multipolar dynamo. The winding consists of a copper strap S carefully insulated and placed edgewise on the core C in a single layer of winding. With this arrangement, the space occupied by insulation is reduced to a minimum, and, although the cooling surface is small, each turn of the winding has one edge on the outer surface, being ample for adequate cooling.

another strip, shown on the left side similarly inlaid, serves as a mechanical and electrical attachment for the outer end of the winding.


Two other methods are shown in figs. 240 and 241. A simple device for securing the outer end is to fashion a terminal piece so that it can be laid upon the winding, the last three or four turns of which are wound over its base, and after winding, are bared at the place and securely soldered.

Ques. How are the coils insulated?


Ans. The spools upon which the coils are wound are usually insulated with several layers of paper preparations, a thickness



one-tenth of an inch made up of several superposed layers eneral'y sufficient. Varnished canvas is useful as an under- and vulcanized fibre for lining the flanges. It is important rotect the joint between the cylindrical part and the flanges. ore paper may be laid upon every four layers of winding. ween series and shunt coils, in compound wound machines e should be an insulation as efficient as that on the cores.

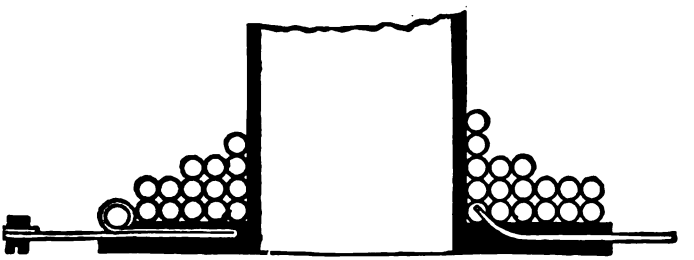



. One mode of bringing out the coil ends, in which copper strip is laid in behind an .heet of insulating material.

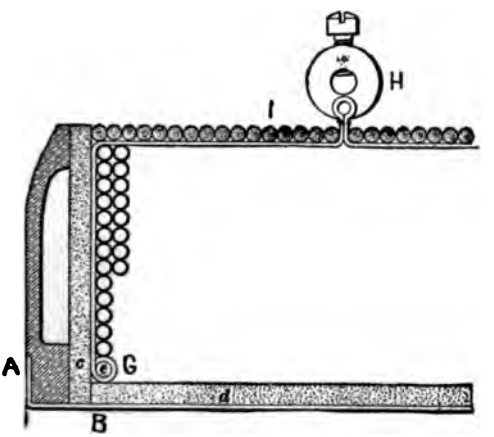

—Another mode of bringing out the coil ends. A narrow insulated strip of thin cop- leading to terminal H, is connected with the end e of the coil before winding.

When the winding is completed, two layers of pressed boa or equivalent are laid over and bound with an external windi of hard rope or tape. This protective external lagging cover the outer surface of the completed coils is not altogether benefit for it tends to prevent dissipation of heat.

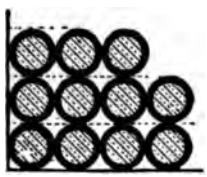

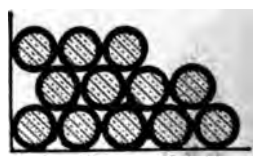

FIGS. 242 and 243.—Square and hexagonal order of "bedding." The term bedding is an pression used to indicate the relation between the cross sectional area of the winding wound square, as in fig. 242, and where wound in some other way, as in fig. 243. In square order of bedding, the degree of bedding equals zero.

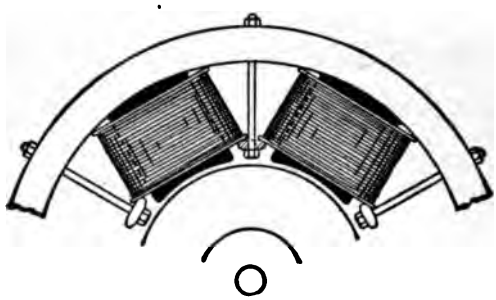


FIG. 244.—Method of securing coils in position when the pole pieces are simply extensions the core without enlargement.

Ques. How are the coils attached?

Ans. Where the pole pieces are simply extensions of t cores without enlargement, the coils can be slipped over t ends, but some kind of clamping device is necessary to h them in place, as for instance, the method shown in fig. 2


In case the pole piece be made larger than the core and separate from, it is put into position after the coils are in place, thus serv double purpose of pole piece and clamp.



es. Describe the coil connections.

. Coils are generally united in series so that the magnetizing current may flow through all of them. The should be so connected that they produce alternate and south poles.

If all the coils be similarly wound with respect to the terminals, and milarly placed; that is so placed that the winding, considered from the il terminal nearest the pole face, starts in all the coils in the same irection, then the connections will come at the north end and at the outh end of the spools.

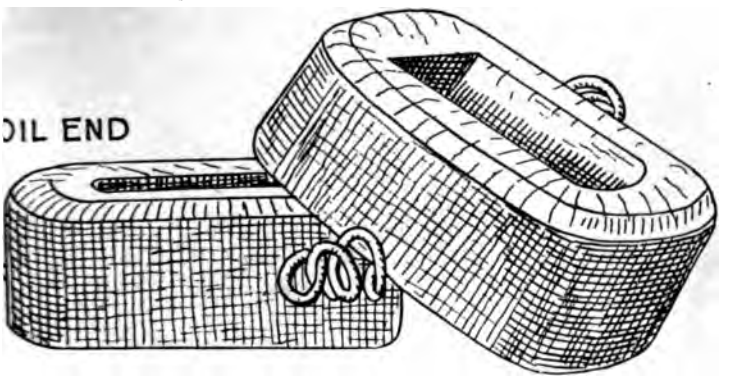

i.—Western Electric set of former wound field coils for four pole dynamo. These coils wound around a former or template, and are then slipped over the cores before the er are bolted to the yokes or frame.

ating.—The heat generated in the magnetizing coils sipated in three ways; by:

Induction;
Radiation;
Convection.

the first instance, it passes through the copper and the ation, either to the external surface, whence it passes off adiation *and convection into* the air, or to the magnet



core and yoke, which in turn conduct it away. In large polar machines the masses of metal in the pole cores and are more efficient in dissipating heat than the external of the coil.



FIG. 246.—Fort Wayne compound wound rectangular ventilated spool field coil. and shunt coils are wound side by side, ventilating passages being provided through each coil and between the shunt and series coils as shown.

Ventilation.—Sometimes provision is made for ver of the field magnet coils as shown in fig. 246. Here th and shunt coils are wound side by side, ample ventilatic provided lengthwise through and between the coils.

[AWKINS PRACTICAL LIBRARY OF

[LECTRICITY

HANDY POCKET FORM **PRICE $1 EACH**

y are not only the best, but the cheapest work published on Electricity. h number being complete in itself. Separate numbers sent postpaid to address on receipt of price. They are guaranteed in every way or money will be returned. Complete catalog of series will be mailed on request.

[CTRICAL GUIDE, NO. 1
Containing the principles of Elementary Electricity, Magnetism, Induction, Experiments, Dynamos, Electric Machinery.

CTRICAL GUIDE, NO. 2
The construction of Dynamos, Motors, Armatures, Armature Windings, Installing of Dynamos.

CTRICAL GUIDE, NO. 3
Electrical Instruments, Testing, Practical Management of Dynamos and Motors.

CTRICAL GUIDE, NO. 4
Distribution Systems, Wiring, Wiring Diagrams, Sign Flashers, Storage Batteries.

CTRICAL GUIDE, NO. 5
Principles of Alternating Currents and Alternators.

CTRICAL GUIDE, NO. 6
Alternating Current Motors, Transformers, Converters, Rectifiers.

CTRICAL GUIDE, NO. 7
Alternating Current Systems, Circuit Breakers, Measuring Instruments.

CTRICAL GUIDE, NO. 8
Alternating Current Switch Boards, Wiring, Power Stations, Installation and Operation.

CTRICAL GUIDE, NO. 9
Telephone, Telegraph, Wireless, Bells, Lighting, Railways

CTRICAL GUIDE, NO. 10
Modern Practical Applications of Electricity and R
ence Index of the 10 Numbers.

EW YORK.

. Audel & Co., Publishers.



[redacted]

OUGHT IS IN THE QUESTION THE INFORMATION IS IN THE ANSWER

HAWKINS

ELECTRICAL GUIDE

NUMBER TWO

QUESTIONS ANSWERS & ILLUSTRATIONS

A PROGRESSIVE COURSE OF STUDY FOR ENGINEERS, ELECTRICIANS, STUDENTS AND THOSE DESIRING TO ACQUIRE A WORKING KNOWLEDGE OF

TRICITY AND ITS APPLICATIONS

A PRACTICAL TREATISE

BY

HAWKINS AND STAFF

EO. AUDEL & CO. 72 FIFTH AVE. NEW YORK.



THE NEW YORK
PUBLIC LIBRARY
677768 A
ASTOR, LENOX AND
TILDEN FOUNDATIONS
R 1933 L

COPYRIGHTED, 1914,
BY
THEO. AUDEL & CO.,
NEW YORK.

Printed in the United States.

TABLE OF CONTENTS GUIDE NO. 2.

HE ARMATURE - - - - - - - - - 221 to 228

Definition—**how continuous current is obtained**—type of armature—comparison ring and drum armatures—**why drum armature is the prevailing type**—disc armatures—why disc armatures were abandoned.

RMATURE WINDINGS - - - - - 229 to 256

Preliminary considerations—**winding diagrams** and **winding tables**—lap and wave winding—angular pitch or **spread** of drum coils—parallel or **lap winding**—series or **wave winding**—double windings—Siemens winding—objection to Siemens winding—**chord winding**—multiplex windings—number of brushes required—number of armature circuits—**equalizer rings**—**drum winding requirements.**

EORY OF THE ARMATURE - - - 257 to 282

Current distribution in ring and drum armatures—**connection of brushes**—variation of voltage around the commutator—**cross magnetization**; field distortion—remedies for field distortion—angle of lead—demagnetizing effect of **armature reaction**—**effect of lead**—**eddy currents**; lamination—remedy for eddy currents—magnetic drag on the **armature**—smooth and slotted armatures—comparison of **smooth** and slotted armatures—magnetic **hysteresis** in **armature** cores—**core loss** or iron loss—dead turns—**friction.**

COMMUTATION AND THE COMMUTATOR - - - - - - 283 t

Period of commutation—commutating plane—normal neutral plane—neutral plane—plane of maximum induction —commutation — position of the brushes — **sparking** — effect of self-induction — construction of commutators— **points relating to commutators** — types of commutator.

BRUSHES AND THE BRUSH GEAR - - 303 t

Classification — gauze brushes — wire brushes — strip brushes — **carbon brushes** — adjustment — comparison of copper and carbon brushes — size of brushes — number— **contact angle of brush** — brush contact — drop in voltage at brushes — **brush holders** — brush rigging — multipolar brush gear.

ARMATURE CONSTRUCTION - - - 321 t

Parts — shaft—core — slotted core — **core laminations** — core bolts — attachment to shaft — insulation of core discs — teeth — advantages and defects of slotted armatures — slotted cores; built up construction — **ventilation** — **insulation of core** — armature windings — construction of inductors — objection to copper bars — **various windings:** hand winding — evolute or butterfly winding — connectors — barrel winding — bastard winding — former winding — former coils — peculiarity of evolute coil — "straight out" coil — **coil retaining devices** — driving horns.

MOTORS - - - - - - - - - - - - - 349 t

Definition — **principles** — propelling drag — essential requirements of construction — **the reverse electromotive force** — hydraulic analogy — action of current supplied to motor — **armature reaction** in motors — method of starting a motor — classes of motor; **series, shunt, and compound** — power of a motor — brake horse power — mutual *relations* of motor torque and speed — **speed regulation** — *series parallel* controller — **interpole motors.**



SELECTION AND INSTALLATION - - 389 to 406

General conditions governing selection — construction — efficiency — adaptation of series and shunt motors — location — foundations — **erection of dynamos and motors** — connecting up dynamos — marine generating set — **belt clamp** — belt lacing — belt speed — **points relating to belts** — gear drive — friction drive — **electrical connections.**

UXILIARY APPARATUS - - - - - 407 to 430

Switches — switch classification and construction — difficulty encountered in opening the circuit — **various switches:** knife, snap, and quick break types — **fuses** — circuit breakers: maximum, minimum, reverse current, maximum and reverse current, no voltage breaker — **discriminating cut out** — time limit attachments — **rheostats** — starting boxes — **switchboards.**



CHAPTER XVII

THE ARMATURE

The armature of a dynamo consists of coils of insulated wire wound around an iron core, and so arranged that electric currents are induced in the wire when the armature is rotated in a magnetic field or the field magnets rotated and armature held stationary.

The commutator is in fact a part of the armature, but is of sufficient importance to be considered in a separate chapter.

Ques. What are the practical objections to the elementary armature, described in fig. 165?

Ans. It induces a very feeble current, which is not of constant pressure, but pulsating; that is, it consists of two pronounced impulses in each revolution as shown in fig. 168.

Ques. Why does the elementary armature produce a pulsating current?

Ans. The pulsations are due to the coil moving alternately into, and out of, the positions of best and least action in the magnetic field.

Ques. How is a continuous current, or one of uniform pressure obtained?

Ans. If an additional coil be added to the elementary armature, *at right angles to the* existing coil, and its ends suitably *connected to a four part* commutator, as in fig. 185, so that

one coil is in the position of best action, while the other is in the position of least action, the pulsations of the resulting current will be of less magnitude. By increasing the coils and suitably altering the construction of the commutator to accommodate the ends of these coils, the resultant current may

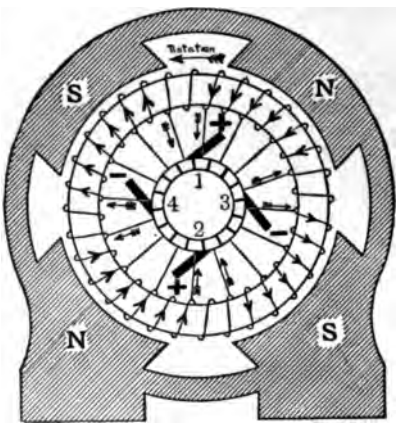


FIG. 247.—Ring armature of four pole dynamo; diagram of winding and connections, showing direction of the induced currents. The currents in the windings under the upper *N* and *S* poles are opposed to each other and flow to the external circuit by the positive brush 1, and back to this half of the armature by the negative brushes 3 and 4. At the same instant the opposed currents in the lower windings flow to the external circuit by positive brush 2 and return to the armature through negative brushes 3 and 4. The armature is thus divided into four circuits and four brushes are required which must be placed between the poles so as to short circuit the coils as they pass through the neutral space. In this form of winding there is no difference of potential between the + brushes, so that they are connected in parallel, as are also the negative brushes, and then to the external circuit. In multipolar machines there are as many brushes as pole pieces. Since opposite commutator bars are of the same potential on this four pole dynamo they may be joined by a cross connecting wire and two brushes, as 2 and 4, dispensed with. This can only be done when there is an even number of coils. The armature is said to be "cross connected."


be represented by practically a straight line, indicating the so called *continuous current*, instead of the wavy resultant curve No. 6, as illustrated in fig. 187.

An armature for practical use has a large number of coils, suitably *arranged* upon an iron core, so that a large proportion of them are *always actively* cutting the lines of force, or moving into the positions *of best action* in the magnetic field.

Types of Armature.—Although there are many forms of armature, all may be divided into three classes, according to the arrangement of the coils or winding on the core, as:

1. Ring armatures;
2. Drum armatures;
3. Disc armatures.

Each of these forms of armature has its own special advantages for particular purposes, the disc type being least in favor and not having had any extensive application in this country.

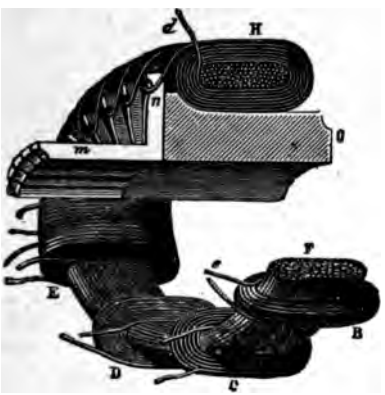

248.—Early form of Gramme ring armature, the core being shown cut through, and some of the coils displaced to make it clearer. The core, F, consists of a quantity of iron wire wound continuously to form a ring of the shape shown by the section. Over this is wound about thirty coils of insulated copper wire, B C D, etc., the direction of the winding of each being the same, and their adjacent ends connected together. The commutator segments consist of a corresponding number of brass angle pieces, *m*, *n*, which are fixed against the wooden boss, *o*, carried on the driving shaft. The junction of every two adjacent coils is connected to one of the commutator segments, as shown at *n*.

Ques. What is the comparison between ring and drum matures?

Ans. The drum armature is electrically and mechanically more efficient, possessing, as it does, possibilities in the *of better mechanical* construction of the core, and in the

arrangement and fixing of the inductors thereon not to be found in the ring form. Less wire and magnetizing current are required for the field magnets for a given output than with the ring armature. Drum winding is not so simple as ring winding, and it is more difficult to ventilate a drum than a ring armature, it being necessary to provide special ventilating ducts.

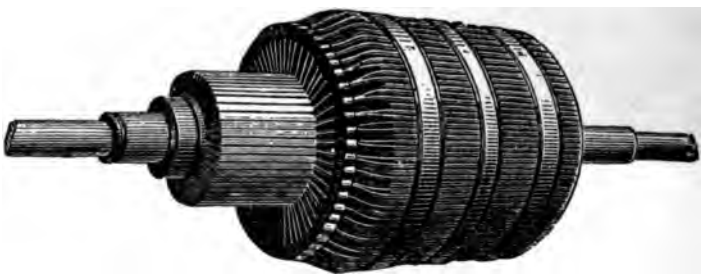


FIG. 249.—Modern form of Gramme ring armature. The core consists of a number of thin flat rings of well annealed charcoal iron, the outer diameter of each ring or disc being 11¼ inches, and its inner diameter 9¼ inches. Sheets of thin paper insulate each disc from its neighbors to prevent the flow of eddy currents. The armature is mounted on a steel shaft to which is keyed a four armed metal "spider," the extremities of whose arms fit into notches cut in the inner edges of the soft iron core rings, so that a good mechanical connection is obtained between the core and the shaft. The spider is made of a non-magnetic metal, to reduce the tendency to leakage of lines of force across the interior of the armature. The armature inductors consist of cotton covered copper wire of No. 9 standard wire gauge, wound around the core in one layer, and offering a resistance, from brush to brush, of 0.048 ohm. There are two convolutions in each section, the adjacent ends of neighboring sections being soldered to radial lugs projecting from the commutator bars.


Ques. Describe a ring armature.

Ans. It consists essentially of an iron ring, around which is wound a number of coils. These various coils are wound on separately, the wire being carried over the outside of the ring, then through the center opening and again around the outside, this operation being repeated until the winding for that individual section is completed. The adjacent coil is then wound in the same way, the ends of each being brought out to the commutator side of the armature, the arrangement of

e coils on the ring and connections with the commutator ing shown in fig. 247, examples of actual construction being own in figs. 248 and 249.

Ques. For what conditions of operation is the ring nature specially adapted, and why?

Ans. It is well suited to the generation of small currents high voltage, as for series arc lighting, because the numerous s can be very well insulated.

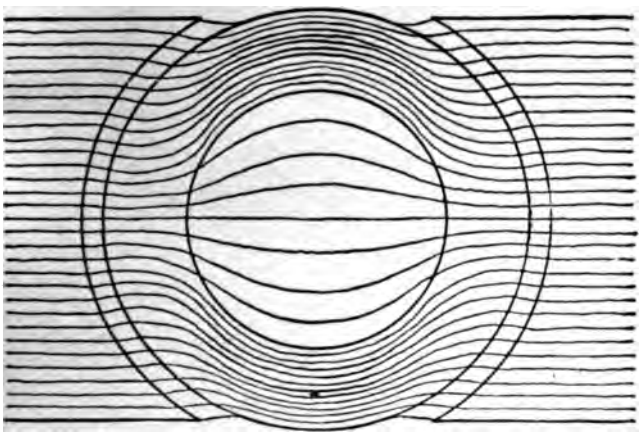

250.—Distribution of magnetic lines of force through a Gramme ring. Since the metal of the ring furnishes a path of least reluctance, most of the magnetic lines will follow the metal of the ring and very few will penetrate into the aperture of the interior. This condition causes a serious defect in the action of ring armatures rendering the winding around the interior useless for the production of electromotive force. Hence, in ring armatures only about half of the winding is effective, the rest or "dead wire," adding its resistance to the circuit, thus decreasing the efficiency of the machine.

Ques. Why does a ring armature require more copper the winding than a drum armature?

Ans. For the reason that those inductors which lie on the er side of the iron ring, being screened from practically the lines of force, as shown in fig. 250, do not generate any rent.

Numerous attempts have been made to utilize this part of the win by making the pole pieces extend around the ring in such a ma that lines of force will pass to the inside of the ring, also by arran an additional pole piece on the inside of the armature, but mechar considerations have shown these methods to be impractical.

Ques. Is any portion of the winding of a drum arn ture inactive?

Ans. Yes; the end connectors do not generate any curr

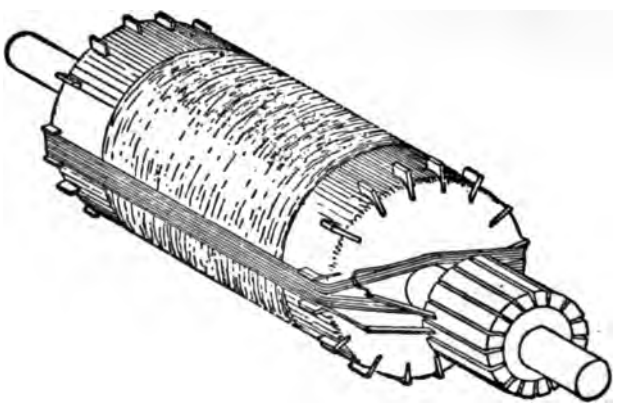


FIG. 251.—Illustrating the principle of Siemens' drum winding. In order to make the win and connections clear, one coil and the commutator is shown assembled, although latter is not put in place until after all the sections have been wound, the ends of wires being temporarily twisted together until all can be soldered to the risers. The c of these early machines were of wood overspun circumferentially with iron wire be receiving the longitudinal copper windings.

Ques. What is the chief advantage of the drum arn ature?

Ans. It reduces considerably the large amount of de *wire necessary* with the ring type.

Ques. How is this accomplished?

Ans. By winding the wire entirely on the outer surface of cylinder or *drum*, as it is called, as shown in fig. 251, thus ne of the wire is screened by the metal of the core.

Fig. 252 shows an elementary four coil drum armature. Starting from the point *a* and following the winding around without reference at

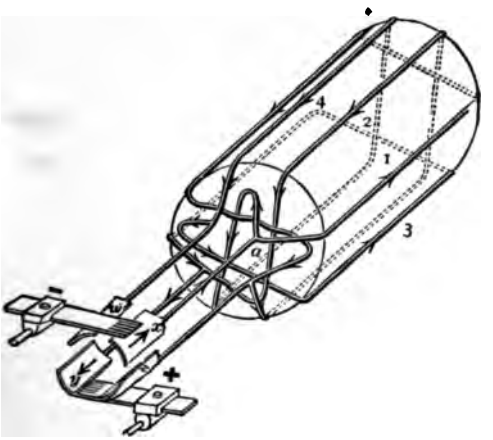


Fig. 252.—Elementary four coil drum winding, showing the connections with the commutator segments, and directions of currents in the several coils. The action of this type of armature is fully explained in the text.

first to the commutator, it will be found that the rectangular turns of the wire form a closed circuit, and are electrically in series with one another in the order of the numbers marked on them.

With respect to the connections to the four segments *w*, *x*, *y*, *z*, of of the commutator it will be found that at two of these, *x* and *y*, the pressures in the windings are both directed *from*, or both directed *toward* the junction with the connecting wire. At the other two segments, *z* and *w*, one pressure is toward the junction and the other directed from it. *If, therefore, the brushes* be placed on *x* and *y* they will supply *current to an external circuit*, *z* and *w*, for the moment being idle segments.

Disc Armatures.—The inductors of a disc armature move in a plane, perpendicular to the direction of the lines of force, about an axis parallel to them as shown in fig. 253. The main difficulty with this type has been in constructing it so that it will be strong and capable of resisting wear and tear. It was introduced in an effort to avoid the losses due to eddy currents and hysteresis present in the other types of armature.

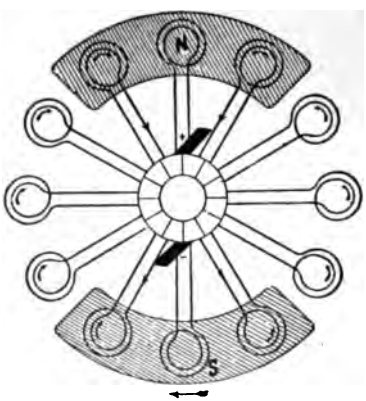


FIG. 253.—Disc armature of Niaudet. It is equivalent to a ring armature, having the coils turned through an angle of 90°, so that all the coils lie in a plane perpendicular to the axis of rotation. The connections of the coils with each other and with the commutator remain the same, the beginning and the end of adjacent coils leading to a common commutator bar as shown. The magnetic field is arranged by the use of two magnets, so arranged as to present the north pole of one to the south pole of the other, and *vice versa*. In the figure one of these magnets is considered as above the paper, and the other below. If this armature be rotated through the magnetic field as shown, a reversal of current takes place in each coil, when it is in such a position that one of its diameters coincides with the pole line, *NS*. If the brushes be set so as to short circuit the coils that are in this position, the armature will be divided into two branchings, the current flowing in an opposite direction in each, and a direct current will flow in the exterior circuit.

On account of the nature of the construction of a disc armature, it is necessary that the coils subject to induction occupy as small a space as possible in the direction of their axes. This requirement, as well as the connection of the inductors with each other and with the commutator, prevented the general adoption of this form of armature, and subsequent experience failed to justify the existence of the type.

CHAPTER XVIII

ARMATURE WINDINGS

'o connect up rightly the inductors on an armature so as ›roduce a desired result is a simple matter in the case of ring ding, for bipolar or multipolar machines. It is a less easy tter in the case of drum winding, especially for multipolar chines. Often there are several different ways of arriving the same result, and the fact that methods which are elec- ally equivalent may be geometrically and mechanically ferent makes it desirable to have a systematic method of ating the subject.

The elementary arrangement of drum and disc armatures s already been considered, which is sufficient explanation r small armature coils of only a few turns of wire, but in the case larger machines which require many coils, further treatment the subject is necessary.

For example, in order to direct the winder how to make the connections for, say a four pole machine having 100 bars spaced around its armature, some plain method of representing all the connections so that they may be easily understood is necessary. From this the workman finds out whether he is to connect the *front** end of bar No. 1 across to 50 or across a quarter of the circumference to 24, or across three quarters of it to bar 75. Again, he ascertains to which bar he is to connect the *back** end of the bar, and how the bars are to be connected to the commutator.

*NOTE.—*The "front" end means* the end at which the commutator is located. Arma- *are most conveniently regarded from* this end, the opposite end being known as the "end.

Winding Diagrams and Winding Tables.—In th
struction of armatures, instructions to winders are gi
the form of diagrams and tables. In the tables the
F and B stand for *front* and *back*, meaning *toward* th
end, and *from* the front end respectively. The letters
D stand for *up* and *down*.

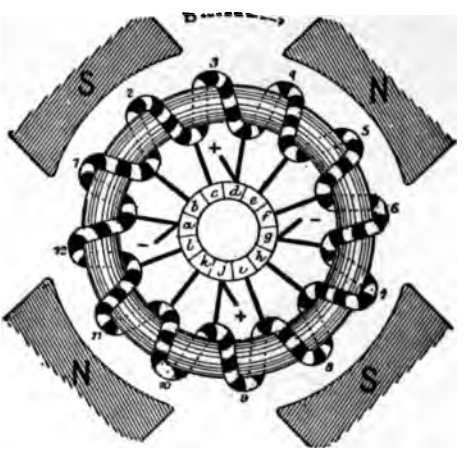


FIG. 254.--End of ring winding for a four pole machine. An end view is simply a vie the arrangement of the armature inductors and connections *looking from th commutator end*. A developed view of the above winding is shown in fig. 257.

There are three kinds of winding diagram:


1. End view diagram;
2. Radial diagram;
3. Developed diagram.

The end view is simply a view showing the arrangement armature inductors and connections looking from the fr commutator end, such as shown in fig. 254.



In the radial diagram the inductors of the armature are epresented by short radial lines, while the end connectors re represented by curves or zigzags, those at one end of the mature being drawn within, those at the other end, without e circumference of the armature. With the radial diagram is easier to follow the circuits and to distinguish the back d front pitch of the winding.

The developed diagram is a mode of representation, originally ggested by Fritsche of Berlin, in which the armature winding

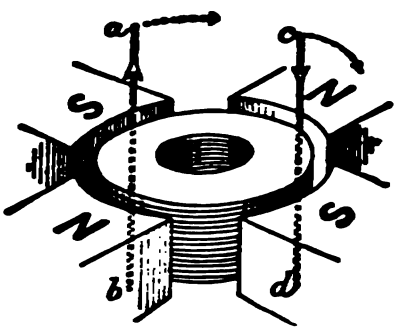

256.—Partial sketch of a four pole machine laid on its side. If the observer imagine himself placed at the center, and the panorama of the four poles to be then laid out flat, the developed view thus obtained would appear as in fig. 256.

considered as though the entire structure had been developed t of a flat surface. This is best explained by aid of figs. 255 d 256.

If in fig. 255, which represents an armature core and a four pole field, wires *a* and *c* be placed parallel to the axis of the armature to represent two of the armature inductors, and moved along the air gap space clockwise past the S poles, they will cut magnetic lines inducing electromotive forces in the directions indicated. To attempt to show a large number of inductors in a drawing of this kind would be unintelligible. Accordingly, the observer is considered as being placed at the center of the armature, and the *panorama* of the four poles surrounding him to be *then laid out flat* or "developed" as in fig. 256.

The faces of the N and S poles are shaded obliquely for di
By choosing the proper directions for these oblique lines, a
paper having a narrow slit to represent the wire may be
the drawing of the pole and when moved, as indicated by t
arrows to the right, the slit in passing over the oblique lines
an apparent motion in the direction in which the current in rea
to flow. It is easily remembered which way the oblique li
slope, for those on the N pole slope parallel to the oblique pa
letter N.

Lap Winding and Wave Winding.—In winding ar
there are two distinct methods employed, known resp
as *lap* and *wave winding*. The distinction arises in the fc

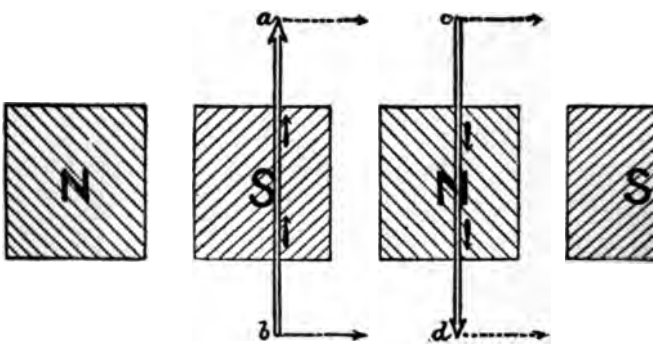


FIG. 256.—Developed view of the four pole field shown in perspective in fig.

manner: Since the inductors, in passing a north pole g
electromotive forces in one direction, and in passing
pole generate electromotive forces in the opposite di
it is evident that an inductor in one of these groups o
be connected to one in nearly a corresponding position
other group, so that the current may flow down one and
other in agreement with the directions of the electr
forces. The order followed in making these connectio
rise to lap and wave windings.

Ques. What is lap winding?

Ans. *One in which the ends of the coils come back to adjacent segments of the commutator; the coils of such a winding lap over each other.*

Ques. What is a wave winding?

Ans. *One in which the coil ends diverge and go to segments widely separated, the winding to a certain extent resembling a wave.*

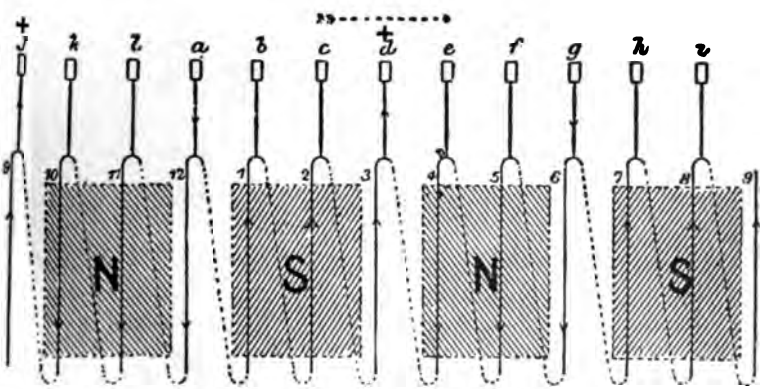


FIG. 257.—Development of ring winding of four pole machine shown in fig. 254. The dead wire or inactive inductors on the inside of the ring are shown in dotted lines, the full lines representing the active portion of the winding.

Angular Pitch or Spread of Drum Coils.—Before taking up the winding as a whole, the form of the individual coil should be considered. Fig. 260 shows an end view of one coil in position on a drum armature of a multipolar machine. The two slots X and Y contain the sides of the coil and the distance between them on the surface of the drum is called the angular pitch or spread of the coil. Theoretically this is equal to th

WINDING TABLE.

A	1	6	B	
B	3	8	C	
C	5	10	D	
D	7	12	E	
E	9	2	F	
F	11	4	A	

pitch of the poles, represented by the angle M, which is the angle between the pole centres.

For instance, on a four pole machine the pitch would be 90°, on a six pole machine, 60°, etc. Usually the angular pitch of the coil is made just a little less than the pole pitch of the machine, in order to shorten the end connections of the coils from slot to slot. However, if the angular pitch be made too small trouble will be encountered in commutation.

In addition to the angular pitch there is the ***commutator pitch*** which relates to the distance around the commutator bridged by the ends of the coil. Thus, if the commutator segments were numbered consecutively 1, 2, 3, etc., and the ***commutator pitch*** say is 10, it would signify that one end of the coil was connected to segment 1 and the other end to segment 11; the ends of the next coil in order then would be connected to segments 2 and 12, in each case there would be ten segments between the two segments connecting with the coil ends.

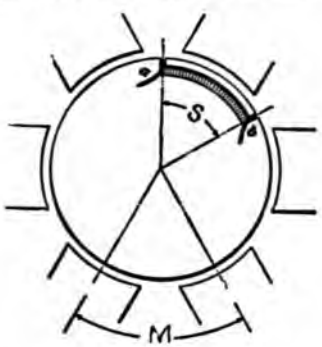


FIG. 260.—End view of drum armature of a multipolar machine showing one coil in position to illustrate the *angular pitch* or spread of drum coils.

Parallel or Lap Drum Winding.—In order to avoid much of the difficulty usually experienced by students of drum winding, the beginner should construct for himself a wooden armature core upon which he can wind strings of various colors, or wires with distinctive insulation, to represent the numerous coils that are used on real armatures. A few windings attempted in this way will make clear many points that cannot be so easily learned from *a written description.*

The type of drum core best adapted for this work is the slotted variety as shown in fig. 258, as it will facilitate the winding. The core as shown in the illustration has twelve slots and six commutator segments, the number of each required for the example of lap winding indicated in the winding table fig. 259.

In making the wooden core, the slots may be formed by nailing a series of thin strips around a cylindrical piece of wood, thus avoiding the trouble of cutting grooves. In the illustrations the commutator segments are shortened (leaving no room for brushes) in order to show the connections as clearly as possible.

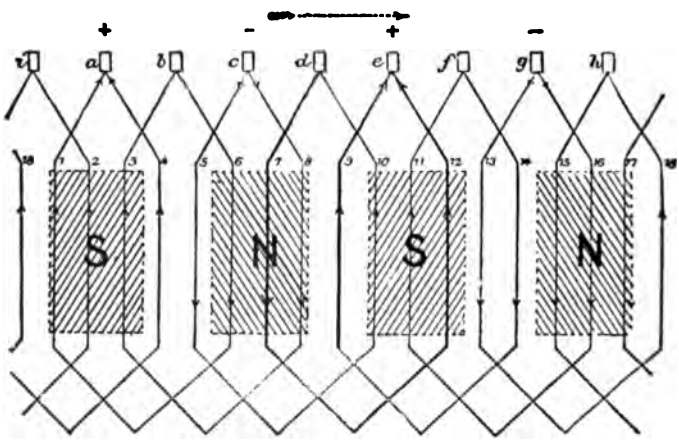


FIG. 261.—Developed view of a typical lap winding. From the figure it is seen that at the back of the armature each inductor is united to one five places further on, that is, 1 to 6, 3 to 8, etc., and at the front end of the winding, after having made one "element," as for example *d*–7–12–*e*, then forms a second element *e*–9–14–*f* which "laps" over the first, and so on all around until the winding returns on itself.

Ques. Describe the simple lap winding fig. 259.

Ans. As given in the table, it consists of six loops of wire presenting twelve inductors on the cylindrical surface of the core or drum. In the table, six wires are shown, having

distinctive and varied insulation so as to readily distinguish the different coils. Opposite these are letters and figures designating the path and connections of each coil.

Ques. What is the path of the first coil?

Ans. According to the table it is:

A—1—6—B

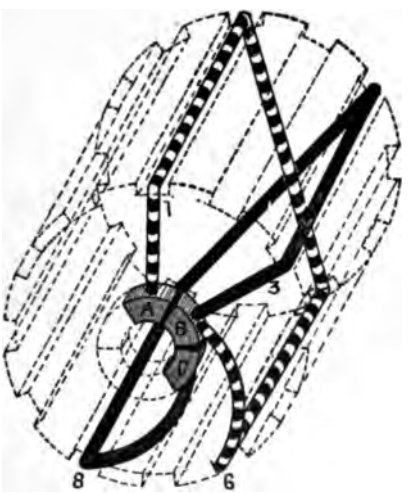


FIG. 262.—Skeleton view of wooden armature core showing in position the first two coils of the winding indicated in the table fig. 259.

that is, one end of the wire is connected to commutator segment A (fig. 262) and then wound to the back of the drum through slot 1, across the back of the drum to slot 6, returning through this slot, and then connected with commutator segment B.

Ques. Describe the path of the second coil.

Ans. *The second coil,* having the block insulation, is wound *according to the table,* in the order:

B—3—8—C

that is, beginning at segment B, thence to back of drum through slot 3, across the back to slot 8, returning through this slot and ending at segment C.

The completed winding of the first two coils are shown in fig. 262, the drum being shown in dotted lines so that all of each coil may be visible.

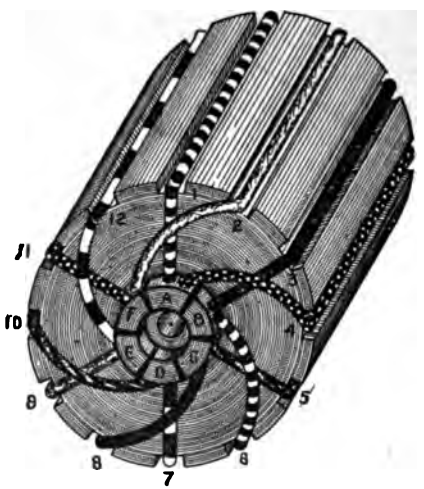


FIG. 263.—View of completed winding as indicated in the table fig. 259. Thus the path of the first coil, according to the table is A-1-6-B which means that the coil begins at segment A of the commutator, rises to slot 1, and proceeds through the slot to the back of the drum; thence across the back to slot 6, through the slot and ending at segment B. The other coils are wound in similar order as indicated in the table.

Ques. How are the remaining coils wound on the drum?

Ans. Each of the succeeding coils are wound as indicated *in the table,* the last connection being made to segment A, the *one from* which the winding started.

Ques. What is the general form of the completed winding?

Ans. It may be considered simply as a wire wound spirally around the drum, with loops brought down to the commutator segments, and ending at the segment from which the start was made.

The completed winding as indicated by the table is shown in fig. 263. Here the path of each coil is easily distinguished by means of the varied insulations although in part hidden by the drum. Fig. 264 shows a developed view of the winding.

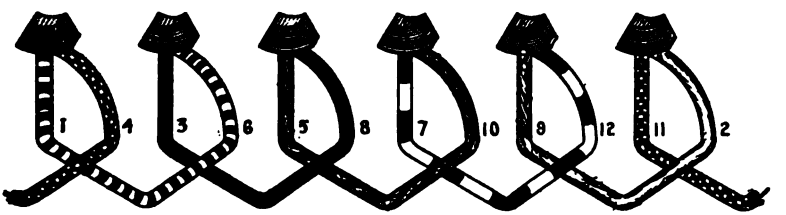


FIG. 264.—Developed view of the winding shown in perspective in fig. 263.

Ques. What condition must obtain in winding an even number of coils?

Ans. The wire must not be wound around the drum to diametrically opposite positions, as for instance 1 to 7 in fig. 265.

Ques. Why is this?

Ans. The reason will be clearly seen by attempting the winding on the wooden core. A winding of this kind on the drum fig. 258, would proceed as follows:

A—1—7—B
B—3—9—C
C—5—11—D

In order now to continue winding in a regular way, the wire from segment *d* should pass to the rear of the armature along space 7, but this space is already occupied by the return of the first coil. Continuing the winding from this point, it would be necessary to carry the wire from segment *d* to 6 or 8, *resulting in an unbalanced winding.*

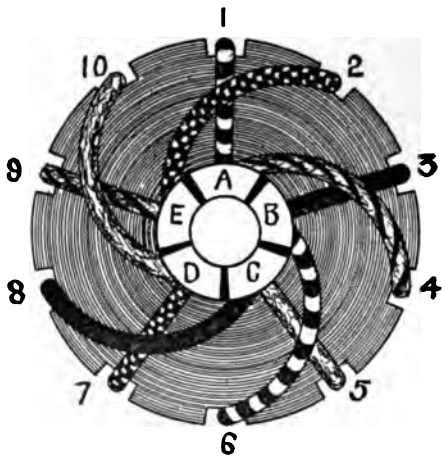


FIG. 265.—Lap winding for bipolar machine, with uneven number of coils; in this case the rear connectors may be made directly across a diameter as shown.

Ques. How is a symmetrical winding obtained having an even number of coils?

Ans. The inductors, in passing from the front to the rear of the armature, fig. 263, must occupy positions 1, 3, 5, 7, 9, 11, and the even numbered positions will then serve as the returns for these wires.

In the example here shown there are six coils, comprising twelve *inductors* and six commutator segments; it should be noted, however, *that if* there were an uneven number of coils, the rear connections

could be made directly across a diameter as shown in fig. 265, which would give a symmetrical winding.

With ten slots as shown in the figure, the drum would be wound, for a bipolar machine, according to the following table:

A — 1 — 6 — B
B — 3 — 8 — C
C — 5 — 10 — D
D — 7 — 2 — E
E — 9 — 4 — F

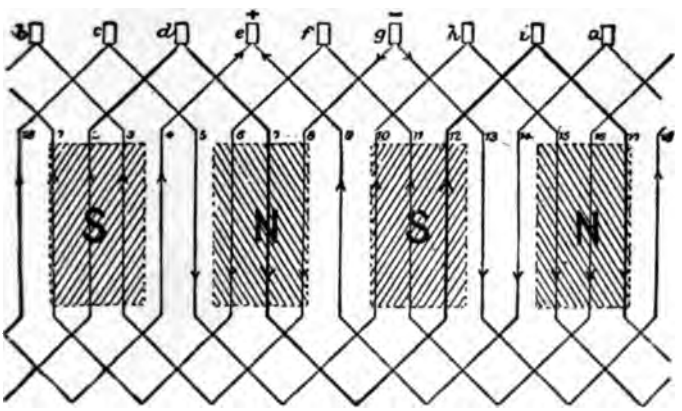


FIG. 266.—Developed view of a typical wave winding. This winding, instead of lapping back toward the commutator segment from whence it came, as in lap winding, turns the other way. For instance, *d*–7–12 does not return directly to *e*, but goes on to *i*, whence another element *i*–17–4–*e* continues in a sort of zigzag *wave*.

Ques. Are coils such as shown in figs. 263 and 265 used in practice?

Ans. No, for practical use each coil would consist of several turns, the diagram then merely indicates the end connections and slots for the several turns of each coil.

Series or Wave Drum Winding.—In this mode of winding, the *inductors are arranged* around the armature so that they do *not turn back, thus describing* a zigzag or wave-like path, that

is, the coil ends instead of connecting with adjacent of the commutator, are attached to segments more or les

Ques. Describe the circuits of a simple or simp winding.

Ans. Only two sets of brushes are required for such a but as many brushes as there are poles can be used.

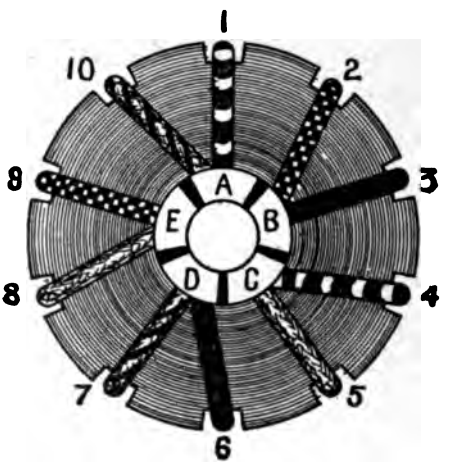


FIG. 267.—Five coil wave winding for a four pole machine. In this winding only are used, there being only two paths through the armature.

Ques. For what service are wave windings a

Ans. They are generally used on armatures des furnish a current of high voltage and low amperage.

An example of wave drum winding for a four pole machin in fig. 267. For simplicity, very few coils are taken, there five as shown in the illustration. To make the winding, one s be removed from the wooden core and the others spaced equ the cylindrical surface. This will give ten slots, the numb for the five coils. The winding is indicated in the following

A — 1 — 4 — C
B — 3 — 6 — D
C — 5 — 8 — E
D — 7 — 10 — A
E — 9 — 2 — B

Accordingly the first coil starting at segment A, is carried to the back of the drum through slot 1, thence across the back and returning through slot 4, ending at segment C the starting point of the second coil. Each coil is wound on in similar manner, the last coil ending at segment A, the starting point of the first coil. A developed view of the winding is shown in fig. 268.

Double Windings.—In the various drum windings thus ar considered, each coil had its individual slots, that is, no wo occupied the same two slots. This arrangement gave twice he number of slots as commutator segments.

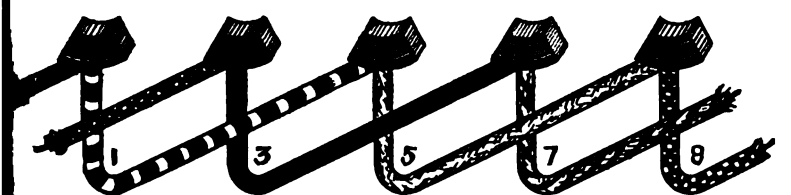


FIG. 268.—Developed view of the five coil wave winding shown in fig. 267.

In a double winding there are as many segments as slots, ch of the latter containing two inductors, comprising part of wo coils.

The Siemens Winding.—In winding drum armatures for ipolar dynamos of two horse power or less, and especially for very all machines as used in fan or sewing machine motors, a m of winding, known as the Siemens winding, which is shown fig. 271, is largely used. It consists in dividing the surface the armature core in one equal number of slots, say 16, and ing a 16 part commutator.

In the Siemens winding, the end of the wire used at the start is to be connected to the first commutator bar, but must be fastened to the armature core out of the way so as not to interfere with the winding of the coils.

If eight turns of wire be required to fill a slot with one layer, then the wire is carried from front to back and bent aside so as to clear the shaft; after passing across the back or pulley end of the armature, it is wound in the diametrically opposite section and brought to the front, then across the commutator end and up close to the beginning of the coil.

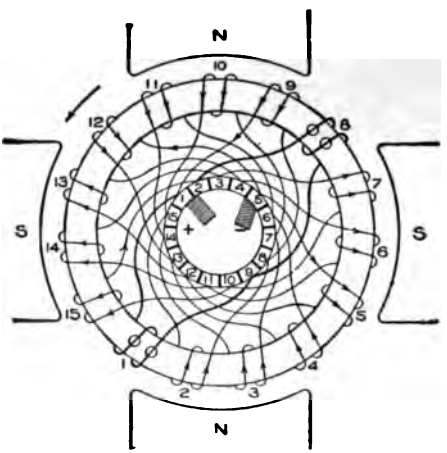


FIG. 269.—Series connected wave wound ring armature for a four pole machine. The coils are so connected that only two brushes are necessary.

Since eight turns are to be used, the process of winding is continued until the section is full and the end of the coil will lie in a position ready to begin the next section. Sometimes the wire is cut at this part of the coil leaving 3 or 4 inches projecting for connecting to the commutator bar 2, or next to the first bar where the winding was started.

The usual practice is, however, to make a loop of the wire of sufficient length to make the connection to the commutator and it has the advantage that since all of the coils on the armature are joined in series, the ending of one coil is joined to the beginning of the next which avoids *making* mistakes in making the commutator connections.


If the ends be cut they should be marked "beginning" and "end" to avoid *trouble*, because if they get mixed, it will be necessary to test each coil *with* a battery and compass needle in order to determine the polarity *produced* and find which is the beginning of the coil and which the end.

With 32 ends of the wire projecting from the end of the armature, it is confusing and mistakes are often made in the connections, so that one or more coils may oppose each other which would reduce the voltage.

After the surface of the armature is covered with one layer it will be noticed that the number of leads from the coils to the commutator bars is only one-half the number of bars and that they lie on one-half of the armature.

In order to complete the winding the first layer should be insulated and the second layer wound on. The beginning of the new coil will be directly over the first coil put on, but the beginning of the new coil will be diametrically opposite the beginning of the first coil wound.

The winding is now continued section by section and as each coil is finished a loop or pair of leads is left to connect to each bar. When the

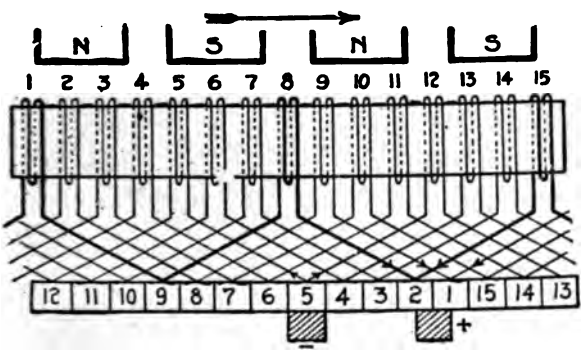

270.—Developed view of the series connected wave wound ring armature shown in fig. 269

last coil is wound, its end will be found lying next to the wire used in starting and should be joined to it and finally connected to bar number one where the start was made.

With the winding and commutator connected, all of the coils are in series and the beginning of the first coil joins the end of the last coil.

If a pair of brushes be now placed on the commutator at opposite points the current will flow into the bar and then divide between the two leads connected to it, half of the current flowing around one side and the other half flowing around the other half of the armature or in other words, the two halves of the armature are joined in parallel.

Ques. What is the objection to the Siemens winding as described?

Ans. *It produces an unsightly head where the wires pass*

around the shaft and requires considerable skill to make it appear workmanlike.

Ques. How may this be avoided?

Ans. By using the chord windings of Froehlich or Breguet, which are improvements over the Siemens in appearance and are more easily carried out.

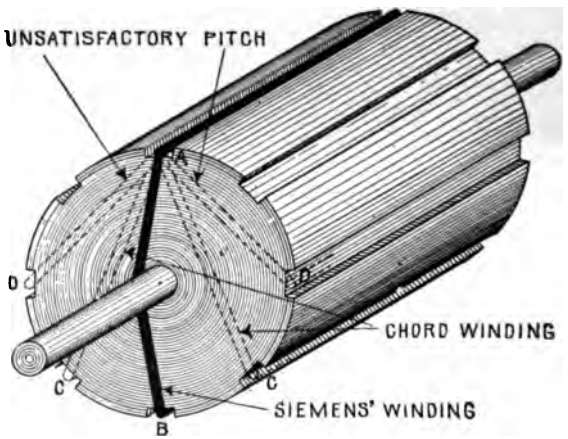


FIG. 271.—End view of an armature, showing the distinction between Siemens' winding and chord winding.

Chord Winding.—In cases where the front and back pitches are so taken that the average pitch differs considerably from the value obtained by dividing the number of inductors by the number of poles, the arrangement is called a chord winding.

In this method each coil is laid on the drum so as to cover an arc of the armature surface nearly equal to the angular pitch of the poles; it is sometimes called *short pitch winding*.

NOTE.—The term *back pitch* means the number of spaces between the two inductors of a coil. For instance, in fig. 267, the pitch is 3; that is, there are three spaces between any two inductors 1 and 4 which form part of the coil A—1—4—C. It is called the back pitch in distinction from the *front* or commutator pitch, which in this instance is 2.

Ques. What is the difference between the Siemens winding and the chord winding?

Ans. This is illustrated in fig. 271, which shows one end of an armature. In the Siemens winding, a wire starting, say at A, crosses the head and enters the slot marked B. If it enter slot C it is a chord winding.

Ques. Describe a chord winding.

Ans. The winding is started in the same manner as described in the Siemens method, only instead of crossing the head and returning in the section diametrically opposite, the section *A C*, fig. 271, next to it is used for the return of the wire to the front end. Leads for connecting to the commutator are left at the beginning and end of each section as before stated and the only difference between the two methods will be noticed when the first layer is nearly complete in that two sections lying next to each other have no wire in them. This will cause the winder to think he has made a mistake, but by continuing the winding and filling in these blank spaces in regular order when the two layers are completed, all the sections will be filled with an equal number of turns and there will be the required number of leads from the coils to connect up to the commutator bars.

Ques. How many paths in the chord winding just described?

Ans. Two.

Multiplex Windings.—An armature may be wound with two or more independent sets of coils. Instead of independent commutators for the several windings, they are combined into one having two or more sets of segments interplaced around the circumference. Thus, in the case of two windings, the brush comes in contact alternately with segments of each set

The brush then must be large enough to overlap at le segments, so as to collect current from both windings taneously. Both windings then are always in the ci parallel.

Ques. What is the effect of a multiplex windi

Ans. It reduces the tendency to sparking, becau half of the current is commutated at a time, and also adjacent commutator bars belong to different windings

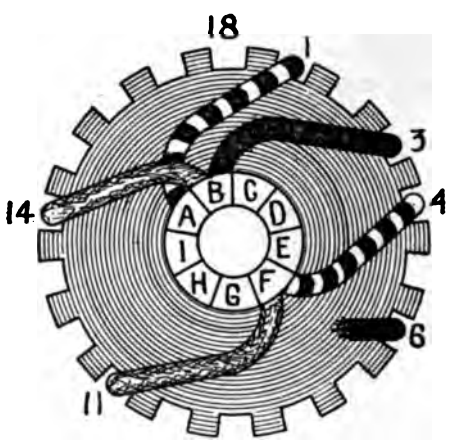


FIG. 272.—A progressive wave winding. *If the front and back pitches of a wave win that in tracing the course of the winding through as many coils as there are pair segment is reached in advance of the one from which the start was made, the windi be progressive.* The figure shows three coils of a winding having 18 inductors. definition, the number of coils to consider to determine if the winding be pr equal to the number of poles divided by 2, which in this case is equal to 2. are shown in the figure as follows: A–1–4–F and F–11–14–B. The second segment B which is in *advance* of segment A from which the winding began that the winding is progressive. Fig. 272 is given simply to illustrate the defi progressive winding, and not to represent a practical winding.

Ques. Does an accident to one winding disal *machine?*

Ans. No, it simply reduces its current capacity.

Ques. Can multiplex windings have more than two windings?

Ans. Yes, there may be three or four windings.

Ques. What is the objection to increasing the number of windings?

Ans. It involves an increased number of inductors and

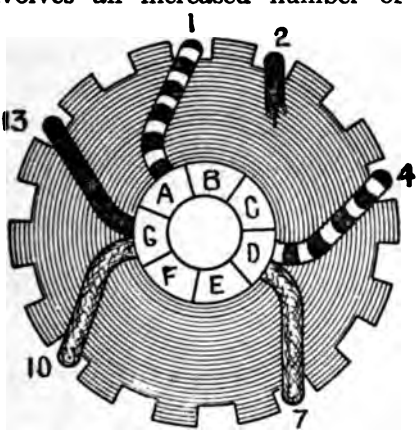


Fig. 273.—A retrogressive wave winding. *If the pitches be such that in tracing the winding through as many coils as there are pairs of poles, the first segment of the commutator is not encountered or passed over, the winding is said to be retrogressive.* The number of coils to consider is two, as follows: A-1-4-D and D-7-10-G. The second coil ends at G, hence, since the segment A where the start was made has not been reached or passed over the winding is retrogressive. Fig. 273 is given simply to illustrate the definition of retrogressive winding, and not to represent a practical winding.

commutator segments, which is undesirable in small machines, but for large ones might be allowable.

When there are two independent windings the arrangement is called *duplex*, with three windings, *triplex*, and with four, *quadruplex*.

Ques. What loss is reduced with multiplex windings?

Ans. In these windings, the division of what otherwise would be very stout *inductors* into several smaller ones, has the *effect of reducing eddy current* loss.

Ques. For what service are machines with multiplex windings specially adapted?

Ans. Multiplex windings are used in machines intended to supply large currents at low voltages, such as is required in electrolytic work.

Number of Brushes Required.—The number of places on the commutator at which it is necessary or advisable to place a set of collecting brushes can be ascertained from the winding diagrams. All that is necessary is to draw arrows marking the directions of the induced electromotive forces. Wherever two arrow heads meet at any segment of the commutator, a positive brush is to be placed, and at every point from which two arrows start in opposed directions along the winding, a negative brush should be placed.

Ques. How many brushes are required for lap windings and ordinary parallel ring windings?

Ans. There will be as many brushes as poles, and they will be situated symmetrically around the commutator in regular order and at angular distances apart equal to the pole pitch.

It should be noted that the number of brush sets does not necessarily show the number of circuits through the armature.

Ques. How many brushes are required for wave windings?


Ans. If arrows be drawn marking the direction of the induced *electromotive* forces to determine the number of brushes, it will *be found* that only two brushes are required for any number *of poles.*

Ques. What is the angle between these two brushes?

Ans. It is the same as the angle between any north and south pole.

For instance, in a ten pole machine with wave winding the pitch between the brushes may be any of the following angles:

$$360 \div 10 = 36°$$
$$3 \times 36° = 108°$$
$$5 \times 36° = 180°$$

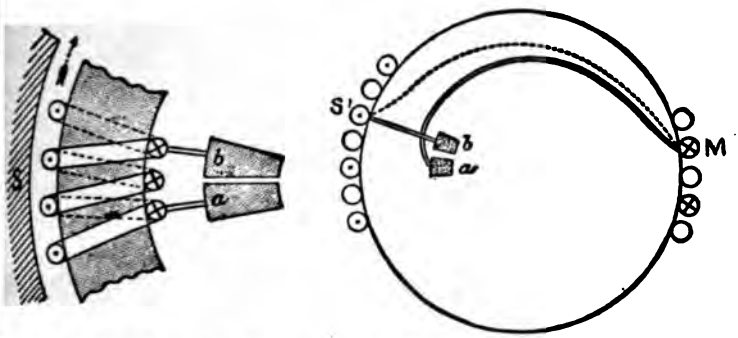

FIGS. 274 and 275.—Right and left hand windings. These consist respectively of turns which pass around the core in a right or left handed fashion. Thus in fig. 274, in passing around the circle clockwise from *a* to *b*, the path of the winding is a right handed spiral. In fig. 275, which shows one coil of a drum armature, if *a* be taken as the starting point, in going to *b*, *a* must be connected by a spiral connector across the front end of the drum to one of the descending inductors such as M, from which at the back end another connector must join it to one of the ascending inductors, such as S, where it is led to *b*, thus making one right handed turn.

Sometimes with lap winding it is desirable to reduce the number of brushes. In fig. 276, is shown the distribution of currents in a four pole lap wound machine having four brushes and generating 120 amperes. In each of the four circuits the flow is 30 amperes, and the current delivered to each brush is 60 amperes. If now two of the brushes be removed, the current through *each of the remaining* two will be 120 amperes, while

Equalizer Rings.—These are rings resembling a seri hoops provided in a parallel wound armature to eliminat effects of "unbalancing," by which the current divides unec among the several paths through the armature. By mea leads, equalizer rings connect points of equal potential i winding and so preserve an equalization of current.



FIG. 278.—Rear view of armature of a large dynamo built by the General Electric Co ing equalizer rings.

Ques. In multipolar machines what points are nected by equalizer rings?

Ans. Any two or more points in the winding, that d *the rotation*, are at nearly equal potentials.

If there were perfect symmetry in the field system, no currents would flow along such connectors; however, owing to imperfect symmetry, the induction in the various sections of the winding may be unequal and the currents not equally distributed.

Drum Winding Requirements.—There are several conditions that must be satisfied by a closed coil drum winding:

1. There cannot be an odd number of inductors;

An odd number of inductors would be equivalent to not having a whole number of coils. The even numbered inductors may be regarded as the returns for the odd numbered inductors.

2. Both the front and back pitches must be odd in simplex windings.

3. The average pitch should be approximately equal to the number of inductors divided by the number of poles.

This condition must obtain in order that the electric pressures induced in inductors moving simultaneously under poles of opposite sign, will be added. The smallest pitch meeting this condition would stretch completely across a pole face, while the largest would stretch from the given pole tip to the next pole tip of like polarity.

he choice of front and back pitch for a given number of inductors should, with lap and wave windings in general, comply with the following conditions:

All the coils composing the winding must be similar, both mechanically and electrically, and must be arranged symmetrically upon the armature.

Each inductor of a simplex winding must be encountered once only, and the winding must be re-entrant.

. Each simplex winding composing a multiplex winding must fulfill the requirement for a simplex winding.

. A singly re-entrant multiplex winding must as a whole *satisfy the requirement* for a simplex winding

In addition to the above requirements for lap and wave windings in general, lap windings must comply with the following conditions:

1. The front and back pitches must be opposite in sign;
2. The front and back pitches must be unequal;

 If they be equal, the coil would be short circuited upon itself.

3. The front and back pitches must differ by two;
4. In multiplex windings, the front and back pitches must differ by two multiplied by the number of independent simplex windings composing the multiplex winding;
5. The number of slots on a slotted armature may be even or odd;
6. The number of inductors must be an even number; it must be a multiple of the number of slots;

In the case of wave windings the several conditions to be fulfilled may be stated as follows:

1. The front and back pitches must be alike in sign;
2. The front and back pitches may be equal or they must differ by any multiple of two.

 They are usually made nearly equal to the number of inductors divided by the number of poles.

CHAPTER XIX

THEORY OF THE ARMATURE

Current Distribution in Ring and Drum Armatures.—studying the actions and reactions which take place in the nature, the student should be able to determine the direcns of the induced currents. The basic principles of electrognetic induction were given in chapter X, from which, for tance, the distribution of current in the gramme ring nature, shown in fig. 279, is easily determined by the applica- n of Fleming's rule.

Tracing the current from the negative to the positive brush, it will be seen that it divides, half going through coils 1, 2, 3, and half through coils I, II, III, these two currents ascend to the top of the ring, uniting at the positive brush.

Ques. In the Gramme ring armature (fig. 279) what the distribution of armature currents?

Ans. There are two paths in parallel as indicated in fig. 279.

Ques. How does the voltage vary in the coils?

Ans. It varies according to the position of the coils, being ist when vertical and greatest when horizontal in a two pole achine arranged as in fig. 279.

The upper and lower coils in the right hand half of the ring armature, fig. 279, will have about the same electromotive force induced in them, say 2 volts each, *while the two coils* between them will have a higher electro- *motive force, at the same instant,* say 4 volts each, since they occupy

nearly the positions of the maximum rate of change of the magi lines threading through them. These eight coils may be represe by two batteries connected in parallel, each battery consisting of t volts cells and two 4 volt cells as shown in fig. 280. The voltage of battery then will be

$$+4+4+2=12 \text{ volts}$$

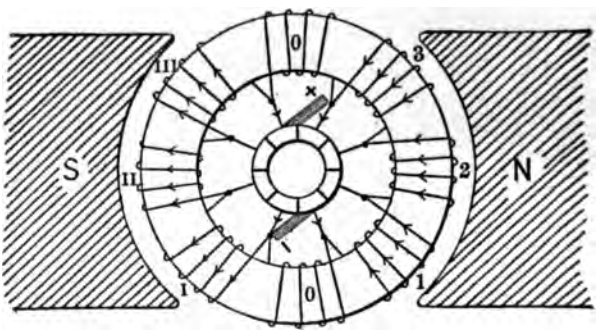


FIG. 279.—Current distribution in a gramme ring armature. There are two paths fo current between the brushes, half going up each side of the ring as indicated by the ar thus giving two paths in parallel as indicated in fig. 281.

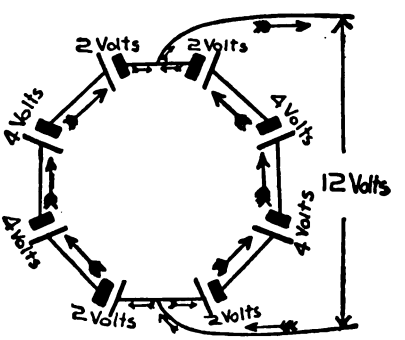


FIG. 280.- -Battery analogy illustrating current distribution in a ring armature. The ei *coils of the armature*, fig. 279, are represented by two batteries of four cells each. *action of the two units thus connected is indicated by the arrows. In the external ci the voltage is equal to that of one battery and the current is equal to the sum of th rents in each battery.*

The two batteries being connected in parallel, the voltage at the terminals will be the same, but the current will be the sum of the currents in each battery.

Ques. How may the number of paths in parallel be increased?

Ans. By increasing the number of poles.

For instance, in a four pole machine, as in fig. 283, there are four paths in parallel. In this case the armature may be used to furnish two separate currents, though this is not desirable.

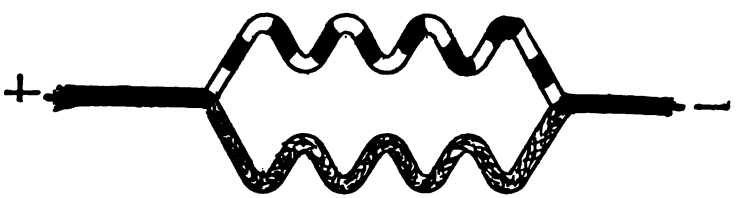


FIG. 281.—Diagram showing distribution of current in the gramme ring armature of fig. 279. The current flows in two parallel paths as indicated.

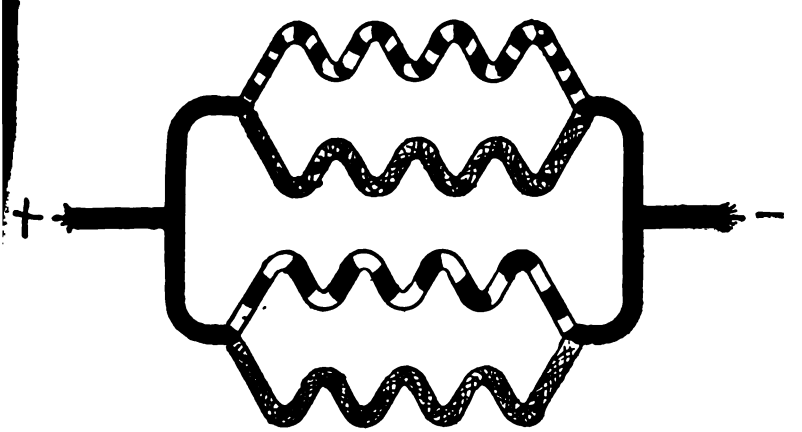


FIG. 282.—*Diagram showing current distribution through armature of a four pole machine with like brushes connected.* There are four paths in parallel, hence the induced voltage *will equal that of one set of coils,* and the current will be four times that flowing in one *set of coils.*

Ques. How are the brushes connected?

Ans. Usually all the positive brushes are connected together, and all the negative brushes as in fig. 283, giving four paths in parallel through the armature as indicated in fig. 282.

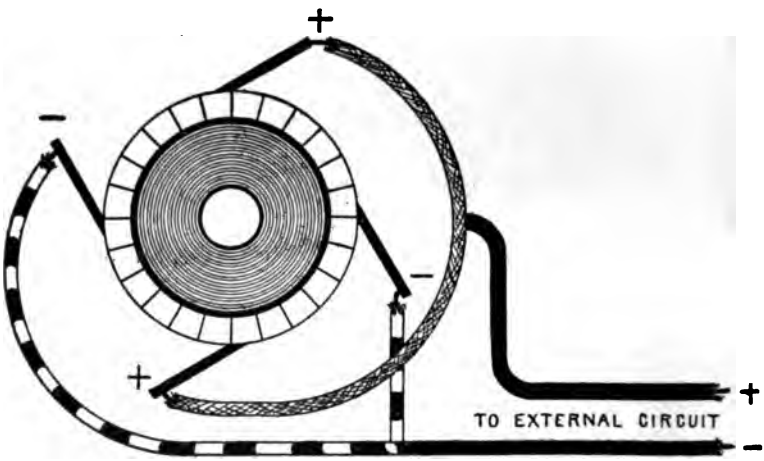


FIG. 283.—Brush connections for four pole dynamo. It is usual to connect all the positive brushes to one terminal and all the negative brushes to the other which gives four parallel paths as shown in the diagram, fig. 282. In a four pole machine, two separate currents can be obtained by omitting the parallel brush connections.

Ques. How does this method of brush connection affect the voltage?

Ans. The voltage at the terminals is equal to that of any of the sets of coils between one positive brush and the adjacent negative brush.

Thus in the four pole machine, fig. 283, the coils of the four quadrants are in four parallels, which gives an internal resistance equal to one-*sixteenth* that of the total resistance of the entire ring.

When the coils are connected in two circuits or series parallel, it *requires* only two brushes at two neutral points on the commutator, *for any* number of poles; this arrangement is shown in fig. 289.

Ques. In general what may be said about the current paths through an armature?

Ans. The paths may be in parallel or series parallel according as the winding is of the lap or wave type.

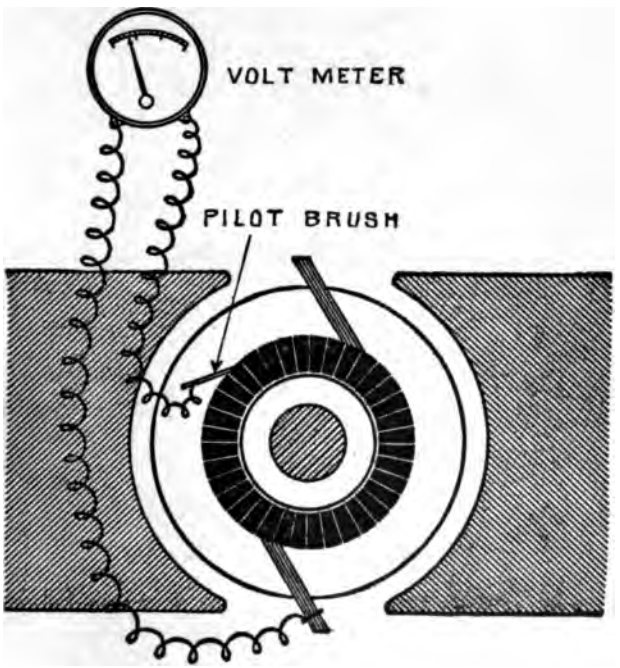


FIG. 284.—Morday's method of measuring the variation of voltage around the commutator by use of a single exploring brush and volt meter. It consists in connecting one terminal of the volt meter (preferably an electrostatic one) to one brush of the machine, and the other terminal to the exploring brush, which can be moved from point to point, readings being taken at each point.

Variation of Voltage Around the Commutator.—There are numerous ways of determining the value of the induced voltage in an armature at various points around the

commutator. In the method suggested by Morday, i measured by the use of a single exploring brush an meter as shown in fig. 284.

In this method, one terminal of the volt meter is connec of the brushes of the dynamo, and the other terminal is joinec to a small pilot brush which can be pressed against the c at any desired part of its circumference. With the machii at its rated speed, the exploring brush is placed in successiv between the two brushes of the machine. In each position of the volt meter is taken and the angular position of the brush noted.

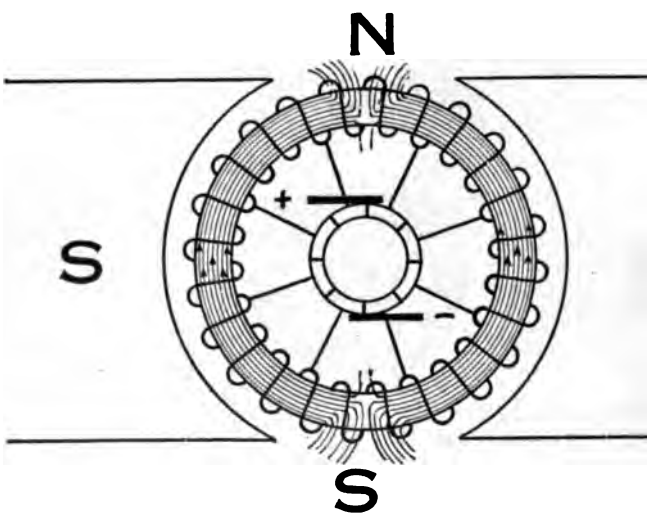


FIG. 285.—Cross magnetization. This is defined as lines of magnetic force set up in of a dynamo armature which oppose at right angles the lines of force created poles of the field magnet. The figure shows this cross flux which is due to t current alone.

Ques. How does the voltage vary between su *pairs of* commutator segments?

Ans. The variation is not constant.

Cross Magnetization; Field Distortion.—In the operation of a dynamo with load, the induced current flowing in the armature winding, converts the armature into an electromagnet setting up a field across or at right angles to the field of the machine. This cross magnetization of the armature tends to distort the field produced by the field magnets, the effect being known as *armature reaction*. To understand the nature of this reaction it is best to first consider the effect of the field current and the armature current separately.

Fig. 285 represents the magnetic flux through an armature at rest, where the field magnets are separately excited. If the armature be rotated clockwise, induced currents will flow outward through the two halves of the winding between the brushes, making the lower brush negative and the upper brush positive.

Ques. If, in fig. 285, the current in the field magnet is shut off, and a current be passed through the armature entering at the lower brush, what is the effect?

Ans. The current will divide at the lower brush, flowing up each side to the top brush. These currents tend to produce north and south poles on each half of the core at the points where the current enters and leaves the armature. Hence, there will be two north poles at the top of the ring and two south poles at the bottom.

Ques. What effect is produced by the like poles at the top and bottom of the ring?

Ans. The external effect will be the same as though there were a single north and south pole situated respectively at the top and *bottom of the ring.*

Ques. In the operation of a dynamo, how do the poles induced in the armature affect the magnetic field of the machine?

Ans. They distort the lines of force into an oblique direction as shown exaggerated in the diagram fig. 286.

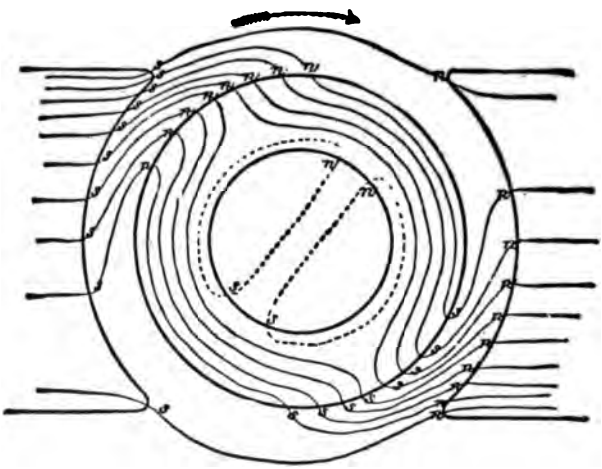


FIG. 286.—Distortion of magnetic field due to cross magnetization. For clearness, the effect is shown somewhat exaggerated. A drag or resistance to the movement of the armature is caused by the attraction of the north and south poles on the armature and pole pieces respectively.

Ques. What effect has the presence of poles in the armature on the operation of the machine?

Ans. In fig. 286, the resultant north pole *n*, *n*, *n*, where the lines emerge from the ring, attracts the south pole, *s*, *s*, *s*, where the lines enter the field magnet, hence a load is brought upon the engine, which drives the dynamo, in dragging the armature *around against* these attractions. The stronger the current *induced in the* armature, the greater will be the power necessary *to turn it.*

Ques. Why does this reaction in the armature require more power to drive the machine?

Ans. The effect produced by the armature reaction is in accordance with Lenz's law which states that: *In electromagnetic induction, the direction of the induced current is such as to oppose the motion producing it.*



FIG. 287.—Actual distortion of field resulting from cross magnetization, as shown by iron filings.

Remedies for Field Distortion.—Since the distortion of the magnetic field of a dynamo causes unsatisfactory operation, numerous attempts have been made to overcome this defect, as for instance, by:

1. Experimenting with different forms of pole piece;

The reluctance of the pole piece should be increased in the region where the *magnetic flux* tends to become most dense. The trailing *horn of the pole piece may* be made longer than the advancing horn *and cut farther from* the surface of the armature, so as to equalize the *distribution of the* magnetic flux.

2. Lengthening the air gap;

This increases the reluctance, and also necessitates more amp turns in the field winding. The field distortion, however, will be so great, as it would be if the magnetic field of the machine we weaker.

3. Slotting the pole pieces;

Both longitudinal gaps and oblique slots have been tried. T reduction of cross section of the pole piece causes it to beco highly saturated and to offer large reluctance to the cross field.

4. The use of auxiliary poles.

These are small poles placed between the main poles and so wou and connected that their action opposes that of the cross field.

Normal Neutral Plane.—This may be defined as *a pla passing through the axis of the armature perpendicular to t magnetic field of the machine when there is no flow of current the armature*, as shown in fig. 288. It is the plane in which t brushes would be placed to prevent sparking when the machi is in operation were the field not distorted by armature reactio and there were no self-induction in the coils.

Commutating Plane; Lead of the Brushes.—It has be found that in order to reduce sparking to a minimum, t brushes must be placed in certain positions found by trial an designated as being located in the *neutral plane.*

When the brushes are in the neutral plane, they are in conta with commutator segments connecting with coils that a cutting the lines of force at the minimum rate.

Ques. Define the term "commutating plane."

Ans. This is a plane passing through the axis of the armatu *and through* the center of contact of the brushes as sho *in figs.* 289 and 300.

Ques. What is the angle of lead?

Ans. The angle between the normal neutral plane and the commutating plane.

In the operation of a dynamo since the field, on account of armature reaction, is twisted around in the direction of rotation, the proper position for the brushes is no longer in the normal neutral plane, but lies

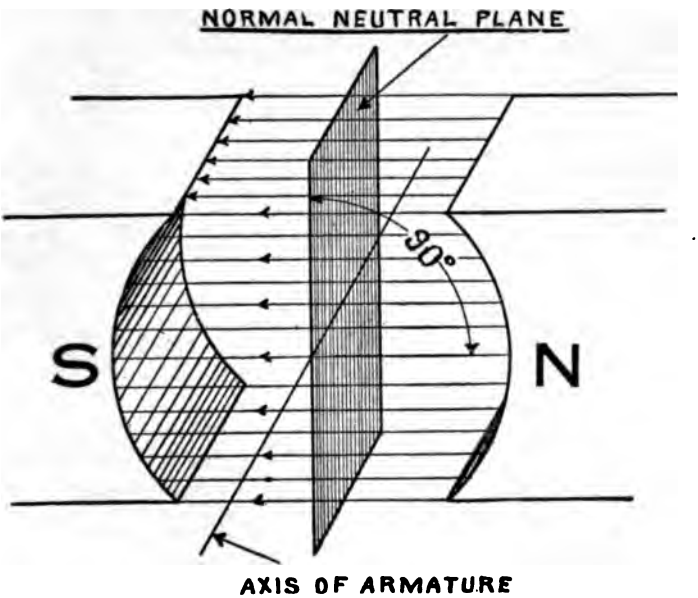


Fig. 288.—Normal neutral plane. This is a reference plane from which the lead is measured. As shown, the normal neutral plane lies at right angles to the lines of force of an undistorted field.

obliquely across, a few degrees in advance. Hence, for sparkless commutation, the commutating plane is a little in advance of the normal neutral plane, *the lead being* measured by the angle between these *planes, as stated in the definition.*

Ques. What may be said with respect to the a of lead?

Ans. *For sparkless commuta ion, the angle of lead varies the load.*

If the field be much altered at full load, it is evident that at h quarter load it will not be nearly so much twisted, hence the nec for mounting the brushes on some kind of rocking device whic

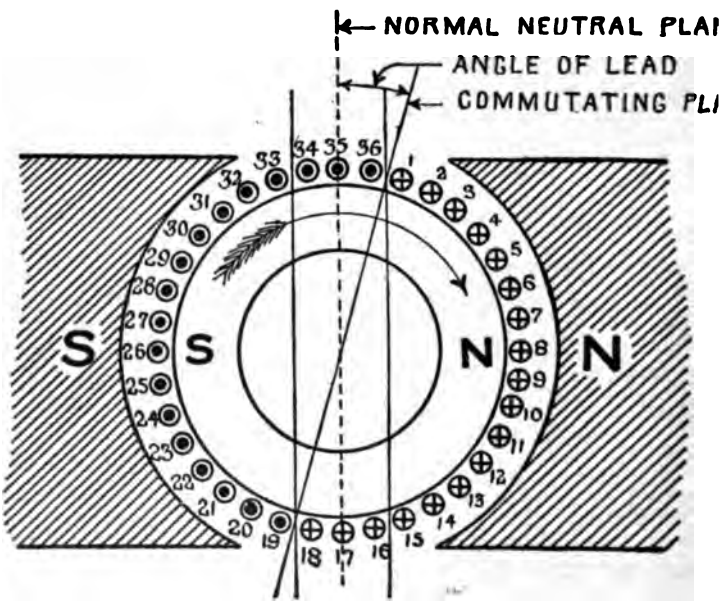


FIG. 289.—Diagram illustrating the demagnetizing effect of armature reaction. This from the forward lead given the brushes in order to secure sparkless commutation.

allow them to be shifted in different positions for different loads. sirable point, then, in dynamo design is to make the angle of le full load so small that it will not be necessary to shift the br much for variation of load. This can be accomplished by makin field magnet field considerably more powerful than the armature f

Demagnetizing Effect of Armature Reaction.—In the operation of a dynamo, as previously explained, the position of the brushes for sparkless commutation must be varied with the load; that is, for light load they should occupy a position practically midway between the poles and for a heavy load they must be moved a few degrees in the direction of rotation. In other words, the commutating plane must be more or less in advance of the normal neutral plane as shown in fig. 289.

Ques. What is the effect of lead?

Ans. It produces a demagnetizing effect which tends to weaken the field magnets.

Ques. Describe this demagnetizing effect in detail.

Ans. Tracing the armature currents, in fig. 289 according to Fleming's rule, it will be seen that current in inductors 1 to 18 flow *from* the observer indicated by crosses representing the tails of retreating arrows and in inductors 19 to 36, *toward* the observer from the back of armature, indicated by dots representing the points of approaching arrows. In determining these current directions the inductors to the right of the neutral line are considered as moving downward, and those to the left as moving upward. The current in inductors 1 to 15 and 19 to 33, tends to cross magnetize the magnetic field of the machine, but the current in inductors 34 to 36 and 16 to 18 tends to produce north and south poles as indicated. These poles are in opposition to the field poles and tend to demagnetize them. Hence, the inductors lying outside the two upright lines are known as *magnetizing turns, and* those lying inside, as demagnetizing

The breadth of the belt of demagnetizing turns included b the two upright lines is clearly proportional to the angle of lead; fore, the demagnetizing effect increases with the lead.

Eddy Currents; Lamination.—Induced electric cur known as eddy currents, occur when a solid metallic m rotated in a magnetic field. They consume considerable e

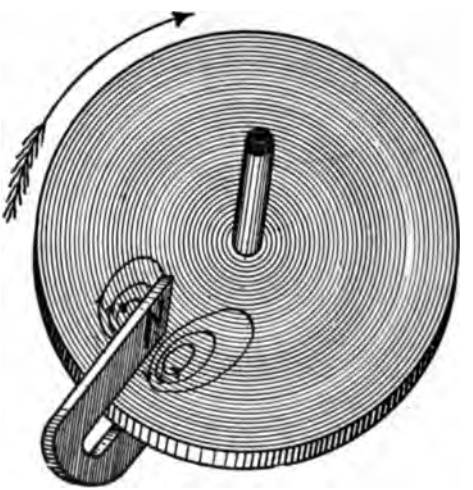


FIG. 290.—Arago's experiment illustrating eddy currents. Arago found that if a cop be rotated in its own plane underneath a compass needle, the needle was dragged as by some invisible friction. The explanation of this phenomenon, known as *rotations*, is due to Faraday, who discovered that it was caused by induction. a magnet moved near a solid mass of metal, induces in it currents, which, in flowing f point to another, have their energy converted into heat, and which, while they last, (in accordance with Lenz's law) electromotive forces tending to stop the motion. in the figure, there are a pair of eddies in the part passing between the poles, ar currents oppose the motion of the disc. Foucault showed by experiment the effect of eddy currents, but such currents were known years before Foucault's expe hence they are incorrectly called Foucault currents.

and often occasion harmful rise in temperature. Arm *cores, pole* pieces, and field magnet cores are specially su *to these* currents.

Ques. Describe the formation of eddy currents.

Ans. In fig. 291, a bar inductor is seen just passing from under the tip of the pole piece N of the field magnet. Noting the distribution of the lines of force, it will be seen that the edge *c d* is in a weaker field than the edge *a b*, hence, since the two edges move with the same velocity, the electromotive force

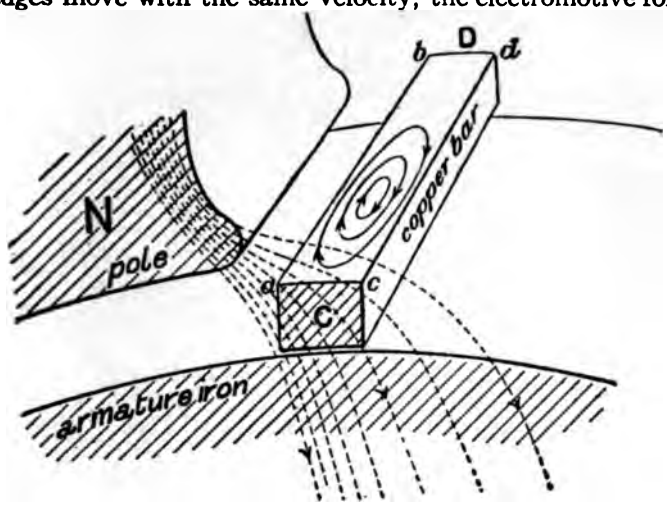


Fig. 291.—Formation of eddy currents in a solid bar inductor. On account of its appreciable size, the field is sometimes weaker at one point than another, hence the unequal electromotive forces thus produced will induce eddy currents.

induced along *c d* will be less than that induced along *a b*. This gives rise to whirls or current eddies in the copper bar as shown.

Ques. What should be noted in seeking a remedy for eddy currents?

Ans. It should be noted that eddy currents are due to very small differences of pressure and that the currents are large only *because of the very low* resistance of their circuits.

Ques. What is the best means of reducing eddy currents?

Ans. Lamination.

Ques. Explain this mode of construction with respect to the bar inductor fig. 291.

Ans. In the case of a large bar inductor such as shown in fig. 291, it could be replaced by a number of small wires soldered

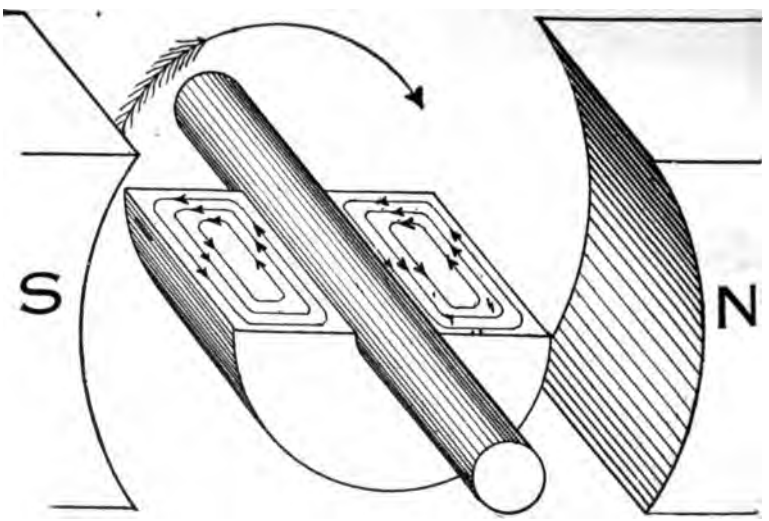


FIG. 292.- Eddy currents induced in a solid armature core. Eddy currents always occur when a solid metallic mass is rotated in a magnetic field, because the outer portion of the metal cuts more lines of force than the inner portion, hence the induced electromotive force not being uniform, tends to set up currents between the points of greatest and least potential. Eddy currents consume a considerable amount of energy and often occasion harmful rise in temperature.

together only at the ends. The layer of dirt or oxide on the *outside* of the wires will furnish sufficient resistance to practically *prevent* the eddy currents passing from wire to wire.

Ques. How should an armature core be laminated to avoid eddy currents?

Ans. It should be laminated at right angles to its axis.

Fig. 292 shows the induced eddy currents in a solid armature core, and fig. 293 shows the manner in which the paths of these currents are interrupted and the losses due to their effect diminished by the use of laminated cores.

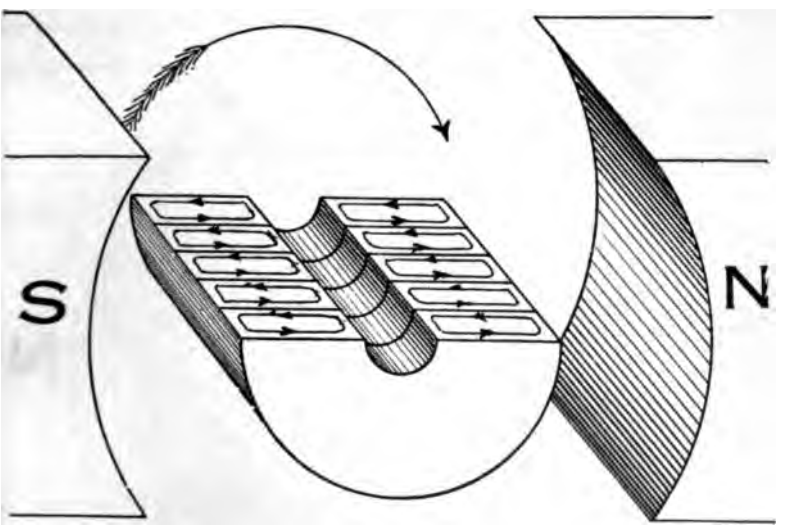


FIG. 293.—Armature core with a few laminations showing effect on eddy currents. In practice the core is made up of a great number of thin sheet metal discs, about 18 gauge, which introduces so much resistance between the discs that the formation of eddy currents is almost entirely prevented.

In fig. 293, only five laminations or plates are indicated, so as to show the sub-division of the eddy currents, but in practical armatures, the number of laminations or punchings ranges from 40 to 66 to an inch, and brings the eddy current loss down to about one per cent. A greater increase in the number of laminations per inch is not economical, however, owing to the difficulties encountered in the punching and handling of extremely thin sheets of iron, and the loss of space between the plates.

Armature cores constructed of the number of plates stated, and forced together by means of screws and heavy hydraulic pressure, contain from 80 to 90 per cent. of iron, and have a magnetic flux carrying capacity only from 5 to 15 per cent. less than when they are made of an equal volume of solid iron.

Magnetic Drag on the Armature.—Whenever a current is induced in an armature coil by moving it in the magnetic field so as to cut lines of force, the direction of the induced current is such as to oppose the motion producing it. Hence, in the


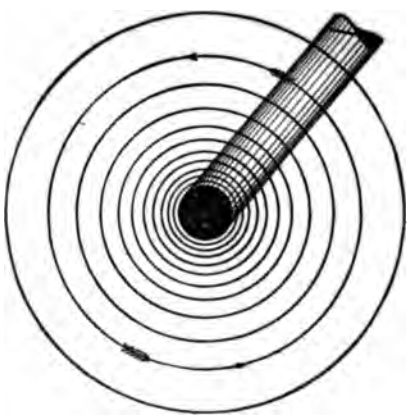


FIG. 294.—Circular concentric magnetic field surrounding a conductor carrying a current. If this conductor be moved across a magnetic field, as between the poles of a magnet, the lines of force will be distorted as in fig. 295, which will oppose the motion of the conductor.

operation of a dynamo, considerable driving power is required to overcome this magnetic drag on the armature.

A conductor carrying a current is surrounded by a circular concentric magnetic field. If now such a conductor, with *current flowing* toward the observer as in fig. 294, be placed *in a uniform* magnetic field, a distortion of the magnetic lines *will occur* as shown in fig. 295. The resulting mechanical

ons are easily determined by remembering that *the magnetic act like elastic cords tending to shorten themselves.* There is ct a tension along the magnetic lines and a pressure at right es to both, proportional at every point to the square of density.

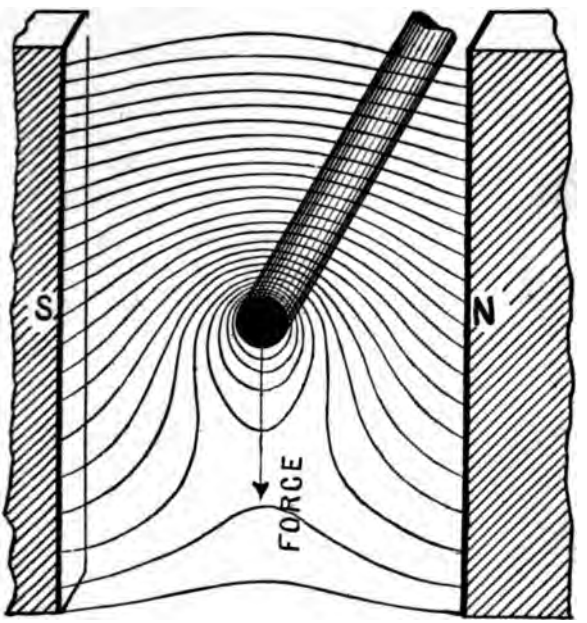

6.—Illustrating drag on armature inductors. In moving a wire carrying a current ough a magnetic field, the lines of force are distorted, and the effect on the wire is the ne as though the magnetic lines were elastic cords tending to shorten themselves. They, refore, oppose the motion of the wire; hence, in dynamo operation, more or less power absorbed in overcoming this drag on the numerous inductors. In the figure the indue- is being moved upward against the "drag" due to the magnetic field.

is evident by inspection of the lines in fig. 295, that there *rag upon the conductor* in the direction shown by the

Smooth and Slotted Armatures.—The inductors of an armature may be placed on a smooth drum or in slots cut in the surface parallel to the axis.

In the first instance, the magnetic drag comes on the inductors, and in the case of slots, upon the teeth.

The effect of embedding the armature inductors in slots is to distort the magnetic field as shown in fig. 296. Most of the lines of force pass through the teeth, thus, not only are the inductors better placed for driving purposes, but, being screened magnetically by the teeth, the forces acting on them are reduced, the greater part of the magnetic drag being taken up by the core.

It should be noted that, although screened from the field, the inductors in a slotted armature cut magnetic lines precisely as if they were not protected. The effect is as though the magnetic lines flashed across the slots from tooth to tooth, instead of passing across the intermediate slot at the ordinary angular velocity.

Comparison of Smooth and Slotted Armatures.—The slotted armature has the following advantages over the smooth type:

1. Reduced reluctance of the air gap;
2. Better protection for the winding;
3. Inductors held firmly in place preventing slippage;
4. No magnetic drag on inductors;
5. No eddy currents in inductors;
6. Better ventilation;
7. Opposition to armature reaction.

Due to increased density of flux through the teeth.


The disadvantages of slotted armatures may be stated as follows:

1. Tendency of the teeth to induce eddy currents in the pole pieces;
2. Increased self-induction of the armature coils;

Greater hysteresis loss on account of denser flux in the teeth;

Leakage of lines of force through the core, especially in the case of partially enclosed slots.

gnetic Hysteresis in Armature Cores.—When the ion or density of magnetic flux in a mass of iron is rapidly ed a considerable expenditure of energy is required which

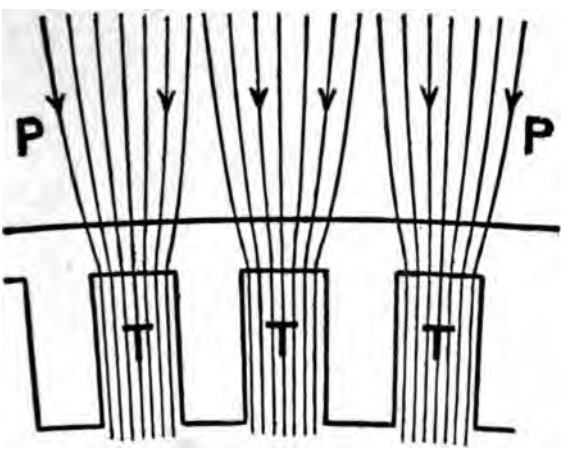

—Effect of slotted armature. The teeth, as they sweep past the pole face, cause ations of the magnetic flux in the iron near the surface because the lines in the pole PP tend to crowd toward the nearest teeth, and will be less dense opposite the This fluctuation of the magnetic lines produce eddy currents in the pole faces s laminated. The armature inductors, being screened from the field, are relieved e drag which is taken by the teeth.

ıot appear as useful work. For instance, when an arma- ɒtates in a bipolar field, the armature core is subjected to pposite magnetic *inductions* in each revolution; that is, at *ıe instant a north pole is* induced in the core opposite the *ole of the magnet.* and a south pole in the core opposite

the north pole of the magnet as indicated in fig. 297 by *n* and *s*. Accordingly, if the armature rotate at a speed of 1,000 revolutions per minute, the polarity of the armature will be changed 2,000 times per minute, and result in the generation of heat at the expense of a portion of the energy required to drive the armature. This loss of energy is due to the work required to change the position of the molecules of the iron, and takes place both in the process of magnetizing and demagnetizing; the magnetism in each case lagging behind the force.

Core Loss or Iron Loss.—These terms are often employed to designate the total internal loss of a dynamo due to the combined effect of eddy currents and hysteresis, but as the losses due to the former are governed by laws totally different from those applicable to the latter, special analysis is required to separate them.

The eddy current loss per pound of iron in the armature core diminishes with the thinness of the laminated sheets, and may be made indefinitely small by the use of indefinitely thin iron plates, were it not for certain mechanical and economical reasons.

The loss due to hysteresis per pound of iron in the core, does not vary with the thinness of the core plates; it can be reduced only by the use of a material having a low hysteretic coefficient.

Dead Turns.—The voltage generated in a dynamo with a given degree of field excitation is not strictly proportional to the speed, but somewhat below on account of the various reactions. That is, the machine acts as though some of its revolutions were not effective in inducting electromotive force.

The name *dead turns* is given to the number of revolutions by which the actual speed exceeds the theoretical speed for any output.

Again, this term is sometimes used to denote that portion of the wire on an armature which comes outside the magnetic field and is therefore rendered ineffective in inducing electromotive force. The number of dead turns is about 20% of the total number of turns.

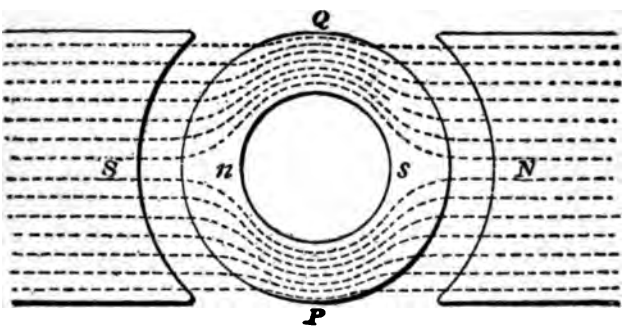


FIG. 297.—Magnetic hysteresis in armature core. Unlike poles are induced in the core opposite the poles of the field magnet. Since on account of the rotation of the core the induced poles are reversed a thousand or more times a minute, considerable energy is required to change the positions of the molecules of the iron for each reversal, resulting in the generation of heat at the expense of a portion of the energy required to drive the armature.

Self-Induction in the Coils; Spurious Resistance.—Self-induction opposes a rapid rise or fall of an electric current in just the same way that the inertia of matter prevents any instantaneous change in its motion. This effect is produced by the action of the current upon itself during variations in its strength.

In the case of a simple straight wire, the phenomenon is almost imperceptible, but if the wire be in the form of a coil, the adjacent turns act inductively upon each other upon the *principle of the mutual induction* arising between two separate *adjacent circuits*.

Ques. What effect has self-induction on the operation of a dynamo?

Ans. It prevents the instantaneous reversal of the current in the armature coils. That is, the current tends to go on, and in fact does actually continue for a brief time after the brush has been reached.

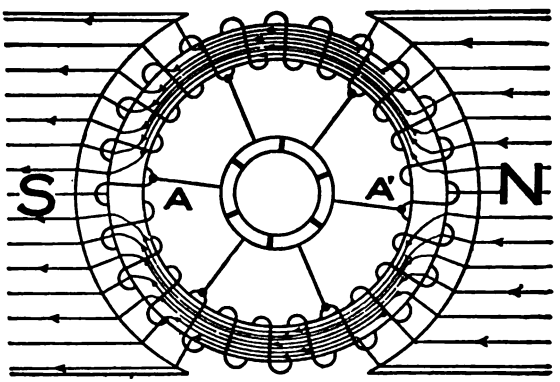


FIG. 298.—Distribution of magnetic lines through a ring armature. Since the lines follow the metal of the ring instead of penetrating the interior, no electromotive force is induced in that portion of the winding lying on the interior surface of the ring. There is, therefore, a large amount of dead wire or wire that is ineffective in inducing electromotive force; this is the chief objection to the ring type of armature.

Ques. What becomes of the energy of the current at reversal?

Ans. The energy of the current in the section of the winding, undergoing commutation is wasted in heating the wire during the interval when it is short circuited, and as it passes on, energy must again be spent in starting a current in it in the reverse direction. There is, then, a lagging of the current in the armature coils due to self-induction.

Ques. What is spurious resistance?

Ans. This is an apparent increase of resistance in the armature winding, which is proportional to the speed of the armature, and due to the lagging of the current.

Armature Losses.—The mechanical power delivered to the pulley of a dynamo is always in excess of its electrical output on account of numerous mechanical and electrical losses. Mechanical losses result from:

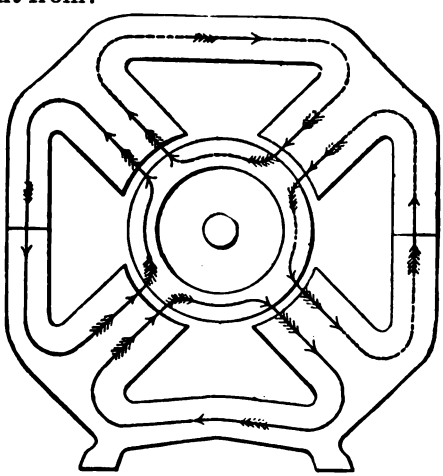


FIG. 299.—Distribution of magnetic lines through solid drum armature of a four pole machine.

1. Friction of bearings;
2. Friction of commutator brushes;
3. Air friction.

The electrical losses may be classified as those due to:

1. Armature *resistance;*
2. *Hysteresis;*
3. *Eddy currents.*

Ques. How do the mechanical and electrical losses compare?

Ans. The mechanical losses are small in comparison with the electrical losses.

Ques. What may be said with respect to friction?

Ans. The bearing friction varies with the load. In calculating this loss not only must the weight of the armature be considered but also the belt tension and magnetic attraction in order to get the resultant thrust on the bearing. Friction of the brushes is very small and may be neglected. A small loss of power is caused by the friction of the air on the armature. The latter, since it revolves rapidly, acts to some extent as a fan, and in some machines this fan action is made use of for ventilation and cooling.

Ques. How are the other losses determined?

Ans. The loss of power due to armature resistance is easily found by Ohm's law, but the hysteresis and eddy current losses, known collectively as *iron losses*, are not so easily determined. If the magnetization curve of the particular quality of iron used for armature plates be known, the hysteresis loss may be calculated approximately. Eddy current losses are the most important, especially in large machines. As previously explained, in all the moving metal masses unless laminated, there will be eddy currents set up if they cut magnetic lines. Power may be lost from this cause even in the metal of the shaft if there be leakage of magnetic lines into it.

CHAPTER XX

COMMUTATION AND THE COMMUTATOR

The act of commutation needs special study. If it be incorrectly performed, the imperfection at once manifests itself by sparks which appear at the brushes. In the study of this chapter on commutation it would be advisable for the student to first review the basic principles of commutation as given in chapter XIV, which contains a brief and simple explanation of how the alternating current in the armature is converted into direct current by the action of the commutator.

Ques. What is the period of commutation?

Ans. The time required for commutation, or the angle through which the armature must turn to commute the current in one coil.

Ques. Upon what does the period of commutation depend?

Ans. Upon the width of the brushes as shown in fig. 300.

This fixes the angle through which the armature must revolve to commute the current in one coil. This angle is formed, as shown in the figure, by two intersecting planes, M and S, which pass through the axis of the armature and the two edges of the brush. Commutation begins at M and ends at S.

Ques. What is the position of the commutating plane with respect to M and S, in fig. 300?

Ans. It bisects the angle formed by the planes M and S.

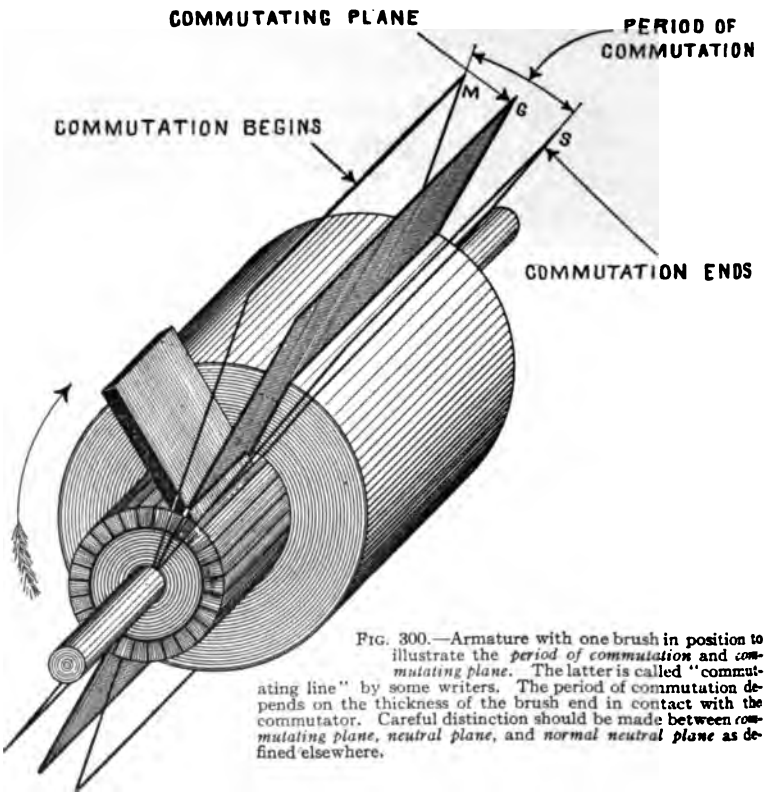


FIG. 300.—Armature with one brush in position to illustrate the *period of commutation* and *commutating plane*. The latter is called "commutating line" by some writers. The period of commutation depends on the thickness of the brush end in contact with the commutator. Careful distinction should be made between *commutating plane*, *neutral plane*, and *normal neutral plane* as defined elsewhere.

Ques. What is the the commutating plane?

Ans. An imaginary plane passing through the axis of the armature and the center of contact of the brush.

Ques. What two planes are referred to in stating the position of the brushes?

Ans. The normal neutral plane and the commutating plane.

The angle intercepted by these two planes represents the *lead*, thus in stating that the brushes have a lead of 6°, means that the angle intercepted by the normal neutral plane and the commutating plane is 6°.

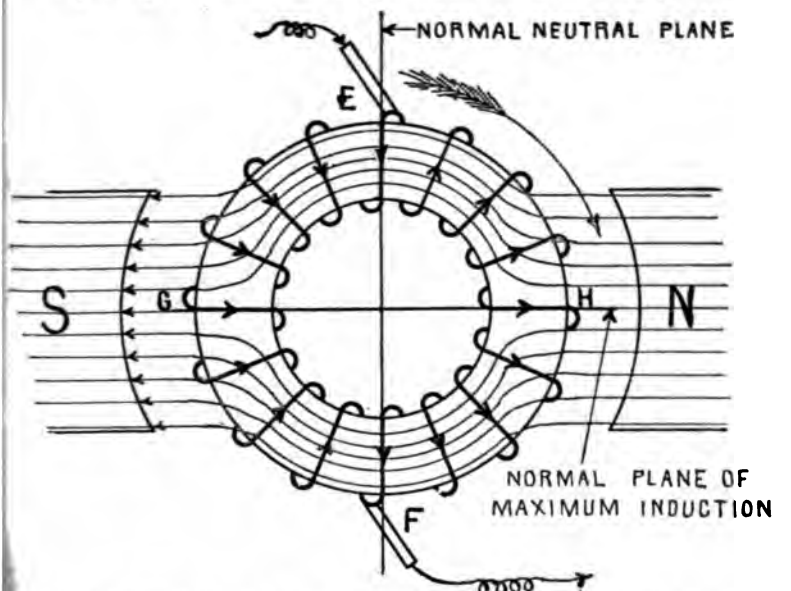


FIG. 301.—The proper position of the brushes, if there were no field distortion and self-induction in the armature coils, would be in the normal neutral plane. In the actual dynamo these two disturbing effects are present which makes it necessary to advance the brushes as shown in figs. 302 and 303 to secure sparkless commutation.

Ques. What is the difference between the normal neutral plane and the neutral plane?

Ans. This is illustrated in figs. 301 and 302. *The normal neutral plane is the position of zero induction* assuming no

distortion of the field as in fig. 301. *The neutral plane is t position of zero induction with distorted field* as in fig. 302 a as is found in the actul machine; the distortion is exa gerated in the figure for clearness.

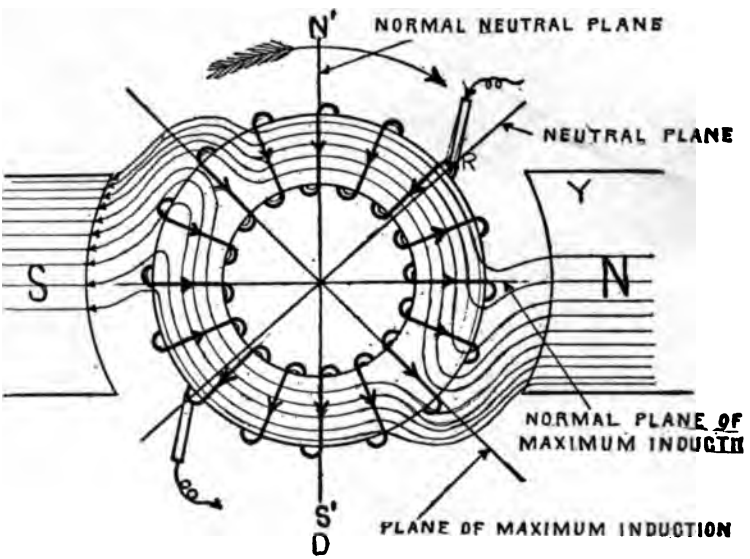


FIG. 302.—Brush adjustment for field distortion. The effect of the latter is to twist the li of force around in the direction of rotation, thus maximum induction takes place in inclined plane. The brushes then must be advanced to the *neutral plane* which is right angles to the plane of maximum induction. This gives the proper position of t brushes *neglecting self-induction.*

Ques. What is the normal plane of maximum indu tion?

Ans. A plane, 90° in advance of the *normal neutral plan being* the position of maximum induction with no distort *of field,* as in fig. 301.

Ques. What is the plane of maximum induction?

Ans. *A plane 90° in advance of the neutral plane*, being the position of maximum induction in a distorted field as in fig. 302.

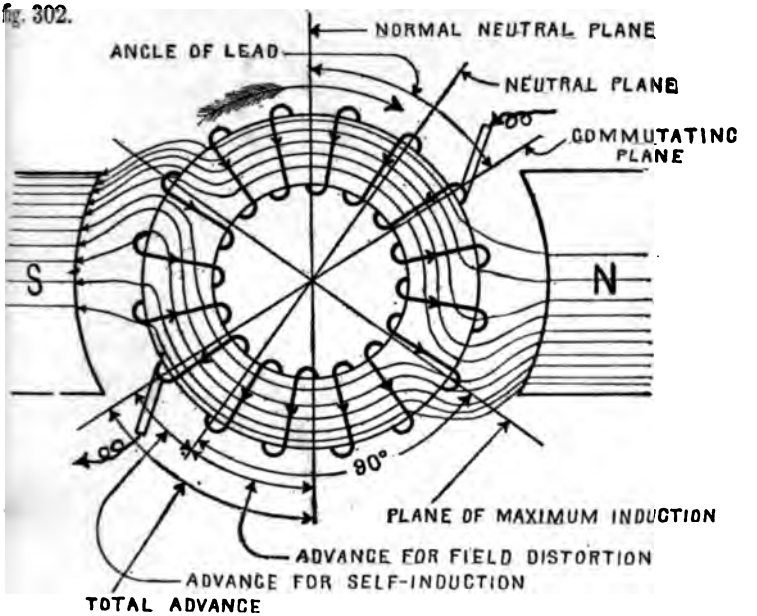


FIG. 303.—Brush adjustment for self-induction. For convenience an electric current is regarded as having weight and hence possessing the property of inertia. The current then during commutation cannot be instantly brought to rest and started in the reverse direction but these changes must be brought about gradually by an opposing force. Hence by advancing the brushes beyond the neutral plane as illustrated, commutation takes place with the short circuited coil cutting the lines of force so as to induce a current in the opposite direction; this opposes the motion of the current in the short circuited coil, brings it to rest and starts it in the opposite direction, thus preventing sparks. Figs. 301 to 303 should be carefully compared and thoroughly understood.

Ques. What should be noted with respect to the different planes?

Ans. The *commutating* plane should be carefully distinguished *from the normal* neutral plane and from the neutral plane, *as shown in fig. 303.*

Commutation.—In order to understand just what happens during commutation, a section of a ring armature may be used for illustration, such as shown in fig. 304. Here the coils A, B, C, D, E, are connected to commutator segments 1, 2, 3, etc., and the positive brush is shown in contact with two segments 2 and 3, the brush being in the neutral position. Currents in

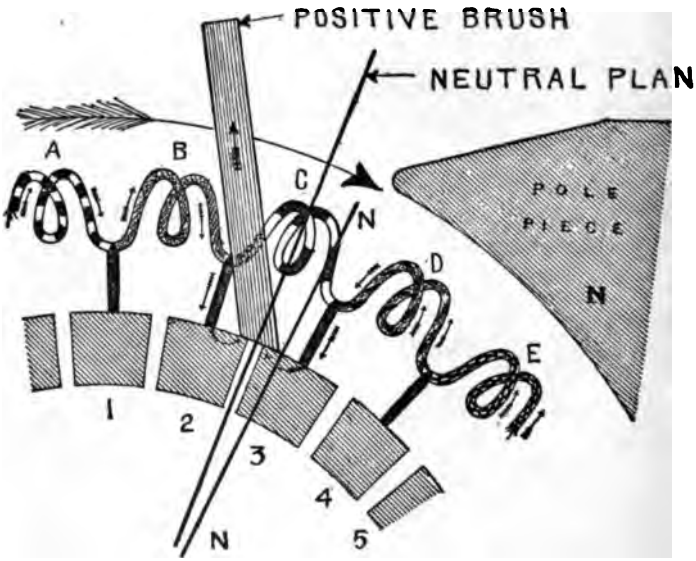


FIG. 304.—Commutation. This takes place during the brief interval in which any two segments of the commutator are bridged by the brush. The coil connecting with the two segments under the brush is thus short circuited. During commutation the current in the short circuited coil is brought to rest and started again in the reverse direction against the opposition offered by its so called inertia, or effect produced by self-induction.

the coils on each side of the neutral line flow to the brush through segments 2 and 3; the brush then is positive.

Now, as the armature turns, the commutator segments come *successively* into contact with the brush. In the figure, segment *3 is just* leaving the brush and 2 is beginning to pass under it, *hence, for* an instant the coil C is short circuited.

Ques. In fig. 304, what are the current conditions?

Ans. Previous to contact with segment 2, current flowed in coil C in the same direction as in coil B.

Ques. What occurs while the brush is in contact with segments 2 and 3?

Ans. During this brief interval, the current in C is stopped and started again in the opposite direction.

Similarly each coil of the armature as it passes the brush will be short circuited and have its current reversed. This is known as *commutation.*

Ques. What is the effect of field distortion with respect to commutation?


Ans. The neutral plane no longer coincides with the normal neutral plane but is advanced in the direction of rotation of the armature as shown in fig. 302.

The reaction of the poles N′ and S′ of the armature field on the poles S and N of the main magnetic field tends to crowd the lines of force into the upper pole face of the south pole of the magnet, and into the lower pole face of the north pole. This effect is due to the strong magnetic attraction between the opposite poles S and N′ and N and S′, and the equally strong repulsion between like poles N and N′ and S and S′. Hence, the plane of maximum induction no longer coincides with the normal plane of maximum induction, but is advanced in the direction of rotation, depending upon the strength of the armature current, being shifted forward for an increase of current, and backward for a decrease of current. This distortion of the field and the consequent shifting of the plane of maximum induction naturally results in the shifting of the neutral plane from the vertical position to the inclined position as shown.

Position of the Brushes; Sparking.—In accordance with the laws of electromagnetic induction, if the bipolar ring armature shown in fig. 301 be rotated in the direction indicated by the arrow the armature current entering at the brush E will

divide, one part passing through the coils on the right half of the ring, and the other part through the coils on the left half of the ring, to the brush F, from which the total current will pass out, urged by the full value of the electromotive force induced in all the coils on both halves of the ring.

Again, if the brushes be placed at the points G and H, each half of a current entering at G, will pass through one-half of

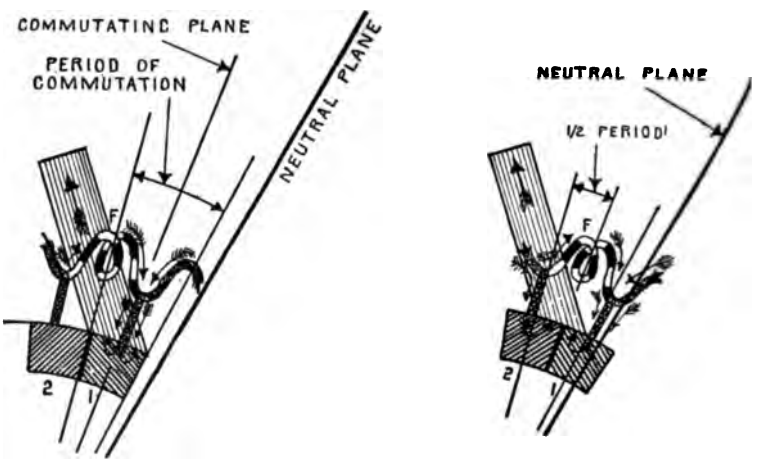


FIGS. 305 to 308.—Improper brush adjustment resulting in excessive sparking. When the brushes are not advanced far enough, commutation takes place before the short circuited coil reaches the neutral plane, hence, its motion is not changed with respect to the magnetic field so as to induce a reverse current till after commutation. There is

the coils on the left side and one-half of the coils on the right side of the ring, so that each half of the current will be urged forward by an electromotive force equal to the electromotive force tending to force it back, and therefore, no current will pass in or out through the brushes. From these considerations it is obvious that the proper position for the brushes would be

in the normal neutral plane, *were it not for the disturbing effects of armature reaction and self induction of the current.*

Ques. Should the brushes of a dynamo be placed in the neutral plane?

Ans. No.

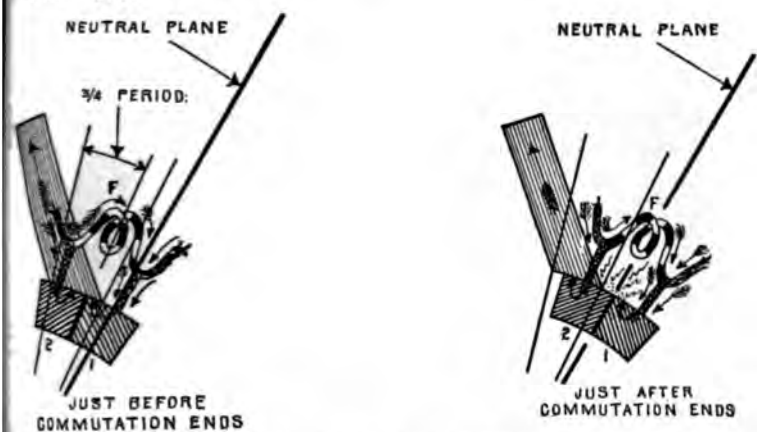

then no opposing force, during commutation, to stop and reverse the current in the short circuited coil, and when the brush breaks contact with segment 1, as in fig. 308, the "*momentum*" of the current in coil F causes it to jump the air gap from segment 1 to segment 2 and the brush, against the enormous resistance of the air, thus producing a spark whose intensity depends on the momentum of the current in coil F. Sparking, if allowed to continue, will injure the brushes and commutator segments.

Ques. Why not?


Ans. The brushes must be advanced beyond the neutral plane to prevent sparking.


Ques. What is the cause of sparking at the brushes?

Ans. *It is due to self-induction* in the coil undergoing commutation.

Ques. Explain the effect of self-induction in detail.

Ans. When commutation takes place with the brushes in the neutral plane as in fig. 304, there will be no voltage induced in the short circuited coil C. The current, therefore, which flowed in coil C before it was short circuited will cease, and as segment 3 breaks contact with the brush, it will be thrown as a

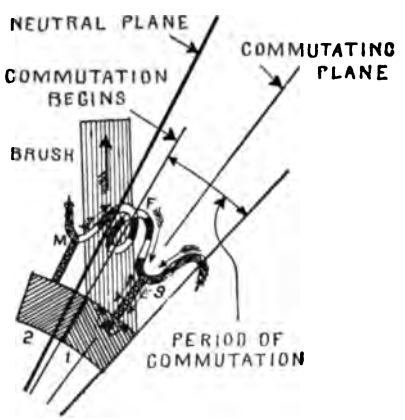

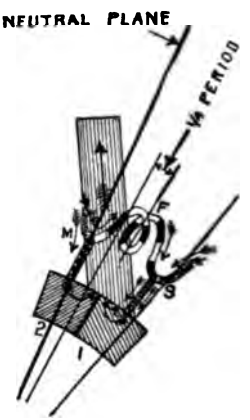

FIGS. 309 to 313.—How sparkless commutation is obtained by advancing the brushes beyond the neutral plane; commutation progressively shown.

FIG. 309.—Commutation begins; current flows up both sides of the armature, uniting at S and flowing to the brush through commutator segment 1 as indicated by the arrow.

FIG. 310.—Segment 2 has come into contact with the brush and coil F, in which commutation is taking place, is now short circuited. The current now divides at M, part passing to the brush through segment 2, and part through coil F and segment 1. Although coil F is short circuited and having passed the neutral plane, is cutting the lines of force so as to induce a current in the opposite direction, it still continues to flow with unchanged direction against these opposing conditions. This is due to *self-induction* in the coil which resists any change just as the momentum of a heavy moving body, such as a train of cars, offers resistance to the action of the brakes in retarding and stopping its motion.

perfectly idle coil upon the right hand half of the ring in which *a current* is flowing toward the brush. Moreover, the current *which* was flowing through D and 3 directly to the brush, must *suddenly* traverse the longer path through the idle coil C. Now,

on account of self-induction, *the current acts in precisely the same manner as though it had weight*; that is:

It cannot be instantly stopped or started.

Therefore, when segment 3 leaves the brush, the current will not instantly change its path and flow through C, but will be urged by its "*momentum*," and jump the air gap between the brush and segment 3, thus producing a spark.

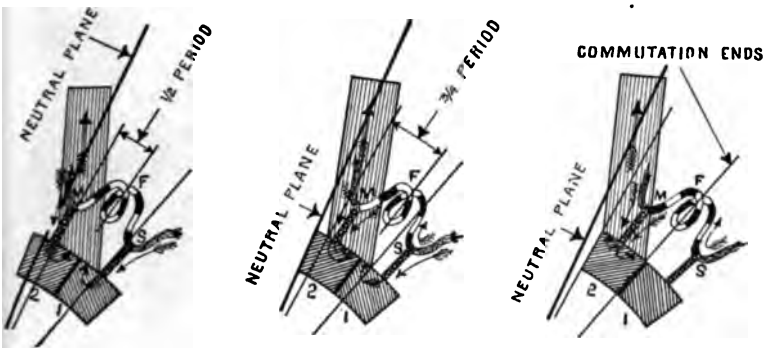


FIG. 311.—Segment 2 has moved further under the brush, and the opposition offered to the forward flow of the current in the short circuited coil F by the reverse induction in the magnetic field to the right of the neutral plane has finaliy brought the current in F to rest. The currents from each side of the armature now flow direct to the brush through their respective end segments 1 and 2.

FIG. 312.—Segment 1 is now almost out of contact with the brush. A current has now been started in the coil F in the reverse direction due to induction in the magnetic field to the right of the neutral plane; it flows to the brush through segment 2. The current has not yet reached its full strength in F, accordingly, part of the current coming up from the right divides at S and flows to the brush through segment 1.

FIG. 313.—Completion of commutation in segments 1 and 2; the brush is now in full contact with segment 2, the current in coil F has now reached its full value, hence the current flowing up from the right no longer divides at S but flows through F and segment 2 to the brush. If the current in F had not reached its full value, at the instant segment 1 left contact with the brush, it could not immediately be made to flow at full speed any more than could a locomotive have its speed instantly changed. This, as previously explained, is due to self-induction in the coil or the so called "inertia" of the current which opposes any sudden change in its rate of flow or direction. Accordingly that portion of the current which was *flowing up from* the right and passing off at S to the brush through *segment 1 as in fig. 312, would, when* this path is suddenly cut off as in fig. 313, encounter *enormous opposition in coil F.* Hence, it would momentarily continue to flow through *segment 1 and jump the air gap* between this segment and the brush, resulting in a more *or less intense spark depending* on the current conditions in coil F.

Ques. How may this sparking be prevented?

Ans. If the brushes be given additional lead, that i shi further to the right to some position as N N, fig. 304 co will not remain idle during the interval it is short c cu *but will cut the magnetic lines in such a way as to induce* ‹ cu *in the reverse direction through it.* Under these conditions, v segment 3 breaks contact with the brush, the current flo through D does not encounter an idle coil, but one in w a current is flowing in the same direction, hence, the tend to jump the air gap and produce a spark is reduced; with pr adjustment of the brushes, there will be no sparking.

Ques. What is the objection to very thin brus

Ans. Time must be allowed for reversal of the cur hence the brushes must not be so thin as merely to bridge insulation between segments.

Ques. What is the effect of lead?

Ans. There is usually much sparking when the lead is small; a little sparking when too great, and no sparking w just right. If the lead be excessive, there is a waste of en due to the generation of a larger reverse current in the sl circuited coil than is necessary.

Fixed Position of Brushes.—The condition for spark commutation is that the current in the short circuited coil reduced to zero, and increased in the opposite direction up the same value as that in the next coil leading. If the brus are to remain in a fixed position, this condition will only realized at the particular load for which the brushes are Thus, if the brushes be set for the average load, the rever *field will* not be correct for either a weaker or stronger lo *Hence,* sparkless commutation with fixed brushes must be d *some* other factor.

Ques. What may be said with respect to carbon rushes?


Ans. Since carbon possesses a high resistance, the drop ll vary greatly with the contact area, thus affecting a difference potential in the two segments passing under the brush and it largely to this that sparkless commutation is due.

Ques. What is the effect of resistance on commutation?

Ans. In fig. 304 during commutation, that is, while the rush contacts with any two segments, as 2 and 3, the currents ming up through the winding on either side of the neutral ane are offered two paths to the brush: 1, direct to brush rough the connecting segment, or 2, across the short cir- ited coil and adjacent segment. Thus, on the right side: brush through segment 3, or across coil C and adjacent seg- ent 2.

The current will take the path of least resistance.

At the beginning of commutation, almost the entire brush a being in contact with segment 3, the contact resistance of s segment will be much less than for segment 2; hence, not ly will the current at the right flow through 3, but also the rent at the left after first traversing the short circuited coil. commutation progresses, the area of contact of 3 decreases le that of 2 increases, and the respective resistances vary inverse proportion. Likewise the tendency of the current he left half of the winding to take the longer path through C and segment 3 to the brush gradually decreases, becoming when the two contact areas become equal. During the nd half of the period of commutation, the contact area of ment 2 becomes greater and of 3, less; thus the resistance of lowered, *and that of 3* increased. Accordingly, all of the *ent at the left will flow* through segment 2, and the current *e right will flow* through C and 2 rather than through

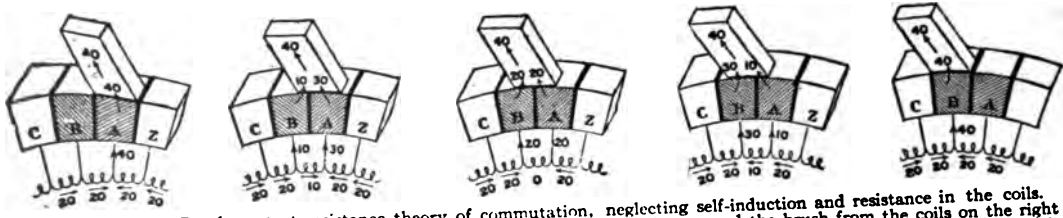

FIGS. 314 to 318.—Brush contact resistance theory of commutation, neglecting self-induction and resistance in the coils. The total current is assumed to be 40 amperes made up of 20 amperes flowing toward the brush from the coils on the right and 20 amperes from the coils on the left. During commutation, that is, the interval during which the brush contacts with any two adjacent segments of the commutator, the current is assumed to vary directly as the contact area.


FIG. 314.—Beginning of commutation; segment A is entirely under the brush, and B is at the initial point of contact. For this position the currents from both sides flow to the brush through segment A.

FIG. 315.—One-quarter period of commutation. One quarter of the brush area is in contact with B and three quarters in contact with A; hence, 10 amperes will flow through B and 30 amperes through A.

FIG. 316.—Second quarter of commutation period. The brush now contacts equally with both segments, hence 20 amperes will flow through each segment.

FIG. 317.—Third quarter of commutation period. Three quarters of the brush area is in contact with segment B and one quarter with segment A; accordingly, 30 amperes will flow through B and 10 amperes through A.

FIG. 318.—Completion of commutation. The brush is in full contact with segment B and at the point of breaking contact with A, hence the entire current from both sides or 40 amperes will flow through B.

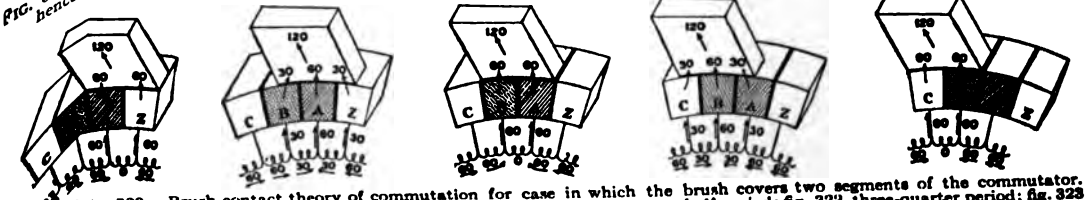

FIGS. 319 to 323.—Brush contact theory of commutation for case in which the brush covers two segments of the commutator. Fig. 319 beginning of commutation; fig. 320 one-quarter period; fig. 321, one-half period; fig. 322, three-quarter period; fig. 323 completion of commutation.

3. In this way the current is reversed in C, and, if the brush be broad enough to allow a sufficient time interval, the current in C is built up to its full value before segment 3 leaves the brush, thus securing sparkless commutation.

This contact resistance factor in sparkless commutation is illustrated in figs. 314 to 318, it being assumed that during commutation, the brush contact resistance is inversely proportional to the area of contact, and that the winding is free of resistance and inductance. The current is taken as 40 amperes, in which case 20 amperes will flow from each side of the winding to the brush.

In fig. 314 the instant before commutation begins all the current will flow through segment A. At the end of the first quarter of the period of commutation, fig. 315, 30 amperes will flow from the right to brush through A, and from the left, 10 amperes through the short circuited coil via A and 10 amperes through B.

At the end of the second quarter or half period, fig. 316, the current through each half of the winding will flow to the brush through these respective segments.

At the end of the third quarter, fig. 317, the current from the right will divide, 10 amperes going through A, and 30 amperes traversing the short circuited coil and out through B. The entire current from the left will flow through segment B.

At the end of the fourth quarter, fig. 318, or completion of the period the current from each half of the winding will flow to the brush through B.


Ques. What is the effect of increasing the degree of contact of the brushes?

Ans. It lengthens the period of commutation, and permits it to start in one coil before the preceding coil has entirely passed through this stage.

The effect of changing the degree of contact is shown in figs. 319 to 323, in which the width of the brush is made equal to that of two segments.

Construction of Commutators.—The commutator for a closed coil armature consists of a number of segments or *L-shaped bars C of drop* forged hard drawn copper assembled *around a tubular iron hub* as shown in figs. 324 and 325. The bars are

held in position by the nuts E, and washers F, screwed on the ends of the tube D. The bars are insulated from each other and from the washers by mica as shown by the heavy lines G, and they are also insulated from the tube either by a tube of mica H, or by a sufficient air space. The ends of the sections of winding are connected to the vertical portions of the bars K, by insertion in the slots L, where they are securely held in place by means of the binding screws, which for greater security

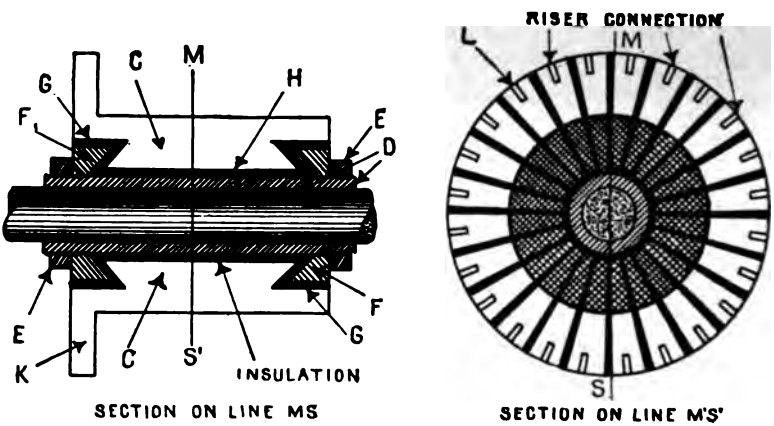

FIGS. 324 and 325.—Side and end sectional views of commutator showing construction. The parts are: C, segments; D, tubular iron hub; E, end nuts; F, clamps; G, insulation; L, riser connection.

are soldered together, and may be released from the slots, whenever necessary, by the application of a hot soldering iron.

It is very important that all the parts of the commutator should be fitted together perfectly and screwed up tightly, in order to prevent looseness. Commutator segments are often made with the washers E, projecting beyond the ends, but such construction reduces the effective length of the commutator, therefore the under cut form of bar is preferable.

In the construction of commutators, the conditions of operation require that there be:

1. Adequate insulation;

It is necessary to have good insulation between each segment, and a specially good insulation between the segments and the hub or sleeve on which they are mounted; also between the segments and end clamps. The insulating material must not absorb moisture, hence asbestos, plaster, or vulcanized fibre are not used. The end insulating rings are usually built up of mica and shellac, moulded while hot under pressure to the correct shape.



FIG. 326—Front view of Western Electric Commutator for bar wound armature. This commutator is made of hard drawn copper and insulated throughout, ventilating spaces being provided near the shaft.

2. Rigidity against centrifugal force;

Since the segments are subject to centrifugal force, they must be securely clamped in place. Screws cannot be used, for that would destroy the insulation. They are therefore held in place by insulated clamps as shown in fig. 324. These clamps should be strong and capable of holding the *segments firmly* in position, for if a segment should rise out of *its place through centrifugal* force, it would disturb the action of the *brush and cause sparking.*

677768 A

3. Provision for wear.

The segments should be of considerable radial depth, so that the commutator may be turned down from time to time to preserve its circular form.

Points Relating to Commutators.—1. The number of commutator segments depends on the scheme of winding and on the number of sections in the armature winding.

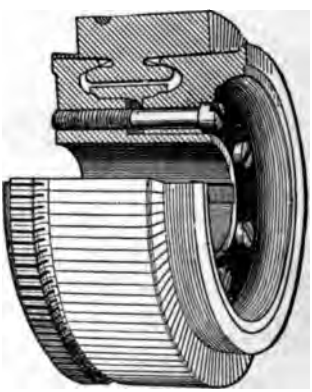


FIG. 327—Sectional view of a General Electric commutator. The segments are of rolled or forged copper and are separated by soft mica insulating sheets. This mica must wear down evenly with the copper, hence its consistency is important. The segments are wedge shaped so that when drawn radially inward they support each other like the stones of an arch. They are drawn together by hollow cone collars which bear upon lugs projecting from the ends of the segments. These lugs are turned to form a smooth cone after the segments are assembled. The collars are insulated with mica from the segments and they are held in place by nuts upon the commutator shell or by bolts passing from end to end under the segments. The segments are also provided with lugs for connection to the windings.

2. Increasing the number of bars diminishes the tendency to spark, and lessens the fluctuations of the current.

There are two practical reasons for not using a very great number of segments: it increases the cost, and in small machines the segments would be so thin that a brush of the proper thickness to collect the current would lap over, or bridge several segments.

Types of Commutator.—Commutators are made in various forms, but they may be grouped into two general types:

1. Commutators for closed coil armatures;

These consist of a large number of segments or bars, insulated from each other and varying in number according to the scheme of armature winding, and on the number of sections into which that winding is grouped.

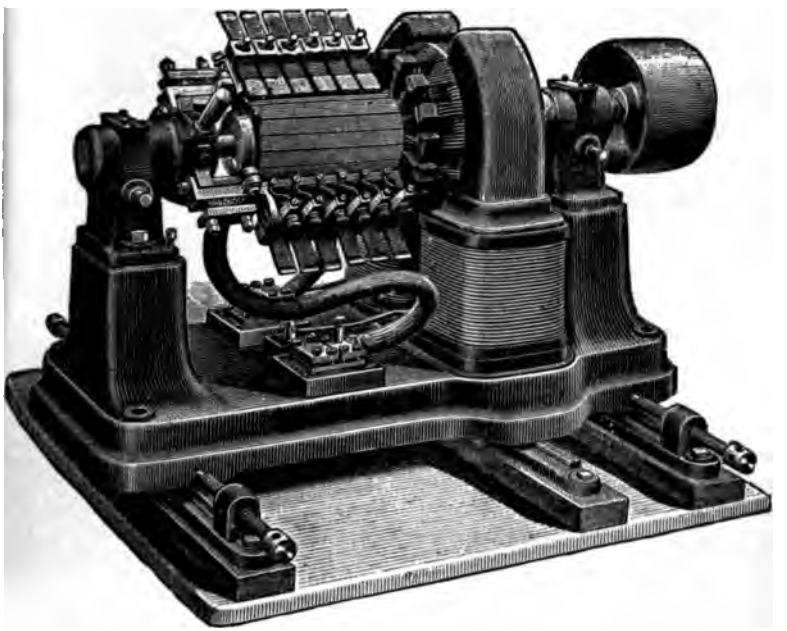


FIG. 338.—A large current low voltage bipolar dynamo built for electrolytic work and here shown to illustrate the large size commutator and brushes necessary to collect the large current. Carbon brushes would not be suitable for this class of machine because even with copper brushes, whose conductivity is much higher than carbon, the commutator must be of considerable size to give the required brush contact area. The contrast between the axial lengths of the armature and the commutator is very marked. The rocker construction is of the ordinary type, and heavy flexible cables conduct the current from the brush holders to the fixed terminals. The machine here illustrated gives 310 amperes at 7 volts when running at a speed of 1400 R. P. M., corresponding to an output of 2.17 kilowatts.

2. Commutators for open coil armatures;

This form of commutator is used on some machines designed especially for arc lighting, such as the Brush and Thompson-Houston machines. They consist of a comparatively small number of segments each of which covers a wide angle, and are separated from each other by air gaps.

3. The segments should be of considerable depth to permit returning occasionally so that their circular form may be preserved;

4. The insulating material must be such that it will not absorb oil or moisture;

Mica is best adapted for insulation, but as there are a great many varieties, differing greatly in hardness and other equalities, it is important to select the kind that wears at the same rate as the segments. If the mica be too hard, the wearing of the segments will leave it projecting and prevent proper contact with the brushes; again, if the mica be too soft, it will result in furrows or depressions between the segments into which copper dust will collect, causing short circuits.

CHAPTER XXI

BRUSHES AND THE BRUSH GEAR

With respect to construction, brushes may be broadly classified as: 1, those made of metal, and; 2, those made of carbon. There are several varieties of metal brush, such as:

1. Gauze brushes;
2. Wire brushes;
3. Laminated or strip brushes.

Gauze Brushes.—These are very flexible and yielding, their use being attended with little wear of the commutator.

Ques. What is the construction of a gauze brush?


Ans. A gauze brush is made up of a sheet of copper gauze, folded several times, with the wires running in an oblique direction, so as to form a solid flat strip of from ¼ to ½ inch in thickness, increasing with the volume of the current to be collected.

Ques. What is the object of folding the gauze with the wires running in oblique directions?

Ans. It is to prevent the ends of the brush fraying or threading out, *which would* be the case if the gauze were folded *up in any other manner.*

Ques. What are the features of gauze brushes?

Ans. They make good contact, but are quite expensive. They may be set either tangentially or radially, the latter preferably, since the point of contact remains the same as the brushes wear away.

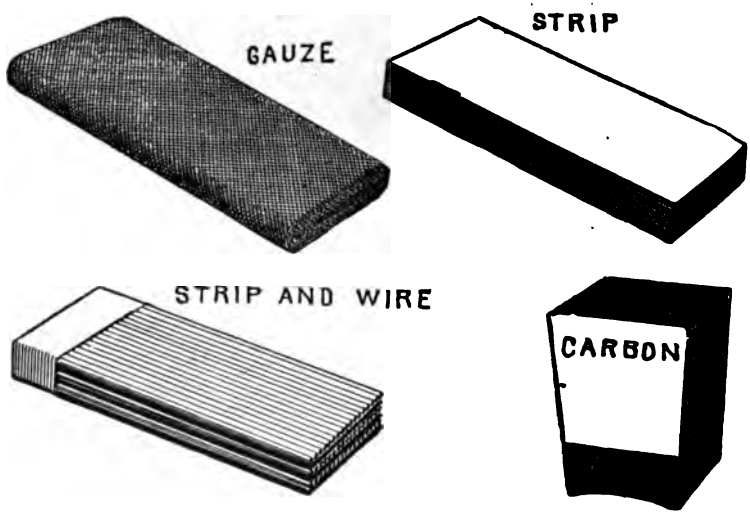

FIGS. 329 to 332.—Various forms of brush. Fig. 329 gauze brush; fig. 330 laminated or strip brush; fig. 331 strip and wire brush as used on the early Edison machines; fig. 332 carbon brush. Carbon is preferred to copper for brushes on account of the reduction of sparking secured by its use.

Wire Brushes.—This class of brush, which was extensively used before the invention of the gauze brush, is made up of a bundle of brass or copper wires, laid side by side and soldered together at one end. Since wire brushes are harder than the gauze brush, they are more liable to cut or score the commutator, and are also more troublesome to trim.

Laminated or Strip Brushes.—These probably represent the simplest form of brush, but are not extensively used owing to the lack of flexibility. They consist of a number of strips of copper or brass, laid one upon the other and soldered at one end, as in fig. 330.



FIG. 333.—General Electric brush holder. The brush holder yoke consists of a cast iron ring of elliptical section, supported from the bracket of the end shield in such a manner as to facilitate the shifting of the brushes. It is provided with a suitable handle, and may be fastened in any position by means of a thumb nut on the outside of the bracket. It is so constructed that the tension on the individual brush can be adjusted without lifting the brush from the commutator and without the use of tools. The brush can be removed while the machine is running, without moving the holder on the stud and without disturbing any other brush. Removal of the brushes for inspection can be accomplished without permanent change in the adjustment of the tension of the brush holder spring. The connection between the brush and stud is made through a flexible copper connection.

Ques. What name is generally given to strip brushes?

Ans. They are commonly and erroneously called *tangential brushes*, but they are really beveled at the end and set inclined to the line of *tangency* so that the ends of all the sheets will *make contact.*

In the Brush and Thomson-Houston arc dynamos, in which the c
rent is limited to ten amperes, the brushes consist of a simple stri
flexible sheet copper, the ends of which are slit in a number of pl
so as to insure contact at several points.

Carbon Brushes.—When metallic brushes are used up
the commutators of high tension machines, they frequen

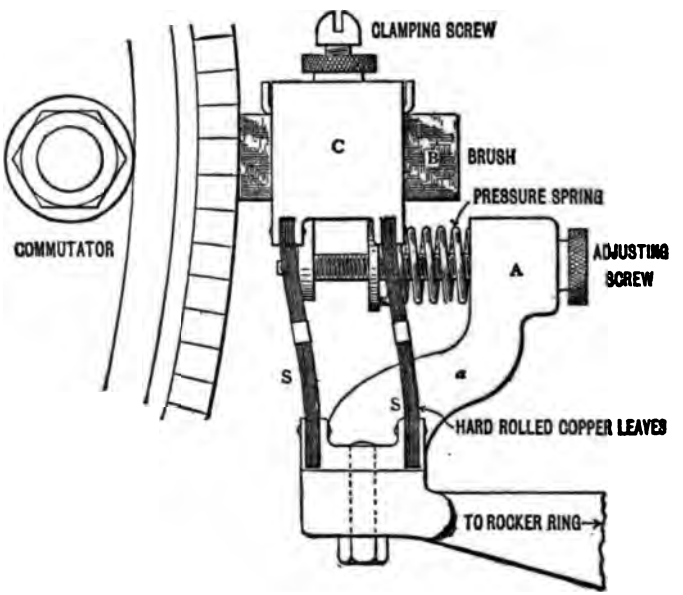



FIG. 334.—Crocker-Wheeler brush holder. The carbon brush B is firmly clamped in "box" C by two screws which bear on a sheet of brass to protect the carbon from be broken by the ends of the screws. The box C is carried by four flexible springs S S, at each corner and formed of hard copper leaves. These are fixed at one end to the box, at the other to the solid base which is in one piece with the spoke attached to the rot ring. An adjusting screw passes through appropriate lugs on the box C and pass through the head A of a fixed arm *a*. Between the lower surface of *a* and the upp lug on the box C is placed the pressure spring.

give rise to excessive sparking and also heating of the armatur
the metallic dust given off appearing to lodge between th
segments of the commutator, thus partially short circuiting

re. To obviate this, carbon brushes are extensively used h dynamos, this material being found very effectual in vention of sparking.

s. What is the usual form of carbon brushes?

They are usually in the form of oblong blocks.

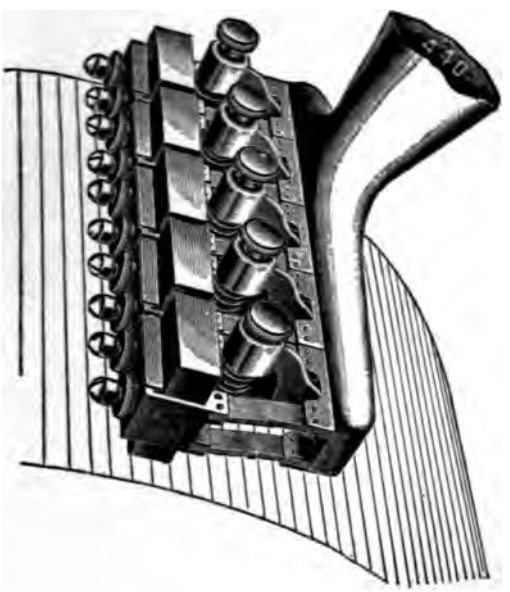

-Perspective views of Crocker Wheeler brush holder. This holder is of the parallel ı which the brushes may be adjusted without affecting the lead. Each brush is held in its box and there are no sliding contacts in the path of the current. The holder ber described under fig. 334.

s. How are they adjusted on the commutator?

They are set "butt" end on the commutator, and fed *as they wear away* by means of a spring holder.

Ques. Why are carbon brushes so extensively

Ans. Because they are the only form of brush tha give good commutation with fixed lead.

Ques. What may be said of the different grad carbon in use for brushes?

Ans. The very soft carbon leaves a layer of graphitic on the commutator, and at high voltages, this may cause ing; such grade of carbon should only be used on low v machines.



FIG. 336.—Western Electric box type brush holder. The box which holds the brush is to allow the brush to slide freely, but not loosely, to and from the commutato which it is normally held by a lever acting directly upon the brush head. This a possibility of uneven bearing on the commutator, as the brushes are allowed ve lateral or angular motion. The adjustment of a brush is also simplified after it removed and then replaced. Tension on the brush head is obtained by a speci which maintains any given tension for which it may be set. An auxiliary flat ste on the lower side of the lever acts as a shock absorber between the lever and t head, absorbing all minor vibrations caused by a worn commutator. Side contact brush and brush holder is not relied upon to carry the current, flexible coppe performing this function to the exclusion of sliding contacts or tension springs, in reduce the brush loss. It is not necessary to take the brush rigging apart or loo connections when it is desired either to remove or reverse the brushes to change t tion of armature rotation.

Ques. How are the ends of carbon brushes tr and why?

Ans. They are usually covered at their upper part *a coating* of electro-deposited copper to insure good contact *the holder.*

Comparison of Copper and Carbon Brushes.—Copper brushes tend to tear and roughen the surface of the commutator, while carbon brushes tend to keep the surface smooth. Copper causes more wear of the commutator than carbon. With carbon brushes, the armature may be run in either direction. The resistance of carbon being greater than copper, there is less short circuiting caused by carbon particles than by those of copper.



FIG. 337 —Westinghouse brush holder. It is made of brass, cast in one piece, and of standard sliding type with a shunt of braided copper wire directly connected to a clamp on each brush and to the solid portion of the holder, where it is held by a screw. This shunt relieves the spring of heavy currents. The holder is so arranged as to be easily accessible for adjustment, cleaning and renewal of carbons. Proper tension is provided by spiral strap springs so mounted as to eliminate friction and give uniform pressure over a wide working range. The spring tension is readily adjusted by a simple ratchet arrangement.

Ques. What is the chief merit of carbon brushes?

Ans. They give less sparking than other types.

Ques. How has the construction of carbon brushes been varied?

Ans. *Since, for minimum* sparking, it is only necessary that *the brush have high resistance* in the region rear its edge,

attempts have been made to increase the conductivity of the other portions by combining with the carbon, copper sheets or wires.

Ques. What are the objections to carbon brushes?

Ans. They are easily broken and not being flexible, vibration, or any roughness of the commutator will cause bad contact.



FIG. 338.—Holzer Cabot multiple brush holder. Each brush is fastened securely to a machined surface by one or two machine screws, making a positive contact. Several strips of flexible copper of ample section to carry the current are interposed between the part of the holder carrying the brush and the portion clamping the stud, no sliding contact or spring being therefore required to carry any current. The brushes are proportioned for a carrying capacity of not more than 2.5 amperes per square inch of brush surface. The brush can be adjusted to any degree of tension during the operation of the machine if necessary. Each holder is insulated in such a manner that no short circuit can occur if the holder be accidentally tipped backward while the operator is changing a brush or cleaning the commutator during a run.

Ques. For what class of machine are carbon brushes specially adapted?

Ans. For machines furnishing a small current at high pressure.

When carbon brushes are used, it is desirable that the current be small, because, on account of the low conductivity of the carbon, more contact area is necessary than with copper for equal current transmission. For fixed lead and fluctuating currents, carbon brushes should be used.

Ques. For what class of machine are copper brushes specially adapted?

Ans. For machines furnishing large current at low pressure, as in fig. 328.

Size of Brushes.—The number of brush sets depends upon the number of poles of the machine, but there may be several brushes in each set. It is usual, except in the smallest machines, to place at least two brushes exactly similar side by side instead of one broad brush, thus allowing one brush to be removed for trimming or renewal while the machine is running. Moreover, better contact is secured by this sub-division, because a slight elevation in the commutator surface at one point may slightly raise one brush of a set at each revolution without much harm, while with one broad brush, the entire brush would be lifted, causing bad sparking.

Ques. What determines the number of brushes in each set?

Ans. It depends upon the current capacity, size of machine, and judgment of the designer.

Ques. What may be said with respect to the dimensions of the brushes?

Ans. No general rule can be given for breadth and thickness of brush. The contact face must clearly be wider than the thickness of the insulation between commutator segments, since the period of commutation must last an appreciable interval of time on account of self-induction.

Ques. What should be the minimum width of the brush contact face?

Ans. It *may be taken* as one and one-half times the thickness *of the commutator segments.*

Ques. How wide should a carbon brush contact be?

Ans. The brush should be thick enough to cover two and one-half commutator segments. The thickness should in no case be excessive on account of the loss due to heating, which results from the difference of potential at the forward and rear edge of the brush.

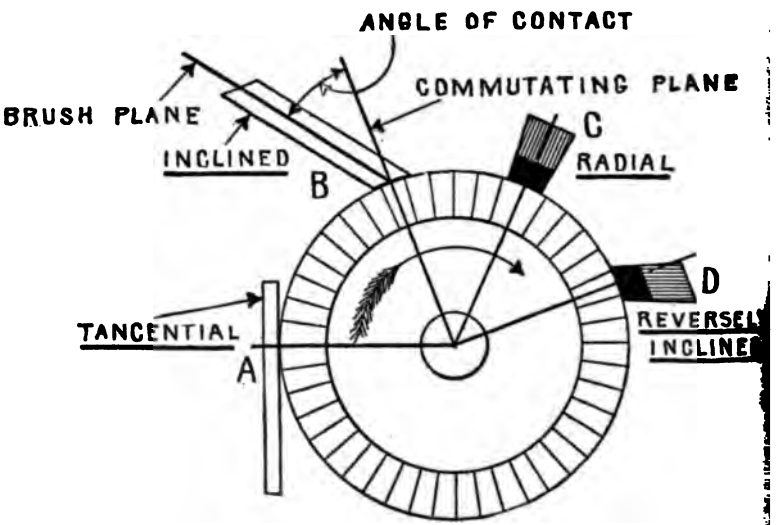


FIG. 339.—Contact angle for the different types of brush. At A is shown a brush with tangential contact, and at B, a so called tangent brush; the latter is properly called an inclined brush. Sheet copper brushes are set tangentially as at A, and gauze brushes inclined as at B. Carbon brushes are placed radially as at C when mounted in box holders, and inclined opposite to the direction of rotation when used with reaction holders.

Contact Angle of Brush.—This may be defined as the angle which the brushes make with the commutating plane as shown in fig. 339. The several kinds of brush, together with the varied *conditions* of operation require different contact angles ranging *from zero* to 90°.

Thus in the figure, a copper strip brush may lie at 90° or tangentially *as at A.*

Wire or gauze brushes should make a more or less acute angle as at B, in order to present the end and not the side of the brush to the commutator.

Carbon brushes may be placed end on or radially as at C, which is the position almost universally used in the case of traction or other reversing motors.

Sometimes the carbon brush is inclined as at D, in order that the revolving commutator may tend to push the brush against its supports and thus ensure better contact.

Brush Contact.—The relation between *contact pressure*, *contact resistance*, and *friction* of brushes varies greatly for different kinds of brush. Copper brushes will carry from 150



FIG. 340.—Bissell double brush holder. Flexible cables carry the current between the brushes and holders. This holder works equally well for forward or reverse rotation. Two or more holders are used on each stud except for the two smallest frames. The construction permits of adjustment or renewal of brush while the machine is in operation. Sufficient contact area of brush is provided to permit running on one carbon at ordinary loads in case the other become worn or inoperative.

to 200 amperes per square inch of contact surface; and carbon brushes from 40 to 70 amperes per square inch. The usual contact pressure is 1.25 to 1.5 pounds per square inch for copper brushes, and 1.5 to 2 pounds per square inch for carbon brushes. The rim velocities of commutators vary from 1,500 to 2,500 feet per minute, the velocity usually increasing with the size of the machine.

Ques. What is the drop in voltage at the brushes?

Ans. For carbon brushes it is about 0.8 to 1.0 volt at each *contact, or 1.6 to 2.0 volts* for the two, positive and negative, *contacts of a machine.*

This value is not materially affected by placing a number of br in parallel or by using several sets, as in the case of multipolar mac as such arrangement merely reduces the current density, and the contact resistance varies in the inverse ratio, their product re nearly constant.

Ques. What may be said of the friction of the brus

Ans. The coefficient of friction of brushes is about .2 t for copper and .3 for carbon.

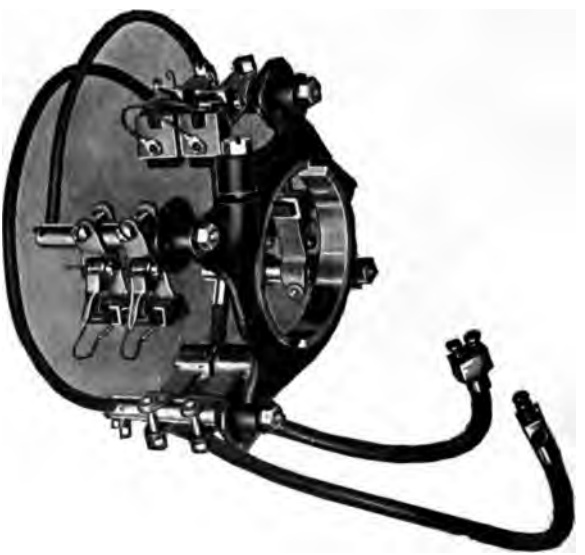


FIG. 341—Western Electric brush gear. The brush holders carry carbon brushes and designed that the brushes may be firmly clamped in position and also be capable of pendent adjustment. Any brush can be removed while the machine is in operation out distrubing the others and without moving the holder on the stud.

Ques. How many watts are lost at the brushes?

Ans. The watt loss is equal to 1.6 to 2. volts for car *multiplied* by the total current carried.


The watt lost on account of friction may be calculated by the for

$$\frac{.3 \times 746}{33000} (P \times S) = \text{watts lost by carbon friction, in w}$$

is the total pressure in pounds on the commutator, and S, the rim velocity of the commutator in feet per minute.

The losses due to contact resistance and brush friction are very liable to be greatly increased above the values that may be obtained by the preceding methods, if the commutator and brushes are dirty and rough, or not in good condition.

Brush Holders.—These are devices employed to hold the brushes against the commutator with the proper pressure. They differ considerably in various types of machine, hence, no

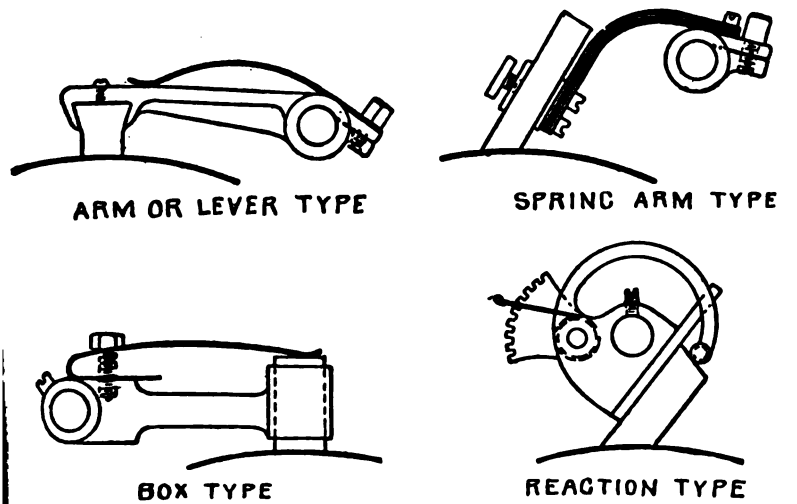

FIGS. 342 to 345.—Various types of brush holder. Fig. 342, arm or lever type; fig. 343, spring arm type; fig. 344, box type; fig. 345, reaction type.

general rules can be given with respect to their construction or use, but any brush holder must fulfill the following requirements:

1. It must hold the brush securely and at the same time feed it forward *as it wears* away so as to maintain a proper contact;
2. *It must hold the* brush at the proper contact angle·

3. It must be capable of being raised from the commutator, and held out of contact by some form of catch;
4. It must be so constructed that the brush can be easily removed for cleaning or renewal;
5. The spring pressure must be adjustable;
6. The brush holders themselves must be carried on a rocker arm, or rocker ring.

It is desirable that brush holders be capable of individual adjustment, so that each may be set at its own point of minimum sparking. A few forms of brush holder are illustrated in figs. 342 to 345.


The various kinds of brush holder may be divided into four types:

1. Arm or lever type;
2. Spring arm type;
3. Box type;
4. Reaction type.

In the arm or lever type the brush is firmly attached to the extremity of a rigid arm capable of movement about the brush spindle, except in so far as it is restrained by a spring as in fig. 342.

Fig. 343 shows a brush holder of the spring arm type. The brush is firmly attached to the extremity of a spring arm, the other end of which is secured to the brush spindle, and when once adjusted is not capable of movement about the brush spindle.

In the box type of brush holder as illustrated in fig. 344, the brush is free to move up and down in the brush box, so far as it is not restrained by a spring rigidly secured to the arm which carries the brush box at its extremity.

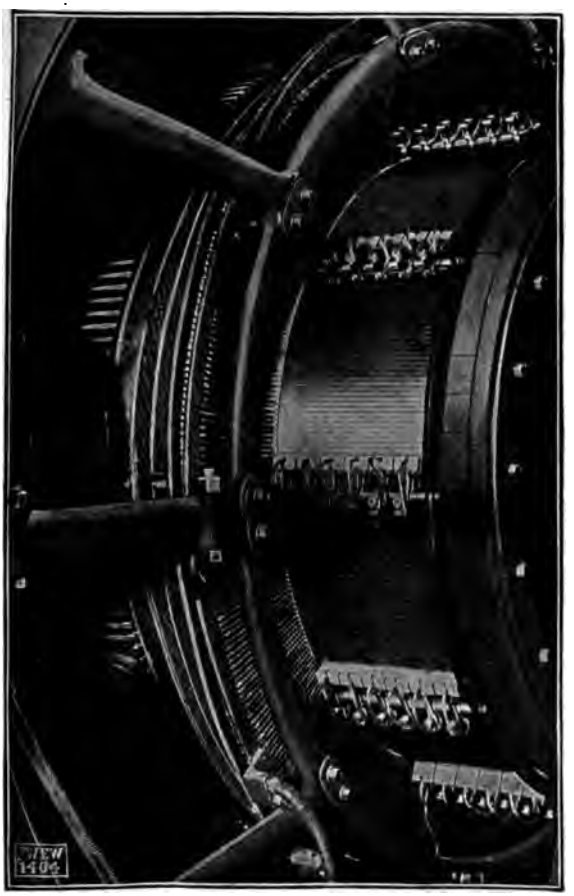

6.—Fort Wayne type MPL dynamo; view showing details of armature, commutator
d brush rigging of large machine. The laminations of the armature core are punched
m thin sheet steel, annealed and japanned. Spacing ribs are built into the core at
per intervals forming air passages for ventilation. In addition, there are recesses in
s inside of the flanges which permit the passage of air from the interior around the
ds of the core to the openings in the end flanges. The armature coils are constructed
round or bar copper on standard forms. The coils are laid in slots in the surface of the
e. The commutator is constructed of bars of hard drawn copper of uniform size an
pe, supported and clamped at either end between beveled rings and securely seated
commutator drum. The drum is connected by radial arms to the commutator hu
h is mounted and keyed on the armature hub extension.

Fig. 345 shows the reaction type of brush holder, in which the movement of the brush is constrained in one direction by the surface of a part rigidly secured to the brush spindle, and is further constrained by a spring controlled arm, the pressure of which is capable of ready adjustment.

Among the special forms of brush holder may be mentioned:



FIG. 347.—Western Electric brush holder. This holder consists of a rugged iron casting, elliptical in section, and supported from the commutator end bearing bracket in such a manner as to provide for the shifting of the brushes. A handle attached to the yoke aids in this shifting and a thumb nut on the outside holds the whole brush gear in the desired position. The brush is fed through an accurately broached slot by a spring which maintains uniform pressure against the commutator throughout the wearing length of the brush. The long lever arm of the spring is sufficiently flexible to take up any minor vibrations of the brush. The tension of the brush may be adjusted without lifting it from the commutator or disturbing any of the other holders. The brush may be removed for inspection by throwing the spring out of notch. The brush is connected to the holder by flexible copper pig tails of ample current carrying capacity.

1. Scissor type of brush holder, used for slip rings, and consisting of two arms pivoted together like a pair of scissors. The lower ends of the arms carry the brushes, suitably mounted, and the upper ends are drawn together by a spring, which thus exerts pressure on the brushes.

2. Clock spring type of brush holder in which the necessary contact pressure is applied to the brush by means of a clock spring, which, with the aid of a ratchet may be wound up and adjusted to any desired pressure.

Ques. How are brush holders carried?

Ans. They are carried by a *rocker arm* for bipolar, and by a *rocker ring* for multipolar machines, which is mounted upon one of the main bearings, or upon a support specially provided for it, being pivoted to revolve from the same center as the shaft, to permit shifting the brushes.

Ques. Mention one trouble sometimes encountered with brush holders.

Ans. There is sometimes trouble resulting from the current passing through the spring which heats it and destroys its elasticity.



FIG. 348.—Western Electric parallel spring brush holder as used on the larger machines.

Ques. How may this be avoided?

Ans. By insulating one end of the spring, and carrying the entire current directly from the brush itself to the main conductors by a flexible copper strip or cable firmly connected to both.

Ques. What may be said with respect to brush construction on machines for electrolytic work?

Ans. The collection of large currents at low voltage, generated by comparatively *small* machines, requires careful design of *brushes and brush holders*. The commutator is longer than the

commutators on machines of equal capacity at higher voltages and as a rule the commutator segments are thicker and fewer in number. Each brush set is made up of numerous narrow brushes rather than two abnormally wide ones.

An example of brush and brush gear designed to meet such conditions is shown in fig. 328.

In large machines for electrolytic work, it is not unusual to find the current divided between two wide commutators, one at each end of the armature, thus giving a longer axial bearing surface for the brushes without inconveniently lengthening the pins upon which the separate brushes are threaded.

Multipolar Brush Gear.—The brush gear which includes the holders and carrier arm or ring, becomes more complicated as the number of poles and magnitude of the current is increased.

In the early days of multipolar machines, schemes of armature winding were devised such that all the necessary cross connections were made inside the machine, and the number of brush holders reduced to two and placed at an angular distance apart depending upon the number of poles. Such windings, though possible, are not used much, chiefly on account of their complexity, which not only increases the danger of error in construction, but also makes repairs costly. In modern multipolar machines, such complicated windings are avoided, and the several sets of brushes are connected together in two groups, positive and negative. These connections are carefully designed as part of the brush gear.

Ques. How are the brushes held in large multipolar dynamos?

Ans. They are held at the proper points of commutation by arms offset from a cast iron rocker ring, which is itself supported by brackets projecting from the magnet yoke as shown in fig. 346.

Ques. What provision is made for shifting the ring to adjust the lead?

Ans. The ring is rotated by means of a worm gear and *hand* wheel.

CHAPTER XXII

ARMATURE CONSTRUCTION

The armature of a dynamo has been defined as: *a collection of coils of wire wound around an iron core, and so arranged that electric currents are induced in the wire when the armature is rotated in a magnetic field.*

From the mechanical point of view the armature may be said to be made up of the following parts:

1. Shaft;
2. Core;
3. Spider (in large machines);
4. Winding;
5. Commutator. (broadly speaking).

Of the two types of armature, ring and drum, the latter is almost universally used, hence the examples of construction which follow will be confined chiefly to this type.

Shaft.—A typical armature shaft is shown in fig. 349. It is made of steel and, except in the smaller machines, is thicker in the middle than at the ends for stiffness to withstand the

strong magnetic side pull on the core when the latter is, slightly, nearer one pole piece than the other.

Ques. What is the object of providing shoulders on the shaft as in fig. 349?

Ans. They serve to keep the armature in the proper position with respect to the bearings.

Ques. How is the shaft proportioned?

Ans. If it be proportioned to secure the proper stiffness, it will be found of ample size to resist the twisting strain.

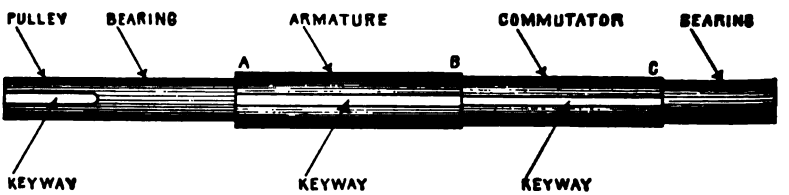


FIG. 349.—Typical shaft for an armature. The illustration shows the keyways for pulley, armature and commutator. In the smaller sizes, there is usually a flange at A, and threads at B and C for retaining nuts.

The shaft is subject also to bending by the weight of the armature, by the magnetic drag on its core, and in belt driven machines, by the lateral drag of the pulley. When running, it is also subjected to bending stresses if the armature be not properly balanced. If the bearings do not give, it is evident that all such actions tend to bend the shaft at definite points.

Core.—In the small and medium size dynamos, the core is attached direct to the shaft. There are two kinds of core:

1. *Smooth*;
2. *Slotted.*

Ques. What may be said of the smooth type of core?

Ans. It has become obsolete, except in special cases, as for machines used for electrolytic work where a large current at low voltage is required.

Ques. What is necessary with a smooth core?

Ans. Driving horns as later described.

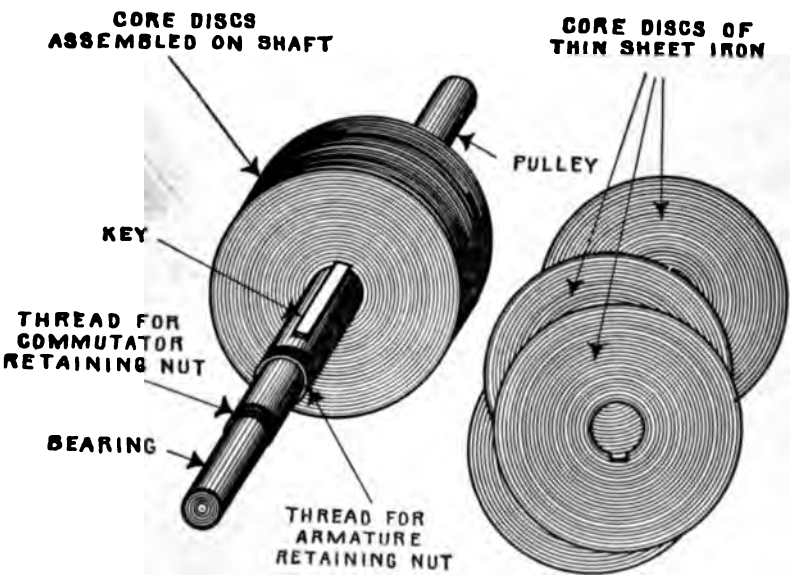


FIG. 350.—Laminated smooth core armature partly assembled. It consists of numerous discs of thin sheet iron threaded on the shaft and pressed together by end plates. The object of this construction is to prevent eddy currents.

Ques. What is a slotted core?

Ans. One having a series of parallel slots, similar to the spaces between the teeth of a gear wheel, and in which the inductors are laid.

Ques. What provision is made to avoid eddy currents in cores?

Ans. They are laminated.

Ques. Describe this method of construction.

Ans. The core is made of stampings of thin wrought iron or mild steel. The numerous discs stamped from the sheet metal are threaded on the shaft as in fig. 350, forming a practically solid metal mass.

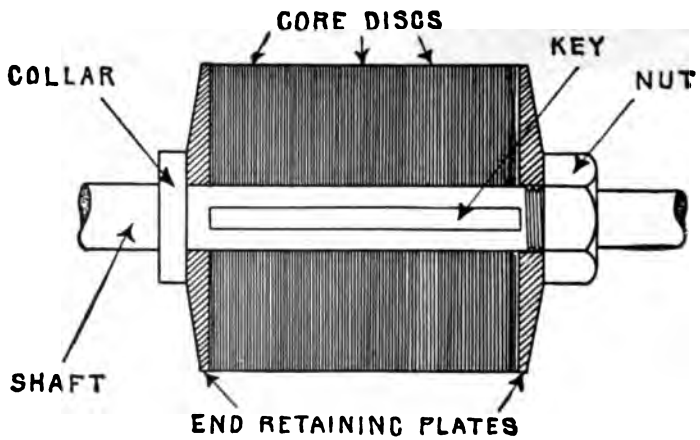


FIG. 351.—Sectional view of laminated smooth core armature showing end plates, flange and retaining nut. A key is provided to prevent rotation of the core with respect to the shaft.

Ques. How thick are the discs?

Ans. The thickness ranges from .014 inch to .025 inch, corresponding to 27 and 22 B and S gauge respectively, 27 gauge being mostly used.

***Ques.* How are the discs held in place?**

Ans. By two end plates pressed together either by large *nuts* screwed directly on the shaft as in fig. 351, or by bolts

passing through the core from end to end, as in fig. 352, holes being punched in the discs for the purpose.

Ques. What precaution is taken with respect to the core bolts?

Ans. They are insulated from the core by tubes and washers of mica or other insulating material.

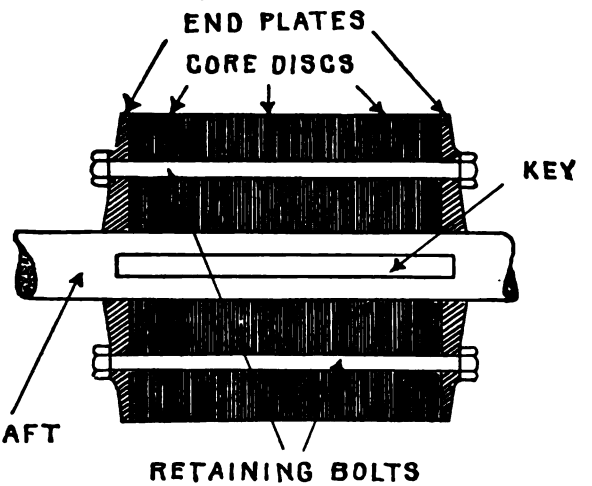


Fig. 352.—Laminated armature core with through retaining bolts. In the larger sizes, these bolts are used instead of a nut threaded on the shaft on account of the large size of the latter.

Ques. What is the construction of the core end plates, and why?

Ans. The rims are beveled quite thin to avoid eddy currents.


Ques. How is the core connected to the shaft?

Ans. Since the core has the full torque exerted upon it by the drag of the *inductors, it* must be firmly connected to the *shaft by means of a key,* as shown, so that it may be positively driven.

Core discs are stamped in one piece up to about 30 inches in diam and for larger sizes they are built up from sections as later descri

Figs. 353 and 354 show two forms of disc stamped in one piece. first illustrates a solid disc, and the second a *ventilated* disc in w more or less of the metal is cut away near the center, thus provi passages for the circulation of air which carries away some of the generated in the armature.

Insulation of Core Discs.—When the discs are stam from very thin metal, the mere existence of a film of oxid sufficient insulation. It is usual, however, to apply a qu

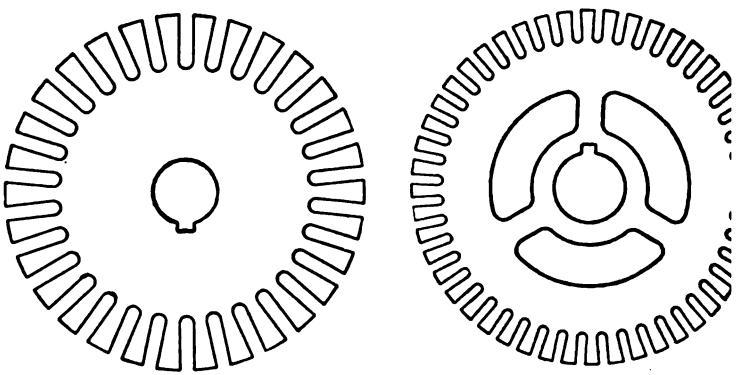

FIGS. 353 and 354.—Solid and ventilated core discs. In fig. 353, the metal cut away the center reduces the weight and provides passages for air circulation. In some inst a forced circulation is secured by means of a fan attached to the armature, as sho fig. 366.

drying varnish that will give a hard tough coat and not sof with heat or become brittle and crumble under vibration. varnish may be applied either by dipping or with a japann machine; it must be very thin, and the solvent employed sho be a very volatile spirit.

Forms of Armature Teeth.—The teeth stamped in the c *discs* are made in various shapes, depending largely on

method of securing the inductors in the slots against electromagnetic drag and centrifugal force. The teeth may be cut with their sides:

1. Inclined;
2. Projecting;
3. Notched.

Ques. What may be said of teeth with inclined sides?

Ans. A tooth of this type is shown in fig. 356, being slightly narrower at the root than at the top, the resulting slot having parallel sides.



FIG. 355.—Western Electric slotted armature core. The laminations are of sheet steel, annealed and japanned. They are mounted directly on the shaft, (except in the large sizes) and held in place by substantial end plates.

Ques. What are the features of the projecting type of tooth?


Ans. The projecting type is shown in figs. 357 and 358 in which the tops project; this gives a larger core area around the circumference of the armature which reduces the reluctance of the air gap, and *provides* projecting surfaces for retaining the *inductors in the slots by* the insertion of wedges.

Ques. What is the object of cutting notches in teeth?

Ans. They are provided for the insertion of retaining wedges, as in fig. 361; this results in less area at the top of the teeth.

Ques. How should teeth be proportioned to secure most efficient operation?

Ans. The width of the tooth should be about equal to the width of the slot minus twice the thickness of the slot insulation;

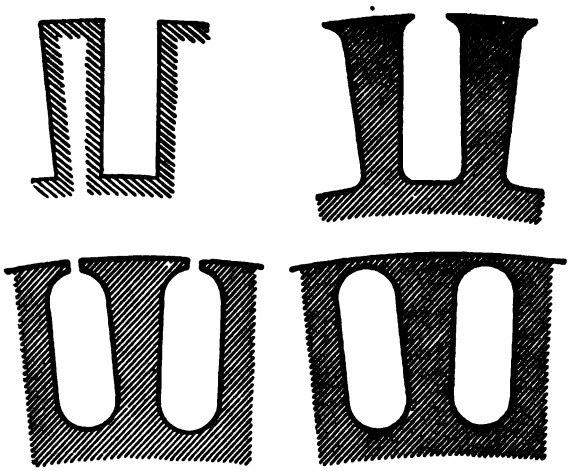


FIGS. 356 to 359.—Various forms of armature teeth; fig. 356 inclined type forming a slot with parallel sides; figs. 357 and 358 projecting type which provides a support for the retaining wedges; fig. 359 enclosed type which forms "tunnels" for the inductors.

that is, the cross sectional area of the teeth should be equal to that of the slots.

Advantages and Defects of Slotted Armatures.—The *slotted* armature, sometimes called the Pacinotti armature, after its inventor, has the following advantages over the smooth type



1. The inductors are held more firmly in place to resist stresses due to electromagnetic drag and centrifugal force;
2. The inductors are protected by the teeth against mechanical injury;
3. Less reluctance of the air gap;
4. The intermittent induction due to the presence of the teeth prevents the formation of eddy currents.
5. When the teeth are saturated they oppose the shifting of the lines due to armature reaction.

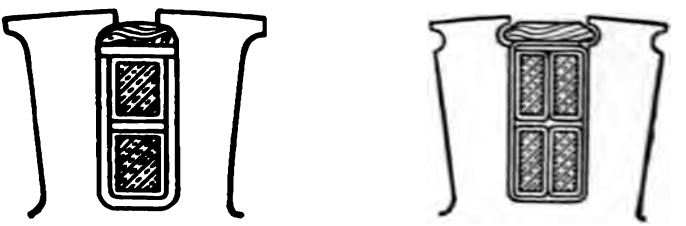

FIGS. 360 and 361.—Projecting and notched teeth; cross sections showing inductors and retaining wedges in place.


The disadvantages of slotted armatures compared with the smooth type are:

1. Greater hysteresis loss, caused by denser flux in the teeth;
2. Generation of eddy currents in the polar faces when the latter are not of laminated construction;
3. Greater self-induction in the armature coils;
4. Construction more expensive;
5. Leakage of magnetic lines through core, exterior to winding.

The generation of eddy currents in the polar faces may be overcome by making the air gap at least 50 per cent. of the distance between the teeth, *so that the magnetic lines* can spread from the corners of the teeth, *and become nearly uniformly* distributed over the polar faces. Magnetic *leakage through the core* may be reduced by making the amount of *metal above the inductors* very small.

Slotted Cores; Built Up Construction.—In the case of large dynamos, the core discs are built up in order to reduce the cost of construction; the following parts are used:

1. Spider;
2. Core rings split into sections.

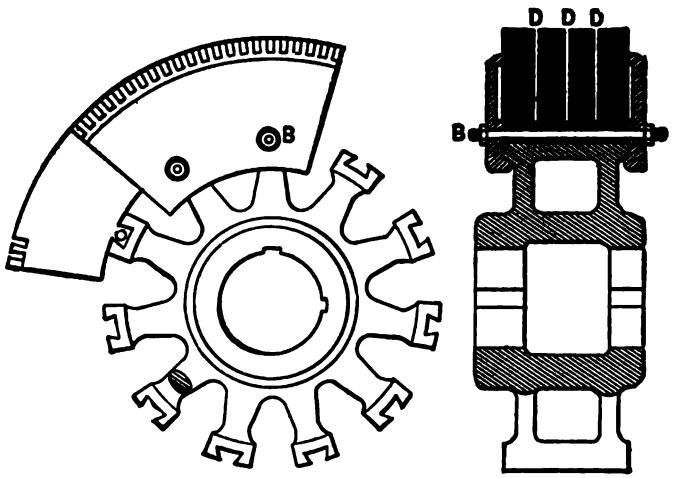

FIGS. 362 and 363.—Side and end view of built up armature core. The sheet metal ring sections containing the teeth are fastened into dovetail notches in the spider as shown. The layers of ring sections are placed so as to break joints and are held by end clamps and through bolts B. Distance pieces are inserted at intervals to provide ventilating spaces D, D, D.

Ques. What is the approved method of core construction in large armatures?

Ans. The core should be of the built up construction to avoid waste of material in the stampings.

***Ques.* Describe the construction of a built up core.**

Ans. Ring sections stamped from sheet metal are fastened to a central support or spider, which consists of an iron hub

with radiating spokes and a rim with provision for fastening the rings. The rim of the spider is provided with dovetail notches into which fit similarly shaped internal projections on the core segments. These features are shown in figs. 362 to 364. Each layer of core sections is placed on the spider so as to break joints and the core thus formed is firmly held in place by end clamps as shown. The manner of fastening the rings to the

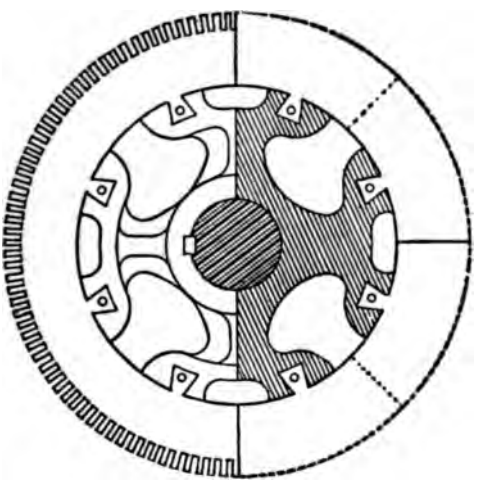


FIG. 364.—Built up core with four spoke spider, each spoke carrying two dovetail notches In this construction a little more air space is obtained for ventilation than where a separate spoke is provided for each notch.

spider is an important point, for it must be done without reducing the effective cross section of the core in order not to choke the magnetic flux.

In order to secure a better fit and reduce the machine work, the *spider hub in large machines* is sometimes cored with enlarged section *between the outer bearing* surfaces, and it is not unusual to find these *surfaces turned to two* different sizes as in fig. 365, to admit of easier *erecting.*

To avoid any trouble that may arise by unequal expansion, the rim of the spider is not made continuous, but in several sections as shown in fig. 364. The rim here consists of four sections each of which has two dovetail notches. By thus dividing the rim into sections, its weight is somewhat reduced and the ventilating spaces between the sections increased.

Ventilation.—In the operation of a dynamo more or less heat is generated, depending on the load; hence it is desirable that provision be made to carry off some of this heat to prevent excessive rise of temperature.

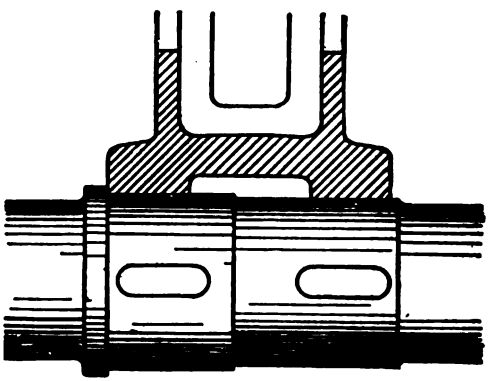


FIG. 365.—Hub and shaft design on large machines to reduce the machine work and facilitate erecting.

Ques. Why do armature cores heat?

Ans. They heat from these causes: eddy currents, hysteresis, and heat generated in the inductors.

***Ques.* How is adequate ventilation secured?**

Ans. The spider is constructed with as much open space as *possible* through which air currents may circulate. The core



FIG. 366.—Western Electric barrel wound armature, having a fan attached at one end to induce a circulation of air for ventilation.

is divided into several sections with intervening air spaces D as shown in fig. 363, the discs being kept apart at these points by distance pieces. These openings between the discs are called *ventilating ducts;* they are usually spaced from 2 to 4 inches apart.

Ques. What other provision is sometimes made to secure ventilation?

Ans. In some machines a forced circulation of air is secured by means of a fan attached to one end of the armature as shown in fig. 366.

Insulation of Core.—Before the winding is assembled on the core, the latter should be thoroughly insulated. Japan or enamel insulation is not sufficient because it is liable to have bubbles or minute holes in it, or be pierced by particles of metal or by the rough edges of the core discs. Two or more layers of strong paper, fibre, canvas or mica, should be applied to the

core before placing the inductors in position. The ends of the core should be insulated with thicker material, since the strain upon it is greater, especially at the edges.

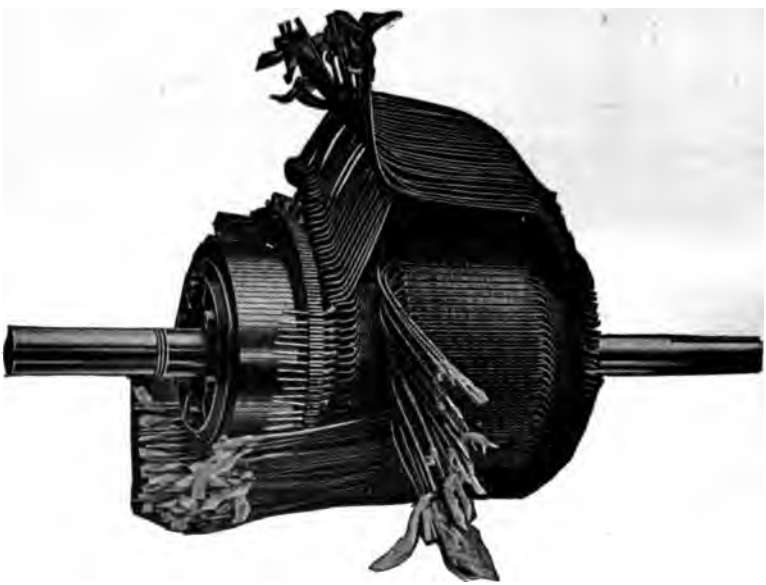


FIG. 367.—Holzer Cabot partially wound barrel wound armature, showing arrangement of coils. The core is built up of thin discs of soft annealed steel, which are slotted to allow the wire to sink below the surface, this being sometimes called *iron clad construction*. The discs are held by end plates, clamped without through bolts. The coils are machine formed of round ribbon or bar copper depending on the size and purpose of the machine, being without joint except at the commutator. They lie in insulated troughs, the upper layers being insulated from the lower layers by fibre.

Armature Windings.—The subject of windings has been fully treated from the theoretical point of view in chapter XVIII. *It remains* then to explain the different methods employed in the *shop* and the mechanical devices used to construct the scheme of *winding* adopted.

Ques. What is the construction of the inductors?

Ans. They are made of copper; the ordinary form consists of simple copper wire, insulated with a double or triple covering of cotton, and in some cases copper bars are used for large current machines.

Ques. What is the objection to copper bars?

Ans. They are liable to have eddy currents set up in them as illustrated in fig. 291.



FIG. 368.—Holzer Cabot iron clad band wound armature complete; view showing openings for ventilation. The advantage of the form of winding adopted, is the ease with which a coil may be replaced in case of injury and the additional cooling surface. The coils are held in place by maple wedges secured by binding wires which are soldered throughout their length.

Ques. What may be said with respect to the sizes of wire used for inductors?


Ans. Wire larger than about number 8 B and S gauge (.1285 inch diameter) is not easily handled, hence for large inductors, two or more wires may be wound together in parallel.

According to the mechanical features and manner of assembling on the core, drum windings may be divided into several classes, as follows:

1. Hand winding;
2. *Evolute or butterfly* winding;

3. Barrel winding;
4 Bastard winding;
5. Former winding.

Hand Winding.—The first windings were put on by hand, and proved objectionable on account of the clumsy overlapping of the wires at the ends of the armature, which stops ventilation

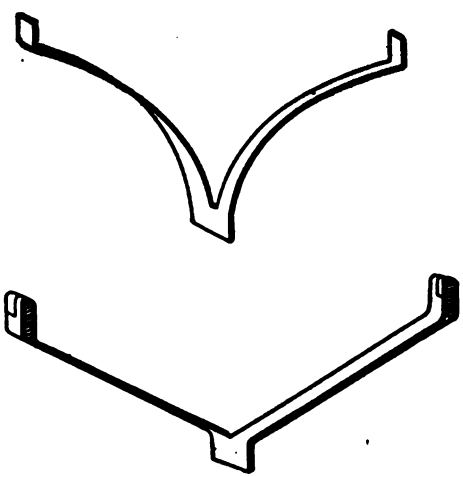

FIGS. 369 and 370.—Evolute and "straight out" connectors. In small machines the connectors must be curved as in fig. 369, but in large machines, especially where the teeth are wide, they may be straight as in fig. 370. These connectors may take either of the following forms: 1. *involute or evolute connectors*—An involute is the curve drawn by the extremity of a piece of string which is unwound from a cylinder; 2, *spiral connectors*—These consist of double spirals, the commutator being usually connected to the junction of the two spirals. These connectors are also known as "butterfly" connectors.

and hinders repairs, while the outer layers overlying those first wound, bring into close proximity inductors of widely varying *voltage*. The method is still used in special cases and for small *machines*. Such a winding has rarely, if ever, been made with one continuous wire.

Evolute or Butterfly Winding.—This mode of winding, was introduced by Siemens for electroplating dynamos to overcome the objections to hand winding. It takes its name from the method of uniting the inductors by means of spiral end connectors as shown in fig. 374, also in figs. 369 and 370, which show more modern forms.



FIG. 371.—Holzer Cabot armature; rear view showing back head and coil guard. The construction of core and winding is described in fig. 367. The shaft is of crucible steel ground to gauge. The commutator segments are of drop forged copper in the smaller and hard-drawn copper in the larger sizes. The insulating material between the segments is mica. On the larger sizes, the commutator shell is fitted with a thread and mounted on a spider. This construction provides openings between the commutator and shaft for ventilation.

Ques. What are evolute connectors?


Ans. The fork shaped strips used to connect bars at different positions on the armature, as shown in fig. 369.

In large machines, especially where the teeth are wide, these connections may be straight, but in small cc machines they must be curved in the manner shown in the upper part of the figure, as the room available may diminish by as much as half, as the lowest point is reached, and the room occupied by the strip is the width of a horizontal section at various points. This width, in the case of the straight connections, is constant.

In *place of the* wooden block, used in early machines, for fastening *the middle part of* the connectors, they may be anchored to an insu*lated clamping* device built up like a commutator and for that reason *called a false commutator.*

Ques. How are the inductors arranged in evolute winding?

Ans. In fig. 373, it will be seen that the ends of the evolute connectors lie in two planes, hence the inductors must project to different distances beyond the core. Accordingly, one long and one short bar may be conveniently placed in each slot, side by side. In large machines, especially where the teeth are wide,

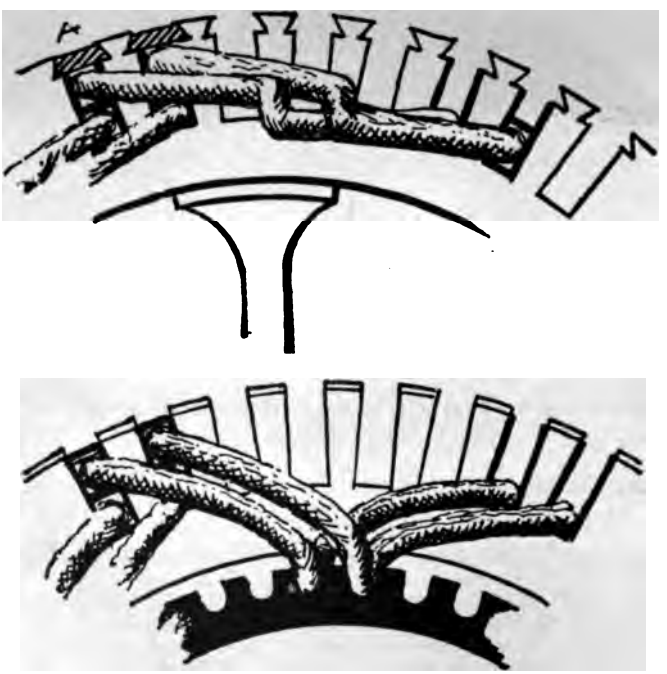


FIGS. 372 and 373.—*Barrel* and *evolute* windings; end views showing placement of coils. *When* all the coils are wound on the former, the placing of them on the armature is a simple *matter.* After insulating the slots, the winder begins at any convenient slot, and inserts *the coils* as shown. Before he can fill all the slots, some of the first coils must be raised and *the last* ones inserted underneath. There is not much difference between barrel and *evolute* winding and one style may be used at one end of the armature and the other at the *opposite* end.

the connectors may be straight as in fig. 370. Evolute connectors may be used for either lap or wave windings.



FIG. 374.—Siemens' bar armature; end view. Each inductor in the form of a bar is connected to the next by means of two evolute spiral copper strips, one bending inwardly, the other outwardly, their junction being in some cases secured to a block of wood upon the shaft. Their outer ends are attached to the bars by rivets or silver solder.

Barrel Winding.—This is a form of drum winding *in which the inductors are arranged in two layers and carried out obliquely on an extension of the cylindrical surface of the drum to meet and connect with radial risers.*

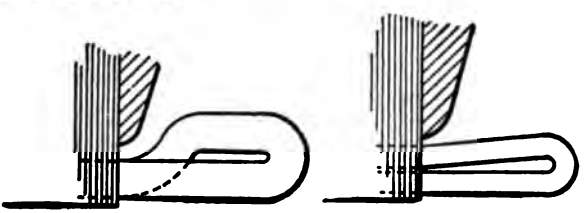

FIGS. 375 and 376.—*Single layer* and double layer barrel winding. Barrel winding is a method *of arranging the ends of* armature coils as they pass from one pole to the next, in which, *instead of using involute* or *butterfly* connections, V-shaped end connections are used which *lie on a cylindrical surface*, which is a continuation of the armature surface. The coil *ends must of necessity* be arranged in two layers, but the method may be used for either one *or two coils per slot*, the difference in arrangement for these is here illustrated.

Barrel winding has been very widely adopted. Although it involves an increased length of armature, this gives additional cooling surface and provides for good ventilation.

In barrel winding, the coil ends must of necessity be arranged in two layers but the method may be used for either one or two coils per slot, the difference in arrangement for these two cases being shown in figs.



FIG. 377.—Westinghouse barrel wound armature. The coils are former wound from copper strap and are interchangeable. In the larger size machine they are of the single type. The illustration shows plainly the characteristic feature of barrel winding, namely the oblique end connectors carried out on the extended drum.

375 and 376. In the single layer barrel winding, fig. 375, each slot is occupied by but one side of one coil. In the double layer barrel winding, fig. 376, the opposite sides of two separate coils occupy space in the same slot. The coils, on emerging from the slots bend in opposite directions, and if one side of a coil occupy the bottom portion of a slot, its other side usually occupies the top portion of a slot distant from the first slot by the polar pitch.

Bastard Winding.—In this type of winding, the end connectors project from the inductors in straight lines parallel to the shaft and then are bent inward. It has the

effect of being somewhat shorter than the barrel winding. In order to secure better ventilation, it is usual to combine a bastard winding at the rear end of the armature with a barrel



FIG. 378.—Rear end of Westinghouse wave-barrel wound armature; view showing ventilation.

winding at the commutator end. This class of winding is used only with bar armatures.


Former Winding.—This relates to a method of winding coils, and not to any particular type; that is, mechanical winding as distinguished from hand winding. While hand winding is necessary *for ring armatures*, a drum armature is wound better *and more easily by* the aid of machinery.

Ques. What is a "former" coil?

Ans. A former coil, as its name suggests, is one that is wound complete upon a former before being placed upon the armature.

Ques. What is the advantage of this method of winding coils?

Ans. By the use of formers much time is saved, thus reducing the cost, and also by their use all the coils are symmetrical which improves the appearance of the finished winding.

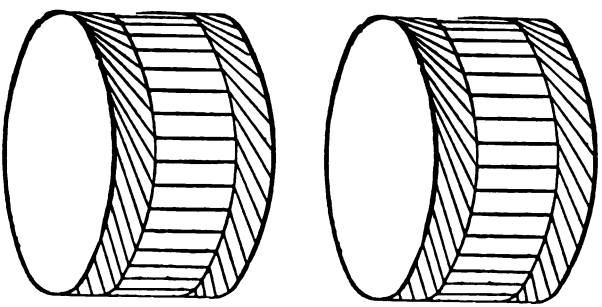

FIGS. 379 and 380.—Diagrams illustrating lap and wave barrel windings.

Ques. How is the required shape of the template or former for winding the coils determined?


Ans. By winding one coil on the armature in order to ascertain its dimensions and shape; it is then removed from the armature and used as a pattern in constructing the former.

Types of Former Coil.—Of the numerous shapes of former coil, mention should be made of:

1. Evolute coils;
2. Straight out coil

***Ques.* Describe the evolute type of former coil.**

Ans. The evolute coil is wound around eight pins inserted in a board as shown in fig. 381. The required number of turns are taken around these pins and their ends G and H left projecting. The coil thus formed is now covered with tape and after removal from the board, is put into a clamp at C and F, and opened up as shown in fig. 382, which is the form required for insertion in the proper slots of the armature.

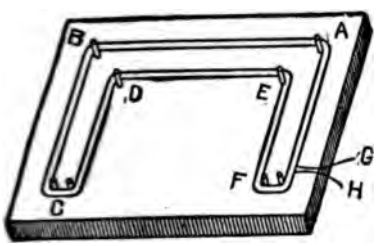

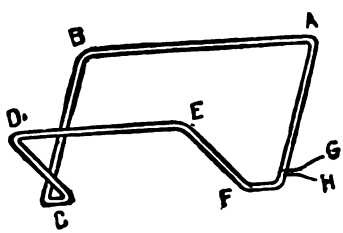


Fig. 381.—Method of winding evolute coils. In preparing the former, it is necessary to know the dimensions of the coil, hence, a pattern coil must first be made, from which the spacing of the pins can be taken so that the completed coil will fit into the slots for which it is intended. After the pins have been properly spaced on the board, the wire is wound around them as indicated, as many turns being taken as decided on for each coil. When the coil is thus completely wound, it is taken from the pins, and the lower ends, C and F, placed in a suitable clamp. The two halves of the coil are then spread apart, the coil assuming the shape illustrated in fig. 382.

Fig. 382.—Appearance of an evolute former wound coil opened out. The points A, B, C, etc., correspond to similar points in fig. 381.

Ques. What is the peculiarity of the evolute coil?

Ans. The two sides of the evolute coil have unequal dimensions. The part marked AB, in fig. 381 which is an upper layer inductor is longer than the part DE, which constitutes a lower layer inductor. The portions DC and EF act as parts of an inner layer of evolutes, and the portions AF and BC as parts of an outer layer of evolutes. These features are shown in fig. 382.

Ques. How are evolute coils placed on the core?

Ans. They are placed in position as shown in figs. 372 and 373, continuing around the core until all the slots are filled. To complete the operation it is necessary to raise some of the first laid coils and insert the last ones below them. The winding is thus completed and is symmetrical.

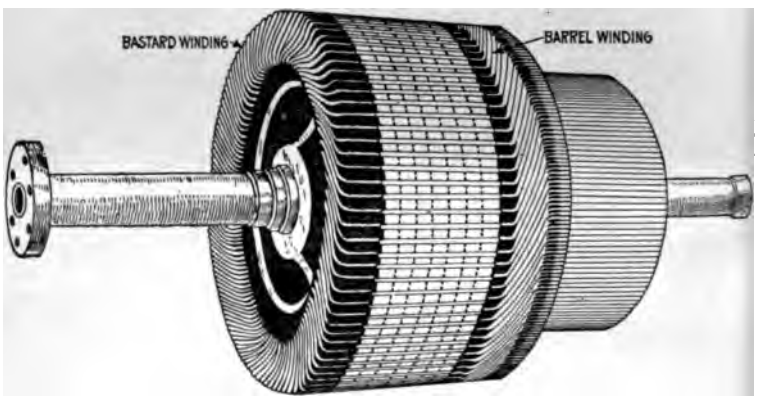


FIG. 383.—Westinghouse combination bastard and barrel winding. A bastard winding at the rear end is combined with a barrel winding at the commutator end, as shown in the illustration, to secure better ventilation.

Ques. Describe the method of winding the "straight out" type of former coil.

Ans. The straight out coil may be wound on a former such as shown in fig. 384. This consists of a board having four upright pins, A, B, D, E, properly spaced and two horizontal pins C, F, attached to extensions at each end of the board. A coil of the required number of turns is wound around these pins and then opened out as in fig. 385. After varnishing and baking it is ready to be placed on the armature.

Ques. For what class of winding are straight out former coils suitable?

Ans. For barrel winding.

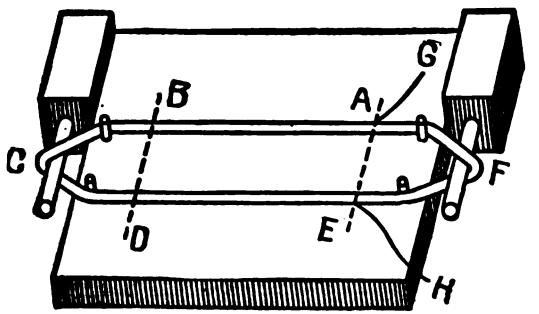


FIG. 384.—Method of winding "straight out" coils. There are several ways of making these coils. A former may be prepared, as shown in the figure, with a board having inserted four pins, and having attached two blocks at the ends carrying horizontal pins as shown. Around the several pins, the coil is wound to the required number of turns and taped. This coil differs from the evolute coil in that the two halves are of equal size, the parts which act respectively as upper and under inductor being of equal length. The coil as shown is suitable for wave winding.

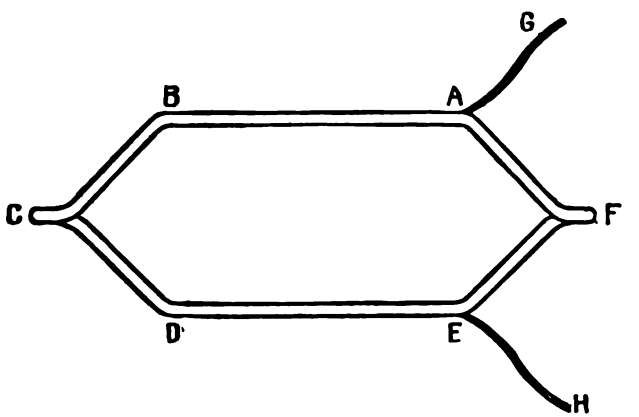


FIG. 385.—Appearance of straight out coil after being opened out. In opening out the coil, the ends C and F are put into a clamp and twisted at right angles to the plane of the coil. The letters correspond to the points indicated in fig. 384.

Ques. How are straight out coils placed on the core?

Ans. In the same manner as described for evolute coils; when in position straight out coils appear as in fig. 372.

Ques. What is the approved method of putting tape on a coil?

Ans. Considerable time is saved by the use of a machine designed for the purpose, such as shown in fig. 387.

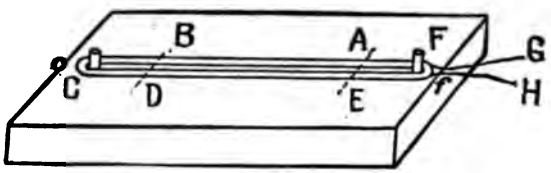


FIG. 386.—Another and simpler method of winding a "straight out" coil. A board with only two pins is employed as shown; this plan, however, gives more trouble in the subsequent opening out of the coil.

The construction of these machines is such that a roll of tape placed on a split metal ring is revolved around the coil to be taped, the coil being gradually moved until it is entirely covered.

Coil Retaining Devices.—In the operation of a dynamo there are two forces which tend to throw the inductors out of position:

1. Armature drag;
2. Centrifugal force.

Both of these forces are present with smooth core armatures, *but only* centrifugal force with slotted armatures. The devices *used to* hold the inductors in position against these forces are

1. Driving horns;
2. Binding ribbons;
3. Retaining wedges.

Ques. What are driving horns?

Ans. They are simply pins or strips projecting from the surface of a smooth core as shown in fig. 251.

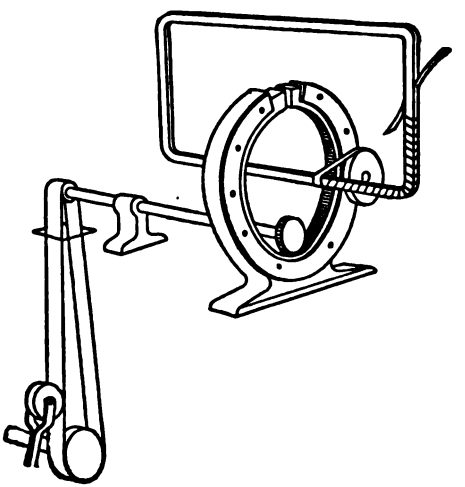


FIG. 387.—Armature coil taping machine. Numerous machines have been invented for taping armature coils. They consist essentially of a device which revolves a roll of tape around the coil, in such a direction that the tape is unwound from the roll and rewound on the coil. The speed at which the coil is fed through the machine will determine the overlapping of the tape.

Ques. What other kinds of retainer are used on smooth core armatures?

Ans. They require several binding ribbons or brass bands placed around *the winding* to prevent the inductors being thrown *off the core by centrifugal* force.

Ques. With slotted armatures what provision must be made for retaining the inductors in position?

Ans. Retaining wedges must be inserted into the notches or between the projecting tops of the teeth.



FIG. 388.—Front view of large armature for direct connected dynamo, built by the General Electric Co.

Ques. How are the wedges made?

Ans. They are usually made of well baked hard wood, such as hornbeam, or hard white vulcanized fibre. Sometimes a springy strip of German silver is used.

CHAPTER XXIII

MOTORS

An electric motor is just the reverse of a dynamo; it is *a machine for converting electrical energy into mechanical energy.* The electrical energy delivered by the dynamo must be obtained from a steam engine, gas engine, or other power; the mechanical energy obtained from the motor comes from the energy of the current flowing through its armature.

Ques. What is the construction of a motor?

Ans. It is constructed in the same manner as a dynamo.

Any machine that can be used as a dynamo will, when supplied with electrical power, run as a motor, and conversely, a motor when driven by mechanical power, will supply electrical energy to the circuit connected to it. Dynamos and motors, therefore, are convertible machines, and the differences that are found in practice are largely mechanical; they arise chiefly from the conditions under which the motor must work. Hence, the study of the motor begins with a knowledge of the dynamo, and accordingly the student should understand thoroughly all the fundamental principles of the dynamo, as already given, before proceeding further with the study of the motor.

Principles of the Motor.—All the early attempts to introduce motors *failed, chiefly* because the law of the conservation *of energy was not fully* recognized. This law states that energy *can neither be created nor destroyed.*

Early experimentors discovered, by placing a galvanometer in a circuit with a motor and battery, that, *when the motor was running, the battery was unable to force through the wires so strong a current as that which flowed when the motor was standing still.* Moreover, the faster the motor ran, the weaker did the current become.

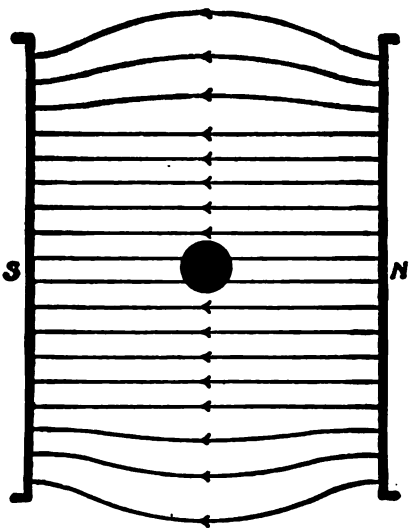


FIG. 389.—Conductor, lying in a magnetic field and carrying no current; the field is not distorted whether the conductor be at rest or in motion.

Ques. Why does less current flow when the motor is running than when standing still?

Ans. Because the motor, on account of its rotation acts as a *dynamo* and thus tends to set up in the circuit a *reverse electromotive force*, that is, an electromotive force in opposite direction to the current which is driving the motor.

Ques. What is the real driving force which causes the armature of a motor to rotate?

Ans. *The propelling drag*, that is, the drag which the magnetic field exerts upon the armature wires through which the current is flowing, or in the case of deeply toothed cores, upon the protruding teeth.

The Propelling Drag.—In fig. 389 is shown the condition which prevails when a conductor carrying no current is placed in a uniform magnetic field. The magnetic lines pass straight from one pole to the other. The field is not distorted whether the conductor be at rest or in motion, so long as there is no flow of current. This represents the condition in the air gap of a motor or dynamo, when no current is flowing in the armature.

Ques. What happens when a current flows in the conductor of fig. 389.

Ans. It sets up a magnetic field of its own as shown in fig. 390.

Ques. What is the effect of this magnetic field?

Ans. It distorts the original field (fig. 389) in which the conductor lies, making the magnetic lines denser on one side and less dense on the other as in fig. 390.

Ques. What is the nature of these distorted magnetic lines?

Ans. They tend to shorten themselves to their original form of straight lines.

Ques. What effect has this on the conductor?

Ans. It produces a force on the conductor tending to push it in the direction indicated by the arrow, fig. 390.

The distorted magnetic lines may be regarded as so many rubber bands tending to straighten themselves; The result then is clearly to force the conductor in the direction indicated.

According to Lenz' law, the direction of the current in the armature of a dynamo is such as to oppose the motion producing it. When the armature of a dynamo is rotated, the bending of the lines of force of


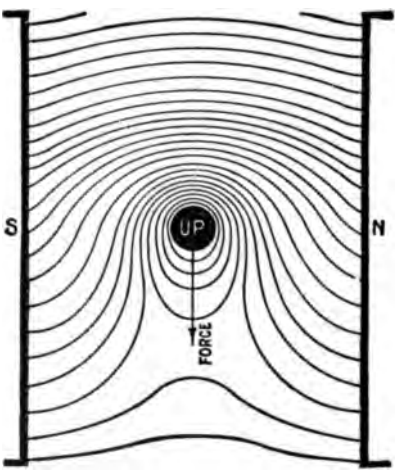


FIG. 390.—Conductor carrying a current in a magnetic field. The current flowing in the conductor sets up a magnetic field which distorts the original field as shown, making the magnetic lines denser on one side and less dense on the other. This results in a force upon the wire, which, in the case of a dynamo (fig. 391) opposes its movement, and which forms the *propelling drag* in the case of a motor (fig. 392).

the main magnetic field due to armature reaction acts as a drag against the motion of the armature. Armature reaction increases with the *increase* of the armature current. Therefore, the effect of the drag *increases* with the increase of load and requires an additional expenditure of power to drive the armature.

In a motor, the direction of the actuating current is the reverse of that of the armature current of a dynamo, consequently, the armature

reaction which constitutes a drag, acting against rotation of the armature of a dynamo, becomes a pull in the direction of rotation of the armature of a motor and constitutes its real turning effect or *torque* which is used at the pulley to do mechanical work. The greater the load applied to the motor, the greater will be the amount of current taken from the supply mains, and consequently, the greater the *torque*.

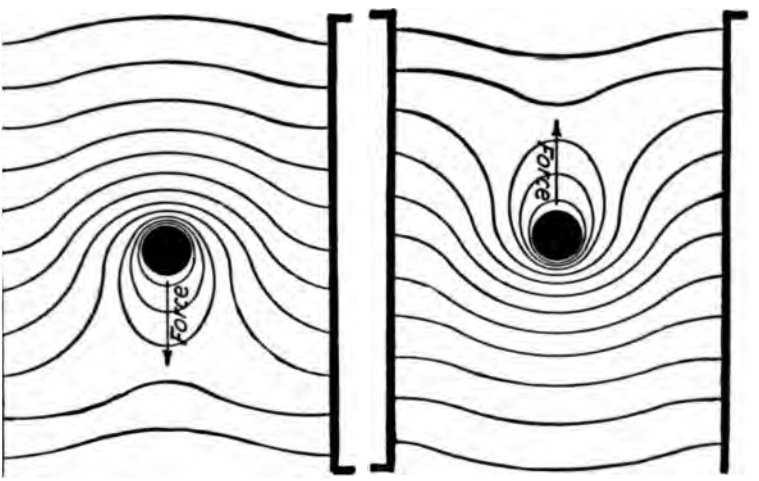

s. 391 and 392.—Action of the magnetic force in a dynamo and motor. In the first instance, according to Lenz' law, the direction of the current induced in the wire is such as to oppose the motion producing it. In the operation of a motor, the current supplied in flowing through the armature winding distorts the field and thus produces rotation. In the figures, the direction of the force is clearly indicated by remembering that the distorted lines of force act like rubber bands tending to straighten and shorten themselves.

Ques. What are the essential requirements of construc-n in a motor?

Ans. They are: 1, a magnetic field, 2, conductors placed rpendicular *to the field*, and 3, provision for motion of the *nductors across the field* in a direction perpendicular to both *nselves and the field.*

The Reverse Electromotive Force.—When an electric current flows through some portion of a circuit in which there is an electromotive force, the current will there either receive or give up energy, according to whether the electromotive force acts *with* or *against* the current.

This is illustrated in fig. 395, which represents a circuit in which there is a dynamo and a motor. Each is rotating clockwise, and accordingly, each generates an electromotive force tending upward

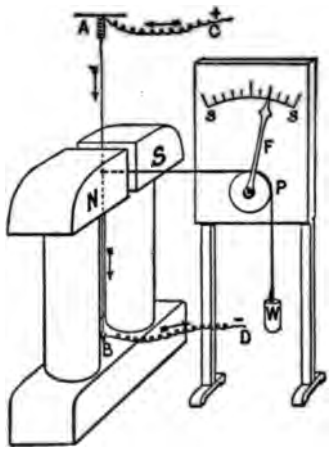


FIG. 393.—Force exerted on a current carrying conductor placed across a magnetic field. Let N, S, be the pole pieces of an ordinary electromagnet, having their faces flat and with only a narrow air gap between. In this gap is stretched the vertical copper wire A B, kept taut by a strong spring at A; current can be passed into the wire from the leads C and D. Attached to the wire in the middle of the gap is a horizontal cord passing over a pulley P and kept taut by a weight W; the pulley carries a pointer F which moves in front of a scale *s s*. If the electromagnet be now excited and have the polarity indicated, it will be found that on passing a strong current *down* the wire, the index F moves toward the *right*, showing a similar movement in the wire. The index returns to zero when the current in the wire ceases, and moves in the opposite direction if the current in the wire be reversed and sent *up* instead of down. The experiment can be further varied by reversing the magnetizing current of the electromagnet.

from the lower to the upper brush. In both cases the upper brush is *positive*. In the dynamo, however, where energy is being supplied *to* the circuit, the electromotive force is in the same direction as the current, and in the motor, where work is being done, the electromotive force is in the reverse direction to that of the dynamo.

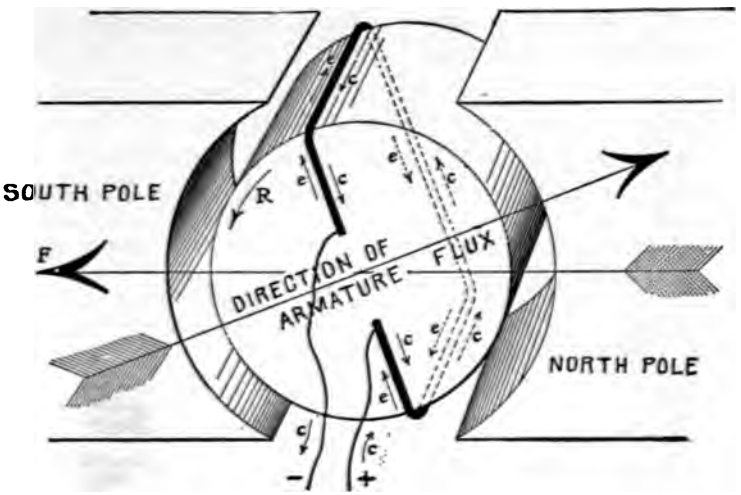


FIG. 394.—Showing relative directions of armature current and reverse electromotive force of a motor. When a motor is in operation, the wires around the periphery of its armature "cut" the magnetic lines of force produced by the field magnet exactly as in the case of the dynamo. Consequently, an electromotive force is induced in each wire, as in the dynamo armature. This induced electromotive force is in opposition to the flow of current due to the electromotive force of the supply circuit, and tends, therefore, to keep down the flow of current. The figure shows a single loop of wire, on the armature core connected directly to the source of electricity. With current flowing in the loop in the direction indicated by the arrows marked *c*, a magnetic field is set up in the direction indicated by the large arrow marked "direction of armature flux." With the field magnet energized so as to produce a field in the direction indicated by the large arrow F, the reaction between the two fields will turn the armature core in the direction indicated by the arrow R. As the core turns, the upper wire of the loop will cut the flux under the south pole of the field magnet, and the other side of the loop will cut the flux under the north pole. The result will be the induction of a reverse electromotive force in the loop, the direction being indicated by the small arrows marked *e*. The actual flow of current in the armature is that due to the difference between the impressed and reverse voltage; the latter is proportional to the speed of the armature, the number of armature wires and the strength of the magnetic field in the air gaps between the armature and the pole faces. The speed of a motor supplied with current at constant voltage varies directly with the reverse electromotive force, also with other conditions fixed, the stronger the field, the slower the speed. Weakening the field will increase the speed up to the point where the increase in reverse electromotive force due to the increased speed cuts down the armature current below the value necessary to give the requisite pull at the armature periphery. When this point is reached, any weakening of the field will reduce the speed of the armature. The pull or *torque* of a motor armature is directly proportional to the strength of the magnetic field, and to the strength of the armature current, the number of armature inductors being fixed. In a field of constant strength, therefore, the pull of the armature depends on the amount of current passing through the winding. The torque *must be just sufficient* to overcome the load; if in excess, the speed will *increase until the increase of* the reverse electromotive force reduces the current and the *increase of speed increases* the load to the point of equilibrium between load and torque. *If the torque be insufficient for* the load, the speed will diminish until equilibrium is *established, assuming the motor* is running on constant voltage circuit.

Ques. Describe similar conditions which prevail in operation of a dynamo.

Ans. When no current is being generated by the dyn little power is required to drive it, but when the external ci is closed and current is forced through it against more or resistance, work is being done, hence more power is requ


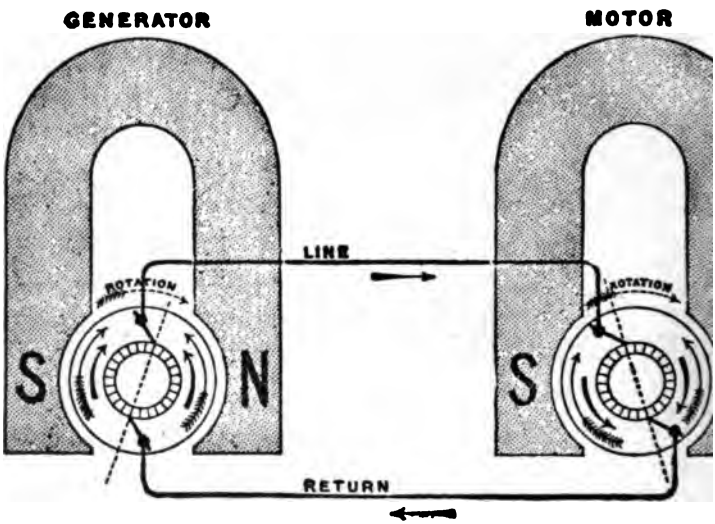


FIG. 395.—Circuit with generator and motor. Whenever current flows through some of a circuit in which there is an electromotive force, the current will there either or give up energy according to whether the electromotive force acts *with* the or *against* it. In the figure, the generator and motor are rotating clockwise, and each generates an electromotive force tending upwards from the lower brush to the In each case the upper brush is the positive one. In the dynamo, where en being supplied to the circuit, the electromotive force is in the same direction as the c while in the motor where work is being done and energy is leaving the circuit, the motive force is in a direction which opposes the current.

In other words, there is an opposition to the mechanical *applied at* the pulley which is proportional to the electric p *delivered by* the dynamo. An opposing reaction or reverse *then is* set up in a dynamo when it does work.

Ques. In the operation of a motor what is the nature of the reverse electromotive force?

Ans. It is proportional to the velocity of rotation, the strength of the magnets, and to the number and arrangement of the wires on the armature, that is, the reverse voltage depends on the *rate* at which the lines of force are cut.

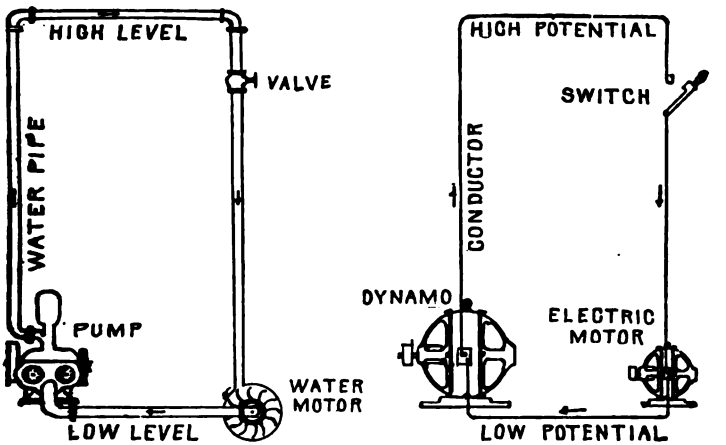

FIGS. 396 and 397.—Water and electric circuits. Diagrams showing comparison between wate. motor and electric motor.

In the diagrams :

The pump	corresponds to the	dynamo.
The high level pipe	" " "	positive conductor.
The low level pipe	" " "	negative conductor.
The valve	" " "	switch.
The water motor	" " "	electric motor.
The water pressure (called head)	" " "	electric pressure (called voltage).
The flow in gallons per minute	" " "	amperes.
The size of pipe	" " "	size of conductor.
The foot pounds	" " "	watts.

The greater the difference between the height of the two pipes the higher the pressure, and the greater the difference between the pressures of the two conductors the higher the voltage. The larger the diameter of the pipes the less resistance is offered to the flow of water, and *the larger the diameter* of the conductors the less resistance is offered to the *flow of electricity. The more* water required by the water wheel, the more power is *required to drive the pump. The more* electricity required by the motor the more power *is required to drive the generator.*



FIG. 398.—Fairbanks-Morse standard TR type motor. This type is built in the smaller sizes and the design is such that the motor can be installed upon the floor, wall or ceiling, the bearing yokes being attached to the frame by four equally spaced bolts so that they can be turned to provide for proper operation of the oiling devices in either position. A substantial base is provided with a thrust screw for adjusting the belt tension. This base has clamping bolts which permit adjusting the position of the motor while suspended. There is a cast ring type frame having steel side pieces which press firmly together, the steel laminations making up the pole pieces. The field coils armature, and armature coils are illustrated in detail in figs. 399 to 401. The commutator bars are of drawn copper, insulated with mica. The lugs which extend outward from the bars to receive the lead wires from the armature windings are formed in one piece with the bars, and are of the full width of the bars with the insulator extending outward between them, so that when assembled a solid flange is formed to receive the armature connections. Self-oiling bearings are provided and the location of the bearing sleeves in the housing is adjustable so that the armature may be centered in the magnetic field. The brush rigging is carried on a skeleton rocker supported in a groove, turned in the edge of the frame. The brush holders are of the box type with independently adjustable tension spring for each. Standard shunt windings are for 115, 230 and 550 volts. The compound wound motors operate at approximately the same full load speeds as the shunt wound, but the no load speeds will be about 20 per cent. higher than the full load speeds. They have, however, the ability to exert a more powerful starting effort than shunt motors without drawing such a heavy current from the line, and are, therefore, especially adapted for driving apparatus [illegible] frequently started and stopped under load and where close speed regulation is not required.

Ques. Describe an experiment which shows the existence of a reverse electromotive force in a motor.

Ans. The apparatus required consists of a small motor, battery, and ammeter. They should be connected in one circuit and the deflection of the ammeter observed when the armature is held stationary, and when it rotates with various loads.

In an experiment of this kind made on a motor with separately excited magnets, the following figures were obtained:

Revolutions per minute	0	50	100	160	180	195
Amperes	20	16.2	12.2	7.8	6.1	5.1



FIG. 209.—Fairbanks-Morse field coil and pole piece. The field coils are wound upon iron forms, each layer treated with insulating compound. Afterward they are removed from the forms and baked hard and dry and finally wrapped with insulating materials; all but the three smaller sizes are wrapped with a protecting cord. The series and shunt coils of the compound winding here shown are wound separately, the smaller one being the series coil and the larger the shunt coil.

Apparently, if the motor had been helped on to run at 261½ revolutions per minute, the current would have been reduced to zero. In the last result obtained, the current of 5.1 amperes was absorbed in driving the armature against its own friction at the speed of 195 revolutions per minute.

Ques. Explain the action of the current supplied to a motor for its operation.

Ans. The motor current passing through the field magnets polarizes them and establishes a magnetic field, and entering the armature, *polarizes its* core in such a way that the positive

pole of the core is away from the negative pole of the magnetic field, and the negative pole is away from the positive pole of the magnetic field. The magnetic repulsions and attractions thus created cause the armature to rotate in a position of magnetic equilibrium or so as to bring its positive and negative poles opposite the negative and positive poles respectively of the magnetic field. It is evident that unless suitable means were provided to reverse the polarity of the armature core at the



FIG. 400.—Fairbanks-Morse armature for 7½ H.P., 1300 R.P.M., TR type motor. The armature core is built up of thin sheet steel laminations with notches in the circumference, which, when the discs are placed together, form grooves or slots to receive the armature coils. The armature cores for the larger machines are mounted on a cast iron spider, which also carries the commutator, making the two parts entirely self-contained, and with this construction, it is possible to remove the armature shaft, without disturbing the core, commutator or windings. Cores of all sizes are provided with ventilating spaces, running from the surface to the central opening of the core, so that air is drawn through the core and blown out over the windings by the revolution of the armature.

instant it reached the position of the magnetic equilibrium, the armature would not rotate any further. The construction is such that the polarity of the armature core, or the direction of the current in the armature coils is reversed at the proper instant automatically by the commutator, thus giving continuous rotation.

***Direction* of Rotation of Motors.**—In the case of either a motor, or a dynamo used as a motor, the direction in which the armature will rotate is easily found by the left hand rule, a

illustrated in fig. 411, when the polarity of the field magnets and the direction of currents through the armature are known.

Ques. How may the rotation of a motor be reversed?

Ans. By reversing either the current through the fields, or the current through the armature.

Ques. What will happen if both currents be reversed?

Ans. The motor will run in the same direction as before.

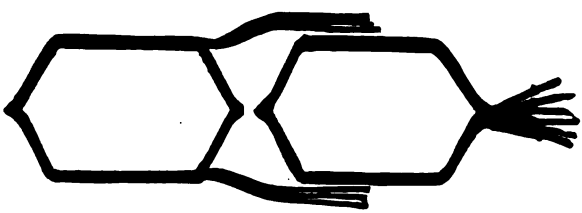



FIG. 401.—Fairbanks-Morse wire wound armature coils. These coils are form wound and are thoroughly insulated and baked before assembling in the slots. Material of great mechanical strength as well as high insulating value is used, and the coils are subjected to dippings in insulating compound and to bakings, thus driving out all moisture and making a coil which is practically waterproof and which will withstand rough handling. These coils, when completed, are placed in the slots, where they are retained by bands on the three smaller sizes and by hardwood wedges on the larger sizes.

Ques. What is the effect of supplying current to a series dynamo?

Ans. It will run in a direction opposite to its motion as a dynamo.

Ques. What is the result of reversing the direction of current at the terminals of a series motor?

Ans. *It will not* change its direction of rotation, since the *current still flows* through the armature in the same direction *as through the field.*

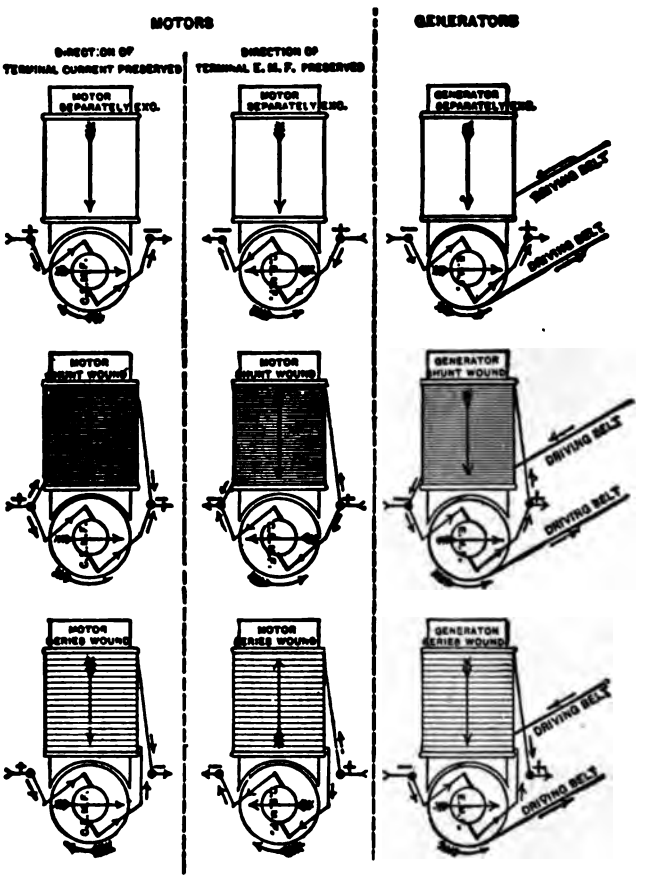

FIGS. 402 to 410.—Diagrams showing relative direction of rotation of motors and dyna
From figs. 391 and 392, it is seen that the direction of the current in a motor arma
must be such as will increase, by the flux it produces, the intensity at the *leading*
edge and decrease the intensity at the *trailing polar edge*. In a dynamo, the arma
has to be moved by mechanical force, against a magnetic force, hence the leading
edge is weakened, while the trailing edge is strengthened. The magnetomotive
in a motor armature is, therefore, opposed to the direction of that in a generator arm
when the direction of rotation and the direction of the field magnetomotive fo
the same. Upon this depends all the relations existing between the direction of
of a machine when acting as a motor or as a dynamo.

Ques. What is the behavior of a shunt dynamo when used as a motor?

Ans. Its direction of rotation remains unchanged.

Ques. Why is this?

Ans. Because if the connections be such that the current supplied will flow through the armature in the same direction as when the machine is used as a dynamo, the current through the field will be reversed, since the field windings are in parallel with the brushes.

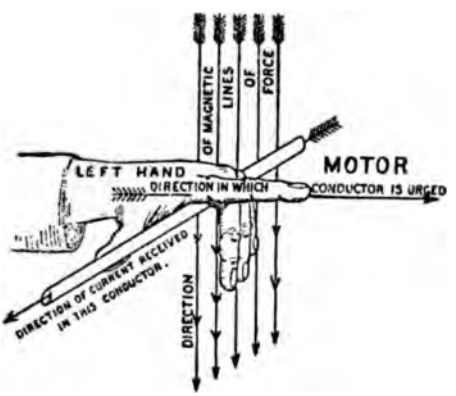


FIG. 411.—The "left hand rule" for direction of motion in motors. *Place the left hand, as shown, so that the thumb points in the direction of the current, the 3rd, 4th and 5th fingers in the direction of the lines of force, then will the 2nd or forefinger, at right angles to the others, point in the direction in which the conductor is urged.*

Armature Reaction in Motors.—In the operation of a motor the reaction between the armature and field magnets distorts the field in a similar manner as in the operation of a dynamo. A current supplied from an outside source magnetizes the armature of a motor and transforms it into a

electromagnet, whose poles would lie nearly at right angles to the line joining the pole pieces, were it not for the fact that *negative* lead must be given to the brushes.

Negative lead is the amount of backward advance of the brushes against the direction of the rotation of the armature, measured in degrees from the neutral plane.

If the brushes be given positive lead, that is, placed in advance of the neutral plane *in the direction of rotation*, the cross magnetizing force is converted into one that tends to increase that of the field magnet, while if they be given negative lead, it tends to demagnetise the field magnet.

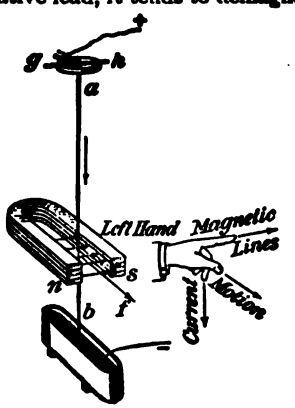


FIG. 412.—Principle of the electric motor as illustrated by experiment showing effect of a magnetic field on a wire carrying an electric current. Let a vertical wire *ab* be rigidly attached to a horizontal wire *gh*, and let the latter be supported by a ring or other metallic support as shown, so that *ab* is free to oscillate about *gh* as an axis. Let the lower end of *ab* dip into a trough of mercury. When a magnet is held in the position shown and a current from a cell is sent through the wire as indicated, the wire will move in the direction shown by the arrow *f*, that is, at right angles to the direction of the lines of magnetic force. Let the direction of the current in the wire be reversed, then the direction of the force acting on the wire will be found to be reversed also. The conclusion is that *a wire carrying a current in a magnetic field tends to move in a direction at right angles both to the direction of the field and to the direction of the current.* The relation between the direction of the magnetic lines, the direction of the current, and the direction of the force, is often remembered by means of the following rule, known as the *motor rule*, and which differs from the dynamo rule only in that it is applied to the fingers of the *left hand* instead of to those of the right. *Let the forefinger of the left hand point in the direction of the magnetic lines of force and the middle finger in the direction of the current sent through the wire, then will the thumb, at right angles to the other two fingers, point in the direction in which the wire is urged.*

Since with positive lead the armature polarity strengthens that of the field magnet, it is possible, disregarding sparking, to operate a motor without any other means being taken to magnetize the field magnets, because the armature will induce a pole in the field magnet and then attract itself towards this induced pole.

Ques. What effect has the cross magnetizing force on the field?

Ans. It tends to shift the field around in a direction opposite to that of the rotation.

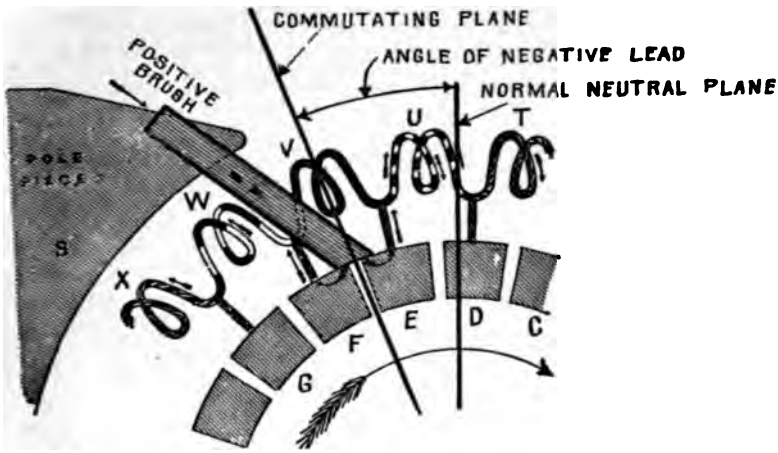


FIG. 413.—Current commutation in a motor. Considering the coil W which is ascending, current is flowing through it from the top brush, while it is itself the seat of an electromotive force that tends to stop or reverse its current. The condition for sparkless commutation requires that during the interval the coil is short circuited by the brush, the coil should be passing through a field that is not only sufficiently strong but one that tends to reverse the direction of its current. The coil is already in such a field, hence, commutation must take place *before* it passes out of this field. To accomplish this the brushes must be shifted backward, that is, given *negative lead*, to overcome sparking. In other words, the *commutating plane* must be shifted *back* of the neutral plane in a motor instead of being placed *in advance* as in a dynamo.

Ques. What are the conditions of minimum sparking?

Ans. The same conditions must obtain as in a dynamo, that is, the current in the coil undergoing commutation must be brought to rest and started again in the opposite direction. This involves that while the coil is short circuited by the brush, *it should be passing* through a field that tends to reverse the *direction of the current*. Since the coil is already in such

field, the act of commutation must take place before it passes out of this field. Accordingly, a negative lead must be given the brushes.

Method of Starting a Motor.—Although motors and dynamos are practically similar in general construction and either one of them will act as the other when suitably traversed by an electric current, there are certain differences between the

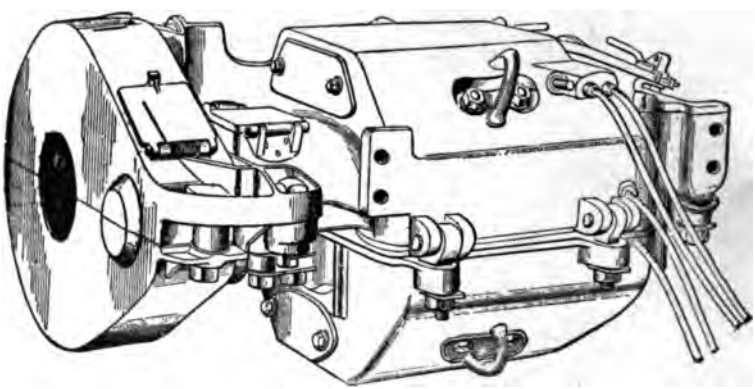


FIG. 414.—Railway motor. This type of motor, since it must operate under cars, has taken on the peculiar form under which it is most familiar. As illustrated, the case is of such shape that compactness and water proofing are secured, and the means of attachment to the car axle and support from the axle and truck frame are provided.

connections and accessories of a machine operated as generator and one employed as a motor. For instance, when a machine is operated as a dynamo, it is first driven up to speed until it has excited itself to the right pressure, and then it is connected to the circuit; but when a machine is used as a motor it will not start until it has been connected to the circuit, and this must not be done until the proper precautions have been taken to ensure that the current, which will pass through it when so connected, will not be excessive and thereby result in serious *injury* to the motor. For this reason a rheostat or variable

resistance, commonly called a starting box is usually inserted in the armature circuit of a motor to prevent an undue rush of current before the motor attains its speed, and subsequently the speed is regulated by the cutting in or out of the circuit of certain extra resistances which constitute the contro ler used on a series motor requiring variable torque at variable speed, as in the case of elevator or e.ectric traction service.

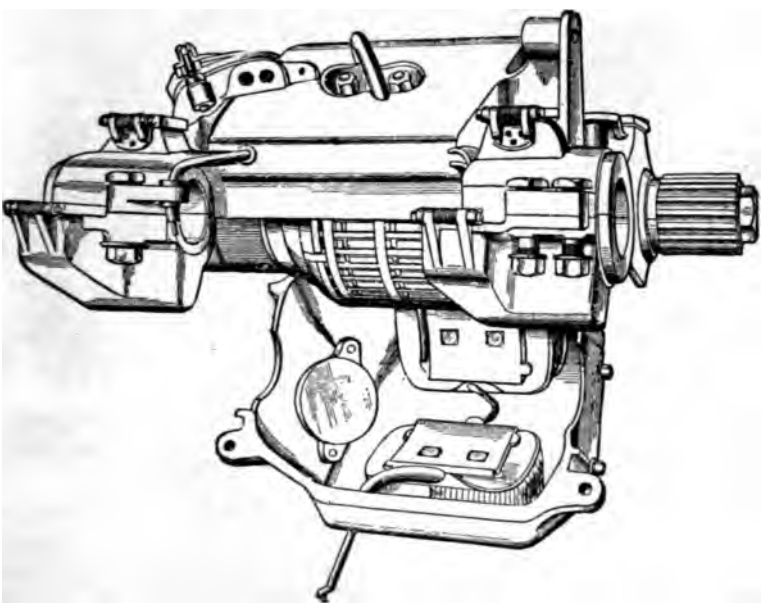


FIG. 415.—View of railway motor, open. The frame is of cast steel for lightness, and which serves as magnetic circuit and protecting case. It is circular or octagonal in form except in very large motors. Four short magnets project from the case. The armature is large in order to secure the required torque. It is always series wound, requiring two brushes. The brush holders are mounted upon a frame of insulating material which is attached to the upper half of the case. The brushes are adjustable radially, but usually it is not necessary to provide for shifting as they remain in the neutral plane. In motors which receive so little attention as these, special attention must be given to the design of devices for keeping oil and grease out of the case. These would injure the insulation of the coils and produce sparking at the commutator. Oil rings are, therefore, placed on the shaft, and these discharge into chambers connected to the oil wells or allow the oil to overflow on the track. The bearings are made self-oiling or self-greasing by means of rings or *wicks and will run for weeks* without attention.

Classes of Motor.—Motors are classified in the same manner as dynamos. The fields may be either bipolar or multi-polar, and with respect to the type of armature winding employed, motors are classed as:

1. Series wound;
2. Shunt wound;
3. Compound wound.

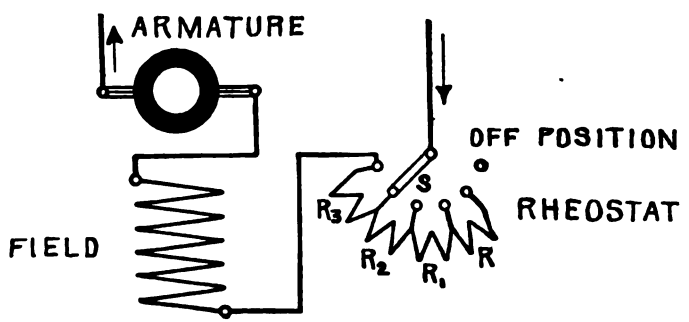


FIG. 416.—Series motor connections. A series motor on a constant voltage circuit does not have a constant field strength, and does not run at uniform speed. If the load be taken off it will run at excessive speed. To start the motor, the circuit is completed through a variable resistance or rheostat by moving the switch S so that the resistances R, R_1, R_2, R_3, are gradually cut out of the circuit. To stop, the switch S is moved back to its "off" position.

Series Motors.—A series motor is one in which the field magnet coils, consisting of a few turns of thick wire, are connected in series with the armature so that the whole current supplied to the motor passes through the field coils as well as the armature. Fig. 416 is a diagram of a series motor showing the connections and rheostat.

Ques. What are the characteristics of a series motor?

Ans. The field strength increases with the current, since the latter flows through the magnet coils. If the motor be run on a

onstant voltage circuit, with light load, it will run at a very igh speed; again, if the motor be loaded heavily, the speed will e much less than before.



IG. 417.—General Electric type CL–B motor for slow and moderate speeds. It is of multipolar construction, having six pole pieces. The advantages of slow speed machinery are generally understood, and in motors the additional outlay to secure slow speeds is warranted, inasmuch as it results in diminished wear and friction losses in gearing, belting, bearings, and commutators, and decreased brush renewals. The comparatively slow speeds of these motors are of importance in that they permit belting or gearing the motors directly to ordinary slow speed line shafting without employing intermediate counter shafting. When motors are geared to heavy duty machines, it is considered better practice to supply an outboard bearing to take up the additional strain that would otherwise be put on the gearing and bearing.

Ques. For what kinds of service are series motors unsuited?

Ans. Series motors should not be employed where the load may be entirely removed because they would attain a dangerous speed. They *should not* be used for driving by means of belts.

because a sudden release of the load due to a mishap to the belt would cause the motor to "run away."

Very small series motors may be used with belts since their comparatively large frictional resistance represents an appreciable load, restraining the motor from reaching a dangerous speed.

Ques. For what service are series motors adapted?

Ans. For gear drive.

In the case of a sudden release of the load the gears provide some load on account of the frictional resistance of the gear teeth.

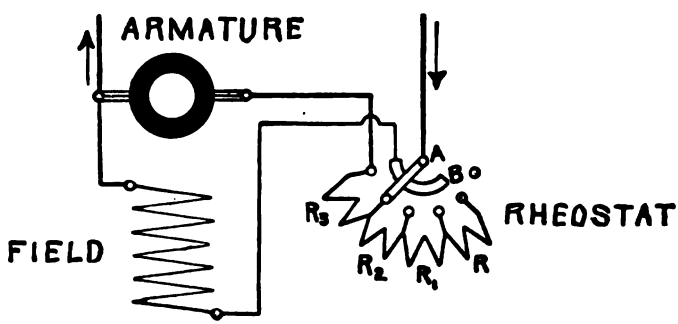


FIG. 418.—Shunt motor connections. A shunt motor runs at constant speed on a constant voltage circuit. In connecting the motor in circuit, the field coils must be placed in circuit first, so that there is a certain amount of field strength to produce rotation of the armature and thus prevent excessive current through the armature. If the field magnets were not put in the circuit first, the armature, at rest on receiving current, would probably burn out, because it is of low resistance, and would take practically all the current supplied, especially since no reverse voltage is generated in the armature at rest. The method of starting is shown in the illustration. To start, the switch is closed, and the rheostat lever pushed over so as to make contact with A and B, thus *first* exciting the magnets. On further movement of the lever, the rheostat resistances R, R_1, R_2 R_3, etc., are gradually cut out as the speed increases, until finally all the resistance coils are cut out. To stop, the lever is brought back to its original position.

Ques. What advantage is obtained with series motors with respect to the connections?

Ans. A single wire only proceeds from the rheostat to the *motor*, so that, with the return wire, only two wires are required.

Ques. For what service are series motors specially adapted?

Ans. Series motors are used principally for electric railways, trolleys, and electric vehicles, and similar purposes where an attendant is always at hand to regulate or control the speed. They are also used on series arc light circuits in which the current is of constant strength. Very small motors are generally provided with series windings.



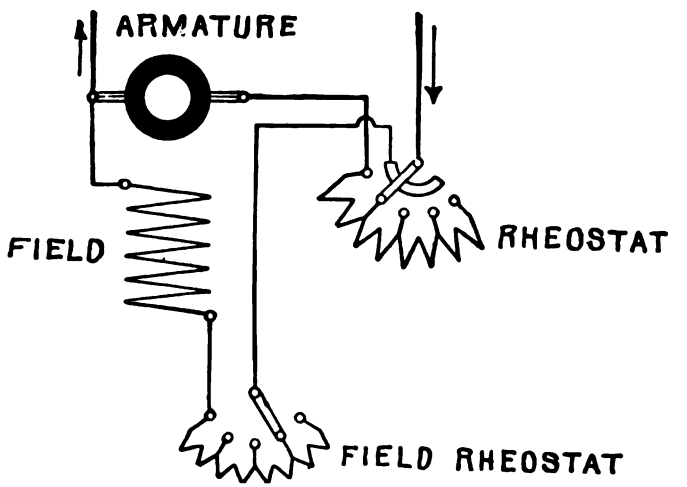


FIG. 419.—Speed regulation of a shunt motor. The speed of a motor depends on the voltage of the current supplied and the field strength. The motor tends to rotate so fast as to produce a *reverse voltage* nearly equal to that supplied to the brushes; hence, the speed varies with the voltage supplied. By decreasing this voltage then, the speed is decreased. Accordingly, the speed may be reduced by inserting, by means of a rheostat, a resistance in series with the motor. By inserting this resistance in the field circuit, the voltage at the terminals of the motor is lowered, thus giving the condition necessary to reduce the speed. The arrangement for speed regulation shown in the figure includes a starting regulator and a shunt regulator.

Shunt *Motors.*—*A shunt* motor may be defined as one in *which the field coils* are wound with many turns of compara*vely fine wire,* connected in parallel with the brushes. Th

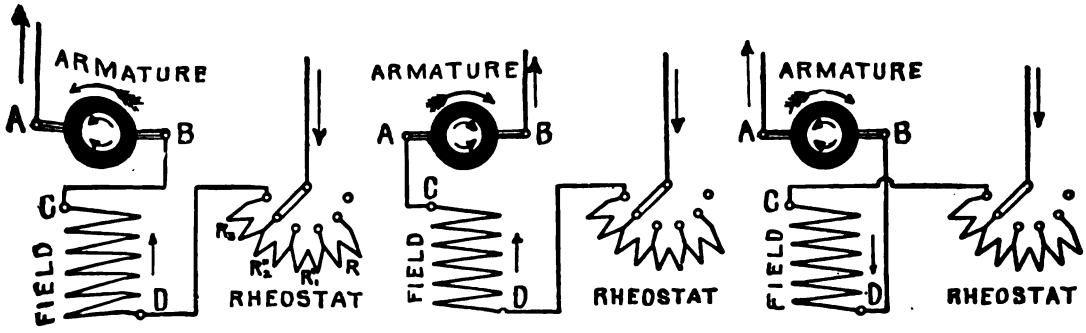

FIGS. 420 to 422.—Reversing the direction of rotation of a series motor. Fig. 420 shows the connections for counter clockwise rotation. The motor may be reversed: 1, by allowing the current to flow in its original direction (from D to C) in the field magnet coils, and altering the direction of the armature current by changing the two connections on the brushes A and B, thus connecting C to A and B to the return wire as in fig. 421, or 2, by leaving the direction of the current in the armature in its original direction, and reversing that of the field current, as in fig. 422. If the wires leading to the rheostat and motor directly, were reversed there would be no reversal of the motor, because by so doing, both the armature and field magnet currents would be reversed.

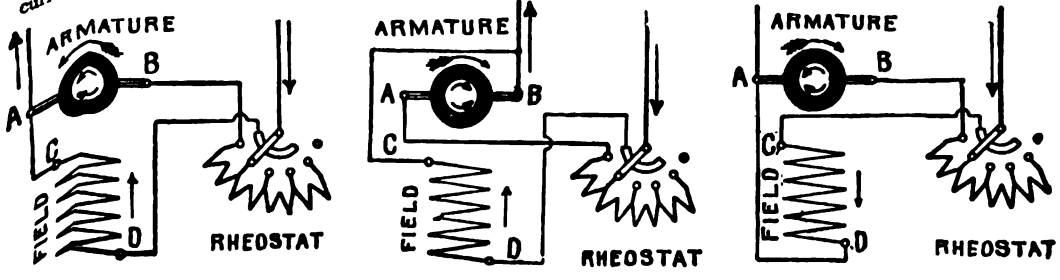

423 to 425.—Reversing the direction of rotation of a shunt motor. Fig. 423 shows the connections for counter clockwise

current then is offered two paths: one through the armature, and one through the field coils.

Ques. What may be said with respect to the speed of a shunt motor?

Ans. It is practically constant with varying loads.

The variation of speed ranges from $\frac{1}{10}$ to 5 per cent., except in the case of small motors, in which the variation may be much greater.

Ques. How should a shunt motor be started?

Ans. To properly start the machine, the field coils must be fully excited.

It is, therefore, necessary to switch the magnet coils immediately on to the voltage of supply, while a variable resistance must be provided for the armature circuit. To get both connections at the same time, rheostats for shunt motors are arranged as shown in fig. 418.

Influence of Brush Position on Speed.—In the case of a shunt motor supplied with current at constant pressure, the speed is a minimum when the brushes are in the neutral plane, and the effect of giving the brushes either positive or negative lead is to increase the speed, especially with little or no load.

Ques. Why does the speed increase?

Ans. When the brushes are shifted from the neutral plane, the reverse voltage between the brushes is decreased, speed remaining unchanged. Accordingly, the pressure in the supply mains forces an increased current through the armature thus producing an increased armature pull which causes the speed to increase until the reverse voltage reaches a value sufficiently large to reduce the current to the value required to supply the necessary driving torque.

Compound Motors.—This type of motor has to a certain extent, the merits of the series motor without its disadvantages, and is adapted to a variety of service. If the current flow in the same direction through both of the field windings, then the effect of the series coil strengthens that of the shunt coil; this strengthening is greater, the larger the armature current.

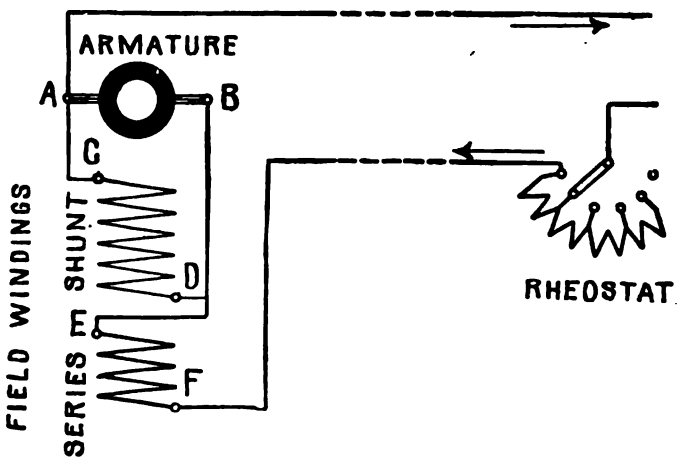


FIG. 426.—Compound motor connections for starting from a distant point. A compound winding may be used on motors for many different purposes. If the current flow in the same direction through both windings, then the effect of the series coil strengthens that of the shunt coil. This strengthening increases with the load. Thus the motor gets, at increasing load, a stronger magnetic field, and will therefore, if the voltage remain constant, run slower than before. Accordingly, for a given current, the starting power will be greater than that of a shunt motor. With a decreasing load the motor will run faster. The compound motor has, to a certain extent, the merits of the series motor without its disadvantages. By means of compound motors the starting at a distance with only two mains may be effected, just as in the case of the series motor. The connections are shown in the diagram. If the motor be regarded as being without the shunt coil, then it is connected up exactly as the series motor in fig. 416. The current coming from the starter enters the series coil at F, flows through the series coil and leaves it at E, flowing from there to the armature brush B, through the armature to brush A, and from there through the second main back to the generator. The shunt winding is connected directly with the armature brushes A and B, and gets at starting, therefore, only a very small voltage, hence its field is nearly ineffective. But on account of the series winding, the motor starts *as a series* motor. Obviously such a motor will not develop a very large starting power *like a real* series motor, for, on account of the large space occupied by the shunt coils, *there is less* space available for the series coils than with a series motor. A compound *motor may*, however, even with this arrangement, be easily started, provided the load *on starting* be not too heavy. When once running the armature will produce a reverse voltage and the shunt coil will be supplied with nearly the full terminal voltage.

Ques. Mention some characteristics of the compound motor.

Ans. Since it is a combination of the shunt and series types, it partakes of the properties of both. The series winding gives it strong torque at starting (though not as strong as in the series motor), while the presence of the shunt winding prevents excessive speed. The speed is practically constant under all loads within the capacity of the machine.

Ques. Describe the connections for starting a compound motor at a distance.

Ans. Control at a distance can be effected with only two wires, just as in the case of a series motor. In the diagram fig. 426, the current coming from the rheostat enters the series coil at F, and leaves it at E, thence it flows to the armature brush B, through armature to brush A, and from here back to the dynamo. The shunt winding, which is connected across the brushes, gets a very small voltage at starting and is accordingly very ineffective. The motor then starts as a series motor. The starting effect is smaller than in a series motor because of the fewer turns in the series winding, most of the available space being occupied by the shunt coils.

Power of a Motor.—The word "power" is defined as *the rate at which work is done*, and is expressed as the quotient of the work divided by the time in which it is done, thus:

$$\text{power} = \frac{\text{work}}{\text{time}}$$

The difference between power and work should be clearly *understood.*

Work is the overcoming of resistance through a certain distance. It is measured by the product of the resistance into the space through which it is overcome, thus:

$$\text{work} = \text{distance} \times \text{space}$$

For instance, in lifting a body from the earth against the attraction of gravity, the resistance is the weight of the body, and the space, the height to which the body is raised, the product of the two being the work done.

The unit of work is the *foot pound*, which it *the amount of work done in overcoming a pressure or weight equal to one pound through one foot of space.*

The unit of power is the *horse power* which is equal to 33,000 *foot pounds of work per minute, that is*:

$$\text{horse power} = \frac{\text{foot pounds per minute}}{33{,}000}$$

The unit of power was established by James Watt as the power of a strong London draught horse to do work during a short interval, and used by him to measure the power of his steam engines.

In order to measure the mechanical power of a motor, it is necessary to first determine the following three factors upon which the power developed depends:

1. Pull of the armature, in pounds;
2. Distance in feet at which the pull acts from the center of the shaft;
3. Revolutions per minute.

EXAMPLE.—If the armature pull of a motor having a two foot pulley, be such that a weight of 500 lbs. attached to the rim, is just balanced, and the speed be 1,000 revolutions per minute, what is the horse power?

Here, the distance that the pull acts from the center of the shaft is one foot, hence for each revolution the resistance of 500 pounds is overcome through a distance equal to the circumference of the pulley or

$$\pi \times \text{diameter} = 3.1416 \times 2 = 6.2832 \text{ feet.}$$

The *work done* in one minute is expressed by the following equation:



FIG. 427.—General Electric type CQ Motor. These motors range in capacity from ¼ to 20 horse power. The small sizes are bipolar, and the larger sizes have four poles. For installations where the motor is exposed to dust, mechanical injury or moisture, it may be partially or entirely enclosed by means of hand hole covers. The standard voltages are 115, 230 and 550.

$$\left\{\begin{matrix}\text{work}\\ \text{per}\\ \text{minute}\end{matrix}\right\} = \left\{\begin{matrix}\text{weight}\\ \text{in lbs.}\end{matrix}\right\} \times \left\{\begin{matrix}\text{circumference}\\ \text{of pulley}\\ \text{in feet}\end{matrix}\right\} \times \left\{\begin{matrix}\text{revolutions}\\ \text{per minute}\end{matrix}\right\} = \text{foot pounds}$$

$$= 500 \times 6.2832 \times 1{,}000 = 3{,}141{,}600.$$

Hence, the power developed is

***3,141,600 ÷ 33,000 = 95.2* horse power.**

Ques. What is "brake" horse power?

Ans. The net horse power developed by a machine at its shaft or pulley; so called because a form of brake is applied to the pulley to determine the power.

Ques. Describe the apparatus used in making a brake test.

Ans. Tests of this kind are usually made with a Prony brake as shown in fig. 428. It consists of a band of rope or strip iron—

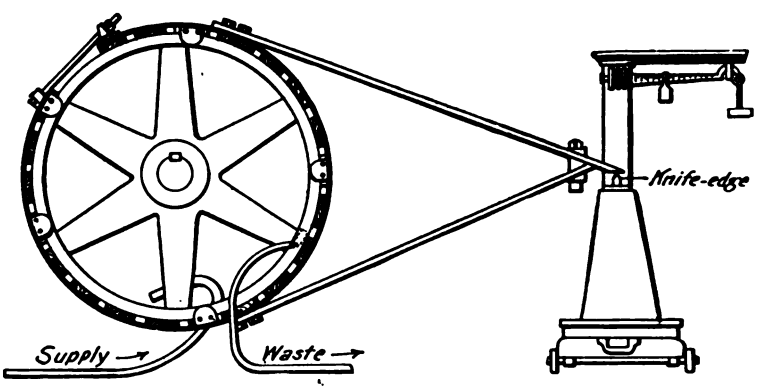


Fig. 428.—Prony brake for determining brake horse power. It consists of a friction band ring which may be placed around a pulley or fly wheel, and attached to a lever bearing upon the platform of a weighing scale in such a manner that the friction between the surfaces in contact will tend to rotate the arm in the direction in which the shaft revolves. This thrust is resisted and measured *in pounds* by the scale. In setting up the brake the distance between the center of the shaft and point of contact (knife edge) with the scales must be accurately measured, *the knife edge being placed at the same elevation as the center of the shaft.* An internal channel permits the circulation of water around the interior of the rim as shown, to prevent overheating.

the latter is the arrangement shown—to which are fastened a number of wooden blocks, several carrying shoulders to prevent the contrivance from slipping off the wheel rim. The brake band is drawn tight, as shown, so that the blocks press against the surface all around. The brake thus formed is restrained from revolving with the pulley by two arms attached near

top and bottom centers of the wheels, and joined at the opposite ends to form a lever which bears upon an ordinary platform scale, a suitable leg or block being arranged to keep its end level with the center of the shaft. By this arrangement the amount of friction between the brake band and the revolving wheel is weighed upon the scales. Since the brake fits tightly enough to be carried around by the wheel, but for the arms bearing upon the scale, the amount of frictional power exerted by the wheel in turning free within the blocks may be transmitted and measured, just as would be the case were a machinery load attached, instead of a friction brake.

Ques. Why must the point of contact of the brake with the scales be level with the center of the shaft?

Ans. In order to determine the force acting at right angles to the line joining the point of contact and center of the shaft.

Ques. What is the distance between the center of the shaft and point of contact with the scales called?

Ans. The lever arm.

Ques. What three quantities must be determined in a test in order to calculate the brake horse power?

Ans. The lever arm, the force exerted on the scales, and the revolutions per minute.

Ques. How is brake horse power calculated?

Ans. From the following formula:

$$B.\ H.\ P. = \frac{2\ \pi\ L\ N\ W}{33{,}000}$$

in which

B. H. P. = brake horse power;
L = lever arm, *in feet;*
N = number of revolutions per minute;
W = force *in pounds* at end of lever arm as measured by scales.

EXAMPLE—In making a brake test on a motor, the lever arm of the brake is 3 ft., and the reading of the scales is 30 lbs. When the motor is running 1,000 revolutions per minute, what is the brake horse power?

Substituting the given values in the formula,

$$\text{B. H. P.} = \frac{2\pi \times 3 \times 1{,}000 \times 30}{33{,}000} = 17.1$$

Now, if the voltmeter and ammeter readings be 220 and 65 respectively, what is the efficiency of the motor at this load?

The amount of power absorbed by the motor, or in other words, the *input* is

$$\text{E. H. P.} = \frac{220 \times 65}{746} = 19.16$$

and since the output is 17.1 horse power,

$$\text{efficiency} = \frac{\text{output}}{\text{input}} = \frac{\text{brake horse power}}{\text{electrical horse power}} = \frac{17.1}{19.16} = 89\%.$$

Speed of a Motor.—The normal speed at which any motor will run is such that the sum of the reverse electromotive force and the drop in the armature will be exactly equal to the electromotive force applied at the brushes. The drop in the armature *is the difference* between the applied voltage and the reverse *voltage.*

Mutual Relations of Motor Torque and Speed.—The character of the work to be done not only determines the condition of the motor torque and speed required, but also the suitability of a particular type of motor for a given service. There are three general classes of work performed by motors, and these require the following conditions of torque and speed:

1. Constant torque at variable speed;

Suitable for driving cranes, hoists, and elevators, etc., where the load is constant and has to be moved at varying rates of speed.

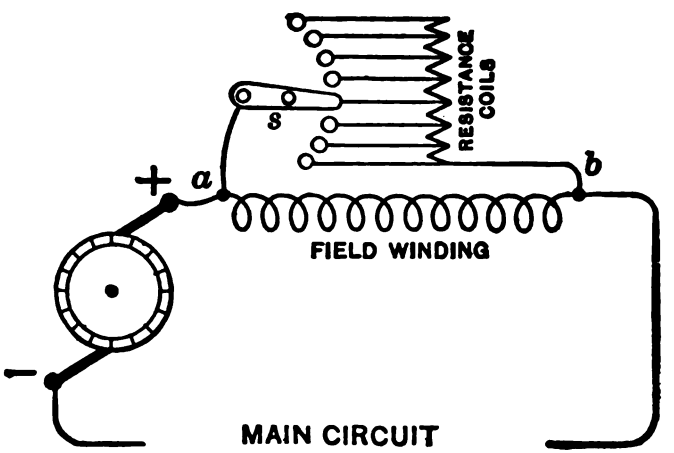


FIG. 429.—Two path method of speed regulation of series motor. A rheostat is connected in shunt to the field coils as shown. The current passing from *a* to *b* divides between the magnet coils and the rheostat coils; the higher the resistance of the rheostat the less current passes through it, and the more through the magnet coils, hence the stronger the field magnet.

2. Variable torque at constant speed;

Suitable for driving line shafting in machine shops, which must run at constant speed regardless of variations of torque due to variations *in the number* of machines in operation at a time, or the *character of* work being preformed.

3. *Variable* torque at variable speed.

Suitable for electric railway work. For example: when a car is started, the torque is at its maximum value and the speed zero, but as the car gains headway, the torque decreases and the speed increases.

Speed Regulation of Motors.—The speed of motors connected to constant voltage circuits is usually regulated by the two following methods:

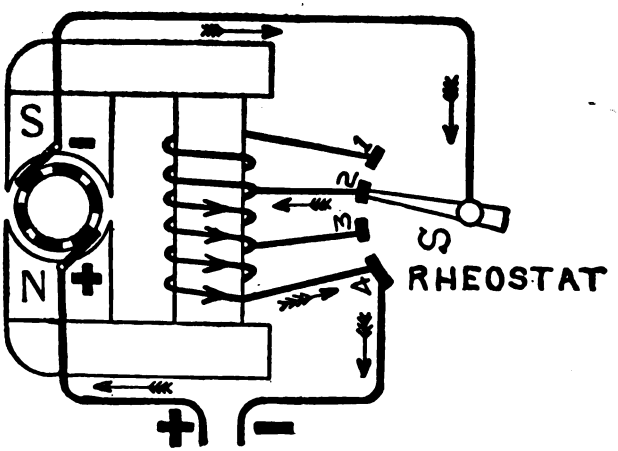


FIG. 430.—Variable field method of speed regulation of series motor. The field winding is divided into a number of sections with leads connecting with switch contact points as illustrated. The speed then is regulated by cutting in or out of the circuit sections of the field winding thus varying the strength of the field.

1. By inserting resistances in the armature circuit of a shunt wound motor;

2. By varying the strength of the field of a series motor.

The first method is sufficiently explained under fig. 418 and *the second* method is illustrated in fig. 430. The controller *switch S is* so arranged that a greater or lesser number of field *coils can* be inserted in the field circuit. When the switch arm is

on point 1, the motor current will flow through all the field windings, and the strength of the field will be at its maximum. When the switch arm is moved so as to successively occupy positions 2, 3, and 4, thus cutting out of circuit a greater and greater number of field coils the strength of the field will be gradually decreased until practically all of the motor current is led or wired through the armature. Under these conditions, when the field of a motor is at its maximum strength, the motor torque will be at a maximum for any given strength of current, and the reverse electromotive force will also be at a maximum for any given speed, therefore, when the field strength is increased the speed will decrease and *vice versa*.

Ques. What results are obtained by this method of regulation?

Ans. The speed of a series motor may be nearly doubled, that is, if the lowest permissible speed of the motor be 250 revolutions per minute it can be readily increased to 500 revolutions per minute by changing the field coil connections from series to parallel. It is on this account, as much as on their powerful starting torque, that series motors have been until recently almost exclusively employed for electric traction purposes.

Series Parallel Controller.—When two motors are used in electric railway work, their armatures are connected in series with each other and an extra resistance which prevents the passage of an excessive current through the armature before the *motor starts. As* the speed of the car increases, the extra *resistance is gradually* cut out of circuit and the field winding *onnections changed* from series to parallel by means of a serie

parallel controller, which finally connects each motor directly across the supply mains, or between the trolley line and the track or ground return.

Efficiency of a Motor.—The commercial efficiency of a motor is the ratio of the output to the input. As a rule, the power developed by a motor increases as the reverse voltage generated by it decreases, until this voltage equals one half of the voltage

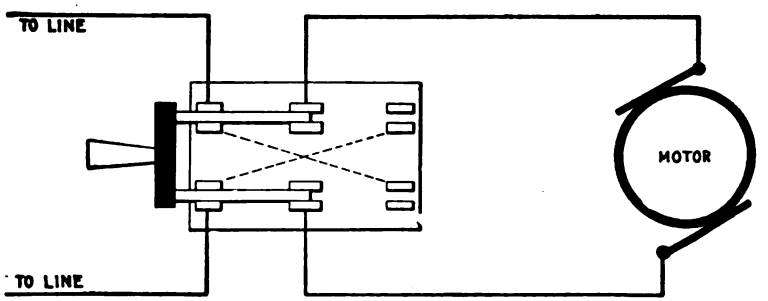


FIG. 431.—Double throw, double pole switch for reversing direction of rotation of a motor. The direction of rotation can be reversed by changing the direction of current in either the armature or the field coils. It is preferable, however, to reverse the direction of rotation by changing the direction of current through the armature. The switch is wired as shown, means of reversal being provided by running the wires as indicated by the dotted lines.

applied at the brushes. After this point is reached, the power developed by the motor decreases with the decrease of the reverse voltage. Therefore, a motor performs the largest amount of work when its reverse voltage is equal to one half the impressed voltage.

The efficiency of a motor as just stated is the ratio of the ***output*** to the input; this is equivalent to saying that the efficiency

of a motor is equal to the brake horse power divided by the electrical horse power.

The electrical horse power is easily obtained by multiplying the readings taken from volt meter and ammeter, which gives the watts, and dividing the product by 746, the number of watts per horse power. That is:

$$\text{Electrical horse power} = \frac{\text{volts} \times \text{amperes}}{746} = \frac{\text{watts}}{746}$$

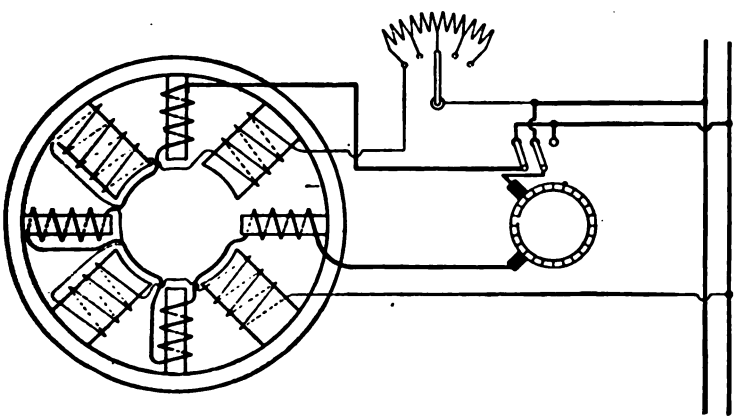


FIG. 432.—Wiring diagram, showing electrical connections between the armature, field, and interpoles of an interpole motor. As the name implies, an interpole motor has in addition to the main poles, a series of interpoles which are placed between the main poles, and whose function is to assist in the reversal of the current under the brushes. They provide a separate commutating field of a correct value at all loads and speeds, and their windings are for this purpose connected in series with the armature. The proper functioning of the interpoles is independent of the direction of rotation of the armature, also of the load carried over the whole speed range. In an ordinary motor without interpoles, commutation is assisted by a magnetic fringe emanating from the main poles, but as the value of this fringe is altered by the load of the motor and by rheostatic field weakening, if higher speeds be desired from such a machine, commutation becomes imperfect and sparking results, making a readjustment of the brushes necessary.

Interpole Motors.—An interpole motor has in addition to the main poles, a series of interpoles, placed between the main poles. The object of these poles is to provide an auxiliary flux or "commutating" field at the point where the armature coils are short circuited by the brush.









FIGS. 433 to 437.—Parts of the type S interpole motor built by Electro-Dynamic Co. They are as follows: 1, yoke—commutator view; 2, interpole coil; 3, top R. H. main coil; 4, bottom R. H. main coil; 5, main pole; 6, interpole; 7, armature shaft, R. O. bearing; 8, commutator; 9, armature wedge; 10, armature coil; 11, brush ring; 12, brush carrier insulation; 13, brush carrier; 14, brush guard; 15, carbon brush; 16, brush holder; 17, cross connecting cable; 18, oil ring; 19, commutator end bearing bushing; 20, pulley end bearing bushing.

Ques. What is the object of the commutating field produced by the interpoles?

Ans. Its object is to assist commutation, that is, to help reverse the current in each coil while short circuited by the brush, and thus reduce sparking.

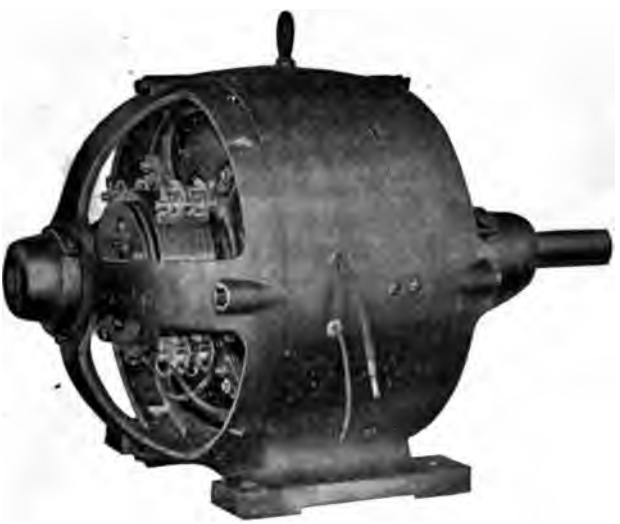


FIG. 438.—Interpole motor as built by the Electro Dynamic Co. This type of motor is devised to prevent sparking at all loads by the use of interpole magnets, that is, small magnets placed between the field magnets. The interpoles set up a field in a direction to stop and reverse the current in the armature coils while they are short circuited by the brushes.

Ques. What is the nature of the commutating field?

Ans. The excitation of the interpoles being produced by series turns, the field will vary with the load, and will, if once adjusted to give good commutation at any one load, keep the same proportion for any other load, provided the iron parts of the circuit be not too highly saturated.

Ques. State briefly how sparking is reduced or vented by the action of the interpoles.

Ans. Sparking is due to self induction in the coil under commutation, which impedes the proper reversal of the cu The action of the interpoles corrects this in that they set field in a direction that causes a reversal of the current i coil while it is short circuited. Thus, the coil at the inst leaves the brush, is not an idle coil, but has a current flo in it in the right direction to prevent sparking.

Ques. Mention some of the claims made for inte motors.

Ans. Constant or adjustable speed, and momentary loads without sparking; constant brush position; operatic adjustable speeds on standard supply circuits of 110, 220, 500 volts; constant speed with variable load; reversal wit changing the position of the brushes.

CHAPTER XXIV

SELECTION AND INSTALLATION OF DYNAMOS AND MOTORS

General Conditions Governing Selection.—In any particular case, the voltage, current capacity, and type of dynamo selected will depend upon the system of transmission or distribution to which it is to be connected, and the character of the work which it is required to perform. The suitability of the different types of dynamo for various kinds of work has already been considered to some extent, but there are certain general conditions which are applicable to almost all cases, such as:

1. Construction;
2. Operation;
3. Cost;
4. Number and size of units.

Construction.—This should be as *simple* as possible and of the most solid character. All parts should be interchangeable, and have a good finish. All machines should be provided with eye bolts or other means by which they can be lifted or moved, as a whole or *in parts, easily* and without injury. These features are so carefully attended to and guaranteed by the manufacturers as to leave little choice in this direction.

Operation.—The considerations relating to the operation of a machine involve an examination of the details of its construction, in order to determine the amount of attention it will require, the character of its regulating device, its *capacity*, *form*, and *weight*.

Ques. What may be said regarding capacity?

Ans. Dynamos and motors should not be overloaded, because the efficiency is greater when the working load does not exceed the rated capacity of the machine.

Form.—As a rule, there is not much choice in the matter of form between standard machines, as they are uniformly symmetrical, well proportioned and compact. It is a mistake, however, to select a light machine for stationary use, as the weight of a machine increases its strength, stability and durability.

Cost.—In some cases, the matter of first cost is important and deserves careful consideration. It should be remembered, however, that high grade electric machinery cannot be built out of low grade materials and with poor workmen; therefore, when necessity compels the selection of a cheap machine, it should not be expected that its service will be as satisfactory as that of a first class machine.

Number and Size of Units.—The best number and size of units for an electrical plant is usually governed by the requirements of the driving engines. As a rule, dynamos and motors are not much less efficient at quarter load than at full load, and the smaller dynamos are fully equal to the larger machines in this respect, therefore, a generating plant can be subdivided, and if so desired, without any detrimental results except those due to a multiplicity of units.

Ques. What is the important consideration with respect to efficiency?

Ans. Efficiency at maximum load is not so important as efficiency at average load.

For instance, in the diagram, fig. 439, the rated efficiency of one dynamo as shown by the curve A, is 93 per cent., and that of another, as shown by curve B, is 91 per cent., but it will be observed that the average efficiency of B is much higher, being 75 per cent. at quarter-load, 89 per cent. at half-load, and 91 per cent. at three-quarter load, to 55, 77 and 89 per cent. of A, at the corresponding loads. In this

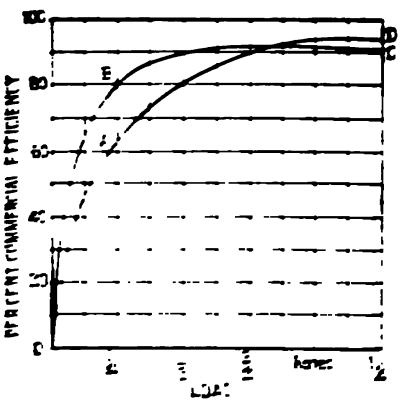


FIG. 439.—Efficiency [illegible] load is not so important as [illegible] represent the [illegible] which [illegible] the efficiency [illegible] is far better [illegible] between [illegible] should be [illegible]

case, A is higher [illegible] which should [illegible] short intervals [illegible] satisfactorily [illegible] under these [illegible] two hours without [illegible] rated load be taken as the full load of a [illegible] 25 per cent.

Ques. For what conditions of service are series motors adapted?

Ans. They are used on constant current circuits, and also on constant voltage circuits as in railway work and similar purposes where an attendant is always at hand to regulate the speed.

Ques. Name some advantages and disadvantages of series motors.

Ans. They are easily started even under heavy loads, the winding is cheaper than the other types and the speed is nearer constant than shunt motors when operated on constant current circuits. When used on constant pressure circuits, such as is employed for incandescent lighting, the speed will depend on the load.

Ques. What kind of circuit is suitable for shunt motors?

Ans. They are used on constant voltage circuits.

Ques. What are the advantages of shunt motors?

Ans. The speed remains nearly constant for variable load.

Ques. State the disadvantages.

Ans. They start less easily under a heavy load than do series motors, and the speed cannot be varied through any wide range without considerable loss. The shunt motor requires more attention than the series type and is more liable to be burnt out.

Location.—The place chosen for the dynamo or motor should be dry, free from dust, and preferably where a cool current of air can be had. It should allow sufficient room for a belt of proper length when a belt drive is used.

Foundations.—It is most important to secure a good foundation for every dynamo, and great care should be taken to have them entirely separate from those of the walls of the building in which the machine is installed, and if the dynamo be directly driven, but not on the same bed plate as the engine, a foundation large enough for both together should be laid down. Stone or concrete may be used, or brick built with cement, having a large thick stone bedded at the top.

For small machines the holding down bolts may be set with lead or sulphur in holes in the stone top, but for large machines the bolts should be long enough to pass down to the bottom, where they should be anchored with iron plates.

Setting up of Dynamos and Motors.—In unpacking the machines care should be taken to avoid injury to any part and in putting the parts together, each part should be carefully cleaned, and all the parts put together in exactly the right way. The shafts, bearings, magnetic joints, and electrical connection should receive especial attention and be thoroughly cleaned of every particle of dirt, grit. dust, metal clippings, etc.

Ques. Who should preferably assemble the machines?

Ans. Whenever possible, they should be assembled by someone thoroughly familiar with the construction; but if the services of such a person cannot be had, no one should attempt to put a machine together unless he has a drawing or photograph of the same for a general guide.

Ques. What precaution should be taken with the armature?

Ans. It should be handled carefully to avoid any injury to *the wires* of the winding and their insulation.

If it become necessary to lay the armature on the ground it should be laid on clean paper or cloth, but it is better to support it by the shaft on two wooden horses or other supports, and thus avoid any strain on the armature body or commutator.

Connecting Up Dynamos.—The manner in which the connections of the field magnet coils, brushes, and terminals, are connected to one another depends entirely upon the type of machine. The field magnet shunt coils of shunt and compound

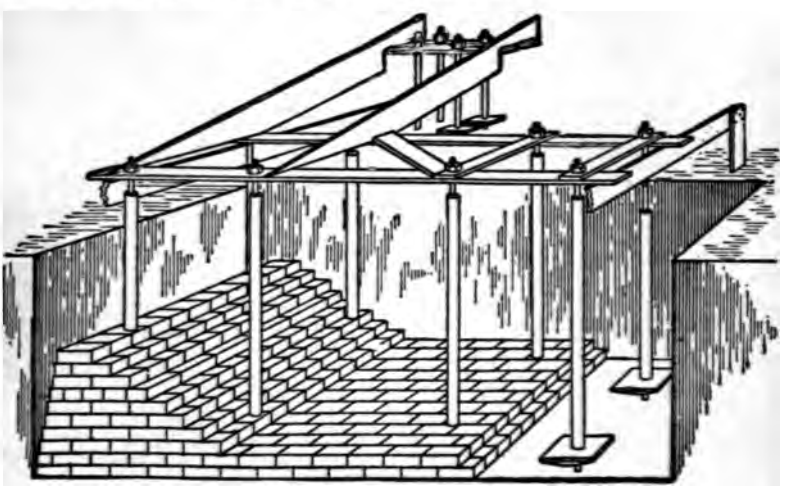


FIG. 441.—Foundation. It may be made either of concrete, stone or brick. The machinery is held firmly in place on the foundation by anchor bolts built into it; the proper position for the bolts are determined by a wooden template suspended above the foundation as shown. The bolts are surrounded by iron pipe that fixes them vertically but permits a little side play to allow for any slight errors in locating the centers on the template.

wound dynamos, are invariably arranged in series with one another, and then connected as a shunt to the brushes or terminals of the machine. The series coils of series and compound wound machines are arranged either in series or in parallel with one another, according to conditions of operation, and then connected in series to the armature and external circuit.

Coupling Up Field Magnet Coils.—In coupling up the coils of either salient or consequent pole field magnets, assume each of the pole pieces to have a certain polarity (in bipolar dynamos two poles only, a north and south pole respectively, are required; in multipolar dynamos the poles must be arranged in alternate order around the armature, the number of N and S poles being equal), then apply Flemming's rule as given under fig. 132, to each of the coils, and ascertain the direction in which the magnetizing current must flow in each in order to

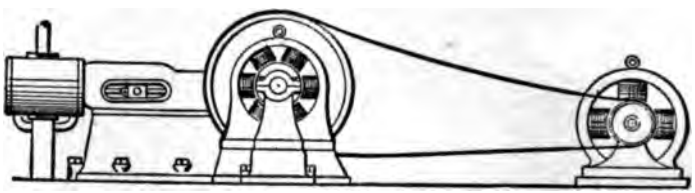


FIG. 442.—Comparison of space occupied by direct and belt connected dynamos. In office buildings space is of value and the room required by belt connected dynamos can always be put to profitable use. For this reason the direct connected unit has become generally adopted in the best type of office buildings. In large factories the direct connected unit is generally adopted also to save space. Where these conditions do not obtain, belted type of dynamo can be used to advantage as a given output can be obtained with a smaller size machine than where it is direct connected to the engine. This is due to the limited rotative speeds at which engines can be run. The illustration shows the relative space required by the two types.

produce the assumed polarity in each of the pole pieces. Having marked these directions on the coils, they can be coupled up in either series or parallel connection according to requirements, so that the current flows in the proper direction in each.

The Drive.—Various means are employed to connect the engine or other prime mover with the dynamo, or the motor with the machinery to driver. Among these may be mentioned the following:

1. Direct drive;
2. Belt drive;
3. Rope drive;
4. Gear drive;
5. Friction drive.

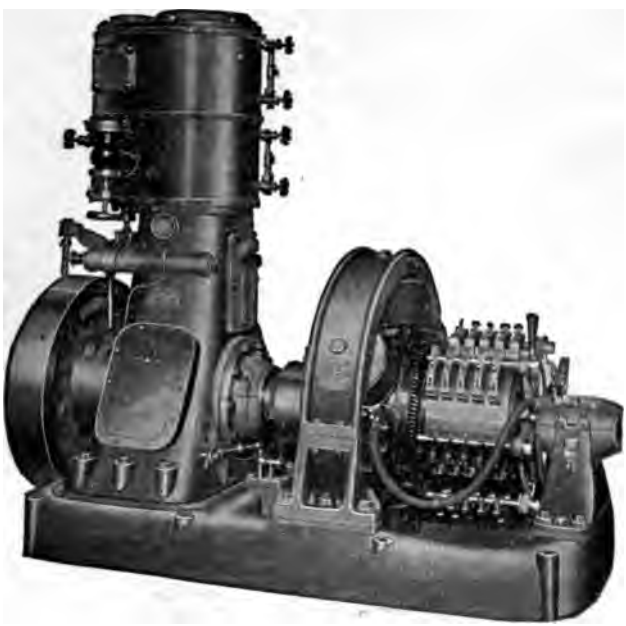


FIG. 443.—General Electric type M P, marine generating set with tandem compound engine. The requirements of such units are compactness, light weight, simplicity, freedom from vibration and noise at high speed, perfect regulation and durability. By adopting a short stroke for the engines and a special armature winding for the dynamos, the height and length of the sets have been reduced. The bed is carried out to the full width of the dynamo frame, making an ample base surface for foundation without increasing the floor space required. While the construction gives a massive appearance, the bed has been cored out and the various parts so designed that the complete sets have an approximate capacity of 3½ watts per pound. All of the moving parts are enclosed by the engine column, excluding dust and reducing wear and attention to a minimum. The bearings are oiled automatically under pressure. These sets are made in sizes from 25 K. W. to 75 K. W., the cylinder dimensions for the smallest size being 6½ and 10½ by 5, and for the largest size 10½ and 18 by 8. Single cylinder sets are made in sizes ranging from 2½ K. W. to 50 K. W., the cylinder dimensions ranging from 3½ x 3 to 12 x 11. See fig. 720.

Ques. What is a direct drive?

Ans. One in which the driving member is connected direct to the driven member, without any interposed gearing.

Fig. 448 shows a direct connected unit, which is an example of direct drive.

Ques. What may be said with respect to direct drive?

Ans. It is the simplest method and the space required is less than with belt drive. With direct drive the engine and dynamo must run at the same speed; this is a disadvantage because the most desirable speeds of the two machines may not agree.

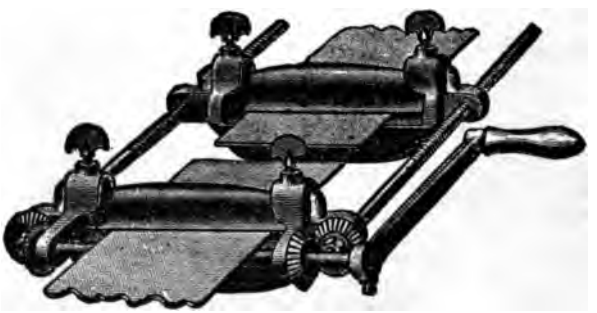


FIG. 444.—Belt clamp for stretching belt and holding the ends while making joint. It consists of a *stretching frame*, the two ends of which are coupled by screwed bars; used for pulling the ends of a belt together with the proper tension, when lacing or joining the ends.


Since the usual engine speeds are slower than dynamo speeds, direct drive involves the use of a larger dynamo for a given output than would be necessary with belt connection, and involves a corresponding increase in cost and greater friction loss due to the rotation of larger and heavier parts.


Ques. Mention some of the features of belt drive.

Ans. Greater flexibility in the original design of a plant is *possible* and new arrangements of old apparatus can be made at *any time*. It gives conveniently any desired speed ratio and *permits* the use of high speed dynamos and motors.

Ques. State some of the disadvantages of belt drive.

Ans. Considerable space is required and the action is not positive. Belts exert a side pull on the bearings which results in wear, also loss of power by friction.

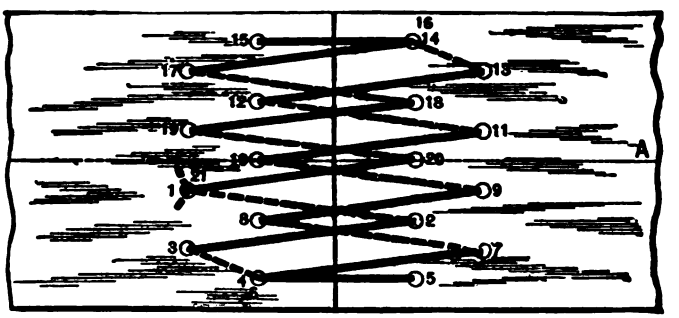

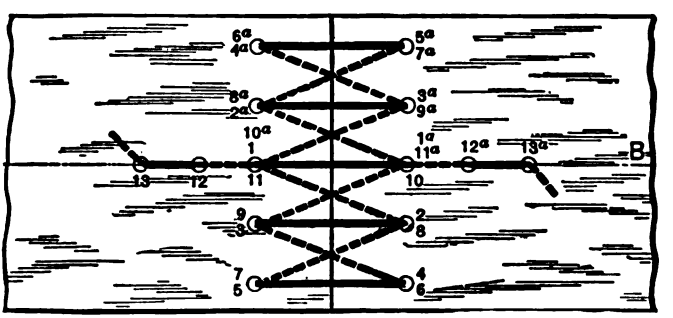

FIGS. 445 and 446.—Two methods of lacing a belt. In fig. 445 two rows of oval holes should be made with a punch, as indicated. The nearest hole should be ¼ inch from the side, and the first row ⅛ inch from the end, and the second row 1¼ inches from the end of the belt. In large belts these distances should be a little greater. A regular belt lacing (a strong, pliable strip of leather) should be used, beginning at hole No. 1, and passing consecutively through all the holes as numbered. In fig. 446 the holes are all made in a row. This *method has the advantage* of making the lacers lie parallel with the motion on the *pulley side. The lacing is* doubled to find its middle, and the two ends are passed through *the two holes marked "1" and "1a"* precisely as in lacing a shoe. The two ends are then *passed successively through* the two series of holes in the order in which they are numbered *2, 3, 4, etc., and 2a, 3a, 4a*, etc., finishing at 13 and 13a, which are additional holes *fastening the ends of the lacer.*

Ques. Give a rule for determining the proper size of belt.

Ans. *A single belt travelling* 1,000 *feet per minute will transmit one horse power per inch of width; a double belt will transmit twice this amount.*

EXAMPLE.—What size of double belt is required to transmit 50 horse power at 4,000 ft. speed, and what diameter pulley must be used for 954 revolutions per minute at 4,000 ft. speed of belt?

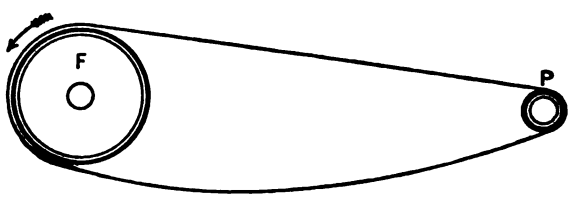


FIG. 447.—Wrong way to run a belt. The pull should *not* come on the top side, because, with slack at bottom there is a tendency to slip.

The horse power transmitted per inch is

$$\frac{4{,}000}{1{,}000} \times 2 = 8$$

accordingly, the width of belt required to transmit 50 horse power is

$$50 \div 8 = 6.25, \text{ say } 6''.$$

For 4,000 ft. per minute belt speed, the distance *in inches* travelled by the belt *per revolution* of the pulley.

$$\frac{4{,}000 \times 12}{954} = 50.31 \text{ inches}$$

This is equal to the circumference of the pulley, and the corresponding diameter is

$$\frac{50.31}{\pi} = 16.1, \text{ say } 16 \text{ inches.}$$

Ques. What is the proper speed for a belt?

Ans. From 3,000 to 5,000 feet per minute, depending on conditions.

Points Relating to Belts.

1. The amount of power that a belt of given size can transmit is not a very definite quantity. The rule just given is conservative and will give an amply large belt for ordinary conditions.

2. A belt should make a straight run through the air and over the pulleys without wabbling; it should maintain an even and perfect contact with that part of the pulley with which it comes in contact. In order to do this it should be kept soft, pliable, and have no abrasions or rough places.



FIG. 448.—Right way to run a belt. The pull should come on the lower side bringing the slack on top.

3. When belt fasteners give way there is too much strain upon belt. The greatest amount of slack in a belt is found where it leaves the driving pulley, hence the tightener should be near the driving pulley, as it takes up the slack, prevents vibration and diminishes strain on belts and bearings. More than 100 degrees of heat is injurious to belts.

4. Double belts should always run with the splices, and not against them. Quarter turn belts should be made of two ply leather, so as to diminish the side strain.


5. Friction is greatest when the pulleys are covered with leather. Friction depends upon pressure, but adhesion depends upon surface contact; the more a belt adheres to pulley surface without straining through too much tightening, the better the driving power. Slipping occurs on wet days because the leather absorbs dampness.

6. A leather covered pulley will produce more resistance than polished or rough iron ones. A good belt dressing makes a smooth, resisting surface, and as it contains no oils which create a slippery surface to be it increases belt adhesion. The friction of leather upon leather times greater than leather upon iron.

7. Moisture and water distend the fibres, change the properties of the tanner's grease and softening compounds. Repeated saturation and drying will soon destroy leather. Leather well filled with tanner's grease or animal oil, if allowed to hang in a warm room for several months without handling, will dry out, become harsh, and will readily crack.

8. A running belt is stretched and relaxed at different times and unless there be perfect elasticity in all its parts there will not be uniform distension.

9. There should be 25 per cent. margin allowed for adhesion before a belt begins to slip.

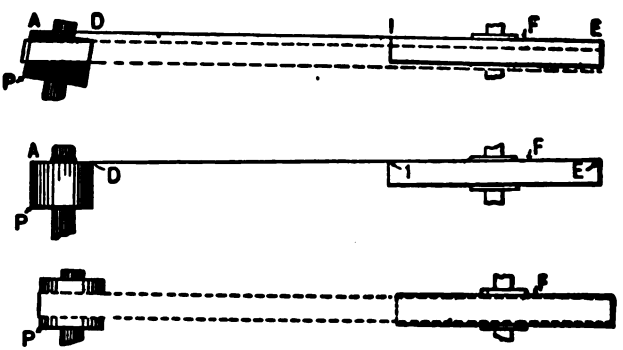

FIGS. 449 to 451.—Method of aligning engine and dynamo. In fig. 449, a line is stretched from A to E and the dynamo shifted until the line contacts with points A, D, I, and E. In a small dynamo, the pulley may be loosened and set back on the shaft as in fig. 450, while lining up the faces, and then moved back to its original position as in fig. 451. When the pulley is not easily shifted the distances at A and D (fig. 449) may be measured.

Rules for Calculating Speed and Sizes of Pulley.—When two pulleys are working together connected by a belt, the one which communicates the motion is called the *driver* and the other which receives it, the *driven pulley*.

To Find the Size of the Driving Pulley: Multiply the diameter of the driven pulley by its required number of revolutions, and divide the product by the revolutions of the driver. The quotient will be the diameter of the driver.

To Find the Number of Revolutions of the Driven Pulley: Multiply the diameter of the driver by its number of revolutions, and divide by diameter of driven. The quotient will be the number of revolutions of the driven.

To Find the Diameter of the Driven that shall Make a Given Number of Revolutions, the Diameter and Revolutions of the Driver Being Given: Multiply the diameter of the driver by its number of revolutions, and divide the product by the number of revolutions of the driven pulley. The quotient will be the diameter of the driven pulley.

Rope Drive.—In this method of power transmission, rope is run in V-shaped grooves in the rims of the pulleys; this form of drive, in some cases, is more desirable than others.



FIG. 452.—General Electric C Q back geared motor driving Hamilton sensitive drill. When slowly moving machines are to be driven, or where, for any reason, very moderate belt speeds are required, the back geared motor is desirable. Two ratios of gear reduction have been adopted as standard; they are:—4 to 1 and 8 to 1.

Ques. What are some of the advantages of rope drive?

Ans. More power can be transmitted with a given diameter and *width of pulley,* on account of the increased grip in the *grooves. Rope drive* can be employed for long or short dis*tances by reason of* its lightness and the action of the groove

Gear Drive.—This method is used where a positive drive is desired, as for elevator or railway motors. It admits of any degree of speed reduction without attending difficulties as would be encountered with belt drive.

Thus, with the worm type of gear as used on elevator motors a great reduction in velocity can be made without incurring the expense of countershaft as with a belt.



FIG. 453.—Watson vertical motor designed to operate a vertical shaft, either through belt connection, or by direct drive. Hess-Bright ball bearings are used, taking the downward thrust due to the weight of the armature. For mounting on the floor or ceiling, a tripod base (as shown) is furnished, the standard sliding base being used on a side wall. The armature shaft may be extended for pulley or coupling either above or below the motor.

Friction Drive.—This is a very simple mode of transmitting power and has the advantages of simplicity and compactness. In operation, the driving wheel is pressed against the wheel to be driven, transmitting motion to the latter by the friction

grip. The drive is thrown out of gear by slightly moving the machine on its sliding base. In construction, the friction may be increased by making one wheel of the pair of wood, compressed paper, or leather.

Electrical Connections.—Circuits for dynamos and motors should be carefully planned so as to secure the simplest arrangement, and to avoid unnecessary expense and delay, the wiring should be installed in accordance with the requirements of the National Electrical Code.

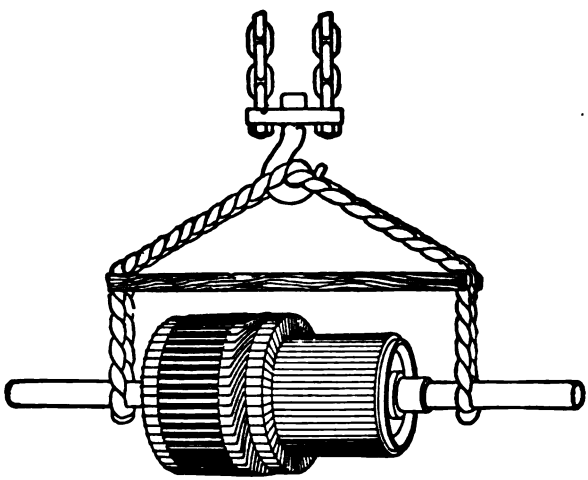


FIG. 454.—Sling for handling armatures. In raising an armature it should be supported by the shaft to avoid any strain on the armature body or commutator.

Ques. What may be said with respect to exposed and concealed wiring?

Ans. Exposed wiring is cheap and accessible; a short circuit or ground is easily located and repaired. Concealed wiring, especially when placed under the floor, has the advantage of being out of the way, and thus protected from injury.

Ques. In wiring a dynamo what are the considerations with respect to size of wire?

Ans. All conductors, including those connecting the machine with the switchboard, as well as the bus bars on the latter, should be of ample size to be free from overheating and excessive loss of voltage. The drop between the generator and switchboard should not exceed one-half per cent. at full load, because it interferes with proper regulation and adds to the less easily avoided drop on the distribution system.

CHAPTER XXV

AUXILIARY APPARATUS

There are numerous devices that must be used in connection with dynamos and motors for proper control and safe operation. Among these may be mentioned:

1. Switches;
2. Fuses;
3. Circuit breakers;
4. Rheostats;
5. Switchboards.

Switches.—A switch is a device by means of which an electric circuit may be opened or closed. There are numerous types of switch; they may be either single or multi-pole, single or double throw and either of the "snap" or knife form.

Ques. What is the difference between a single and double pole switch?


Ans. A single pole switch controls only one of the wires of the circuit, while a double pole switch controls both.

Ques. What is the difference between a single break and a double break switch?

Ans. The distinction is that the one breaks the circuit at *point only. while the* other breaks it at two points.

Ques. What is the advantage of a double break?

Ans. If the circuit be opened at two points in series at the same instant, the electromotive force is divided between the two breaks and the length to which the current will maintain an arc at either break is reduced to one-half; thus there is less chance of burning the metal of the switch. Another reason for providing two breaks is to avoid using the blade pivot as a conductor, the contact at this point being too poor for good conductivity.

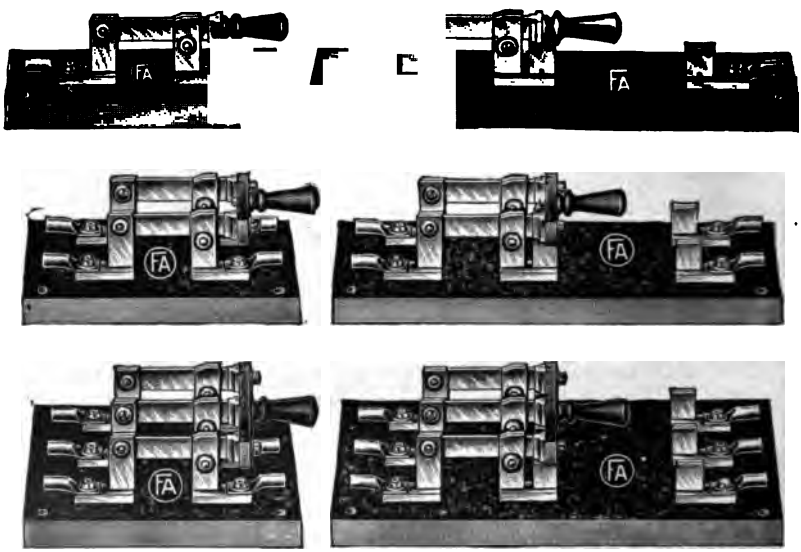

FIGS. 455 to 457.—Adam's single throw knife switches without fuse connections. **Fig. 455,** single pole switch; fig. 456, double-pole switch; fig. 457, three-pole switch.

FIGS. 458 to 460.—Adam's single throw knife switches with fuse connections at the handle end. Fig. 458, single pole switch; fig. 459, double pole switch; **fig. 460, three pole switch.**

***Ques.* When should a knife switch be used?**

Ans. When the capacity of the circuit in which it is to be placed exceeds 10 amperes.



Ques. Describe a knife switch.

Ans. Fig. 461 illustrates a knife switch of the double pole, single throw type. It consists of the following parts: base, hinges, blades, contact jaws, insulating cross bar, and handle, as shown.

Ques. How should knife switches be installed?

Ans. They should be placed so that *gravity tends to open them.*

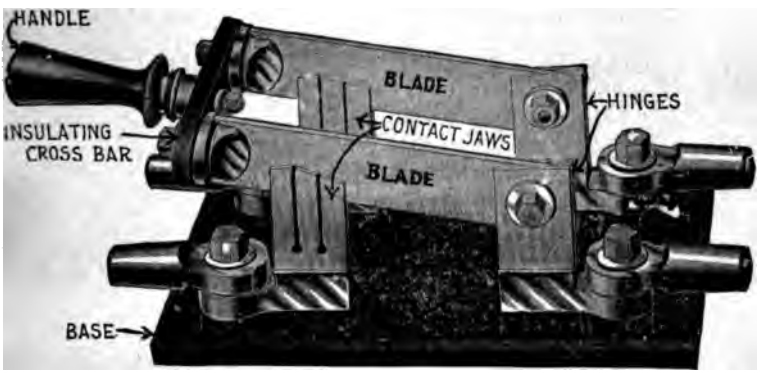


FIG. 461.—A single throw, two pole knife switch. As usually constructed it is made of hard drawn copper with cast terminal lugs and fibre cross bar.

Otherwise if the hinges become loose, the weight of the blades and handle would tend to close the switch, thus closing the circuit and possibly resulting in considerable damage.

Ques. How should switches be proportioned?

Ans. The minimum area of the contact surfaces should not be less than .01 square inch per ampere, and in those used on arc lighting or other high voltage circuits where the current is usually small, the area of the contact surfaces are usually from .02

.05 inch per ampere. Since dirt or oxidation would prevent good contact under a simple pressure between the contact surfaces, the mechanism of a switch provides a sliding contact.

In the general design of switches, all parts which carry current are given a cross sectional area of at least one square inch per 1,000 amperes if they be made of copper, and about three times as much if made of brass, as the conductivity of the latter is only one-third that of the former. Furthermore, the current should never be permitted to pass through springs, as the heat generated will destroy their elasticity.

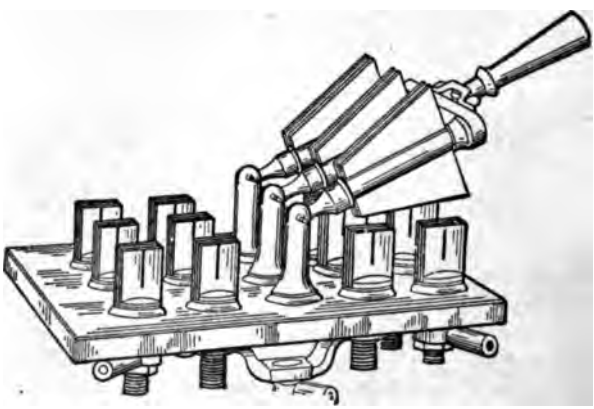


FIG. 462.—Triple pole, double break double throw knife switch for very heavy current. The blades are made up of numerous strips to give adequate contact area. A double throw switch is used when it is desirable to open one circuit and immediately close another, or to transfer one or more connections from one circuit to another in the least practical interval of time, also, when one connection is to be broken and another closed and it is undesirable to allow both to be closed at the same time.

Ques. What difficulty is experienced in opening a circuit in which a heavy current is flowing?

Ans. It is impossible to instantly stop the current by opening the switch, consequently the current continues to flow and momentarily jumps the air gap, resulting in a more or less intense arc which tends to burn the metal of the switch.

Ques. How is this remedied to some extent?

Ans. The contact pieces are so shaped that they open along their whole length at the same time, so as to prevent the concentration of the arc at the last point of contact. This feature is clearly shown in fig. 461.

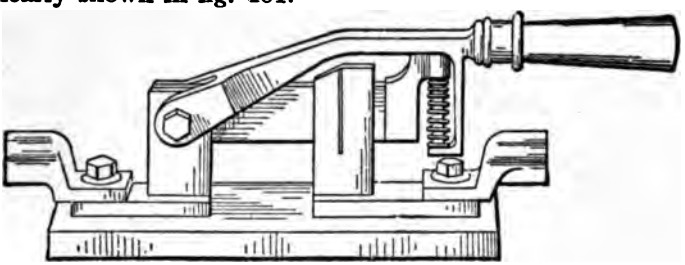


FIG. 463.—A "quick break" knife switch of the single throw, single break, one pole, type. The contact blade is held between the jaws by their clamping friction until the handle compresses the spring sufficiently to force the blade out. As soon as it breaks contact with the jaws, the spring expands and drives the blade away from the jaws with greater rapidity than could be done by hand. The object of this action is to break the arc as quickly as possible to prevent burning the metal of the switch.



FIGS. 464 and 465.—Snap switch; views showing switch with cover on, and exposed to show mechanism. The switch is provided with indicating dial which registers "on" and "off" positions.

FIG. 466.—Gas Engine snap switch. The first snap makes connection so that igniter is run from storage battery; second snap connections are changed so that igniter is supplied from dynamo; third snap makes connections so that dynamo supplies igniter and charges storage battery; fourth snap, all off.

Ques. For what service are "snap" switches suitable?

Ans. They are used on circuits containing lamps in comparatively small groups, and other light duty service.

Ques. What is a quick break switch?

Ans. A form of switch in which the contact pieces are snapped apart by the action of the springs, as shown in fig. 463, so as to make the duration of the arc as short as possible.

The current allowed in each branch circuit of an electric lighting system is limited by the insurance rules to a maximum of 660 watts equivalent to 12 lamps of 16 c.p. each at 110 volts. They are also employed to control lamps in groups in theatres and other places where many lamps are turned on or off at about the same time.



FIG. 467.—Spool of fuse wire. The wire is usually made of an alloy of tin and lead, such as half and half solder. Bismuth is frequently added to the alloy to lower the melting point For half and half solder the melting point is 370° Fahr. The quickness with which a fuse will melt after the current has reached the limit depends upon the specific heat and latent heat of the metal. The current required to "blow" a fuse increases somewhat with the age of the fuse owing to oxidation and molecular changes. Fuses are sometimes rated according to the number of amperes to be taken normally by the circuit they are to protect. Thus, a 10 ampere fuse is supposed to protect a circuit whose regular current should not exceed 10 amperes, and to blow if the current rise to say 12 amperes. The Underwriters' rule requires that the rating be about 80% of the maximum current it can carry indefinitely, thus allowing about 25% overload before the fuse melts. The fusing current varies considerably according to circumstances. The temperature of the surrounding air or other substances affects the melting current greatly, because the rate at which heat from the fuse will be transferred to the surroundings depends upon the difference of temperance between them and the fuse. Hence, a fuse in a warm place will be melted by a smaller current than a similar fuse in a cold place. For a similar reason, a fuse in an enclosed place where there is little chance for the heat to be dissipated, will melt with a smaller current than the same in an open place. If the current increase gradually to that which would ordinarily melt the fuse, the high tempearture makes the fuse wire oxidize rapidly; this sometimes makes a sort of tube of oxide which will not break even after the fuse wire inside has melted, and so the fuse carries more than its rated current. Open fuses are so unreliable that circuit breakers are preferable for large currents; when fuses are used, the enclosed type as shown in figs. 468 to 470, is usually the more desirable.

Fuses.—All circuits subject to abnormal increase of current which might overheat the system, should be protected by fuses which will melt and thus open the circuit. A fuse is simply a strip of fusible metal, often consisting of lead with a small percentage of tin, connected in series in the circuit.

Experiments have shown that for large fuses, a multiple fuse is more sensitive than a single one. A one hundred ampere fuse may be made by taking four wires of twenty-five amperes capacity. A fuse block may



FIGS. 468 to 470.—D & W, enclosed "cartridge" fuses. Fig. 468, type for 3 to 60 amperes; fig. 469, type for 61 to 100 amperes; fig. 470, type for 101 to 1,000 amperes.

be overloaded, not because the metal of the terminals is not of sufficient cross section to carry the current, but because of insufficient area of contact, or loose contact of fuse and wires; the overload thus caused results in heating and frequently melts the fuse.

Ques. Where should fuses be placed?

Ans. They should be inserted wherever the size of wire changes, *or wherever there is a branch of smaller size wire connected, unless the next fuse on the main or larger wire is small enough to protect the branch or small wire.*

FIG. 471

FIG. 472

FIG. 473


FIG. 474

FIG. 475

FIG. 476

FIG. 477

FIG. 478

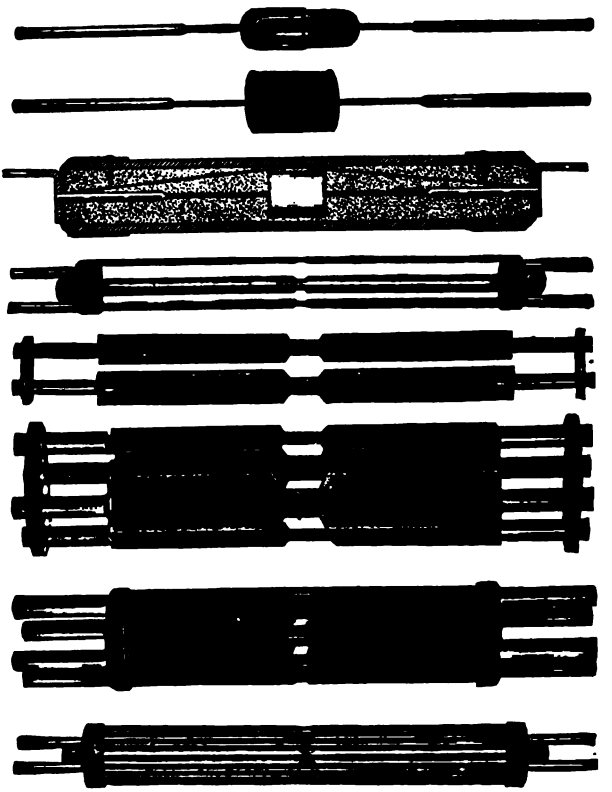

FIGS. 471 to 478.—Interior construction of D. & W. fuses. In the manufacture of these fuses, four types of fuse link are used according to capacity of fuse, and classified as: 1, air drum link; 2, flat link; 3, multiple link; 4, cylinder link. In the air drum link, figs. 471 and 472, a capsule provides an air space about the center of the link, the rate of heat conduction through the confined air being very slow, the temperature of that portion of the link rises rapidly with increasing current, rendering the blowing point practically constant; fig. 473 shows a section through the complete fuse. In the flat link, fig. 474, the section is reduced in the center, cutting down as far as possible the volume of metal to be fused. Figs. 475 to 478 show various form of multiple link construction. By sub-dividing the metal, increased radiating surface is obtained which permits a reduction in the volume of fusible metal necessary, and the metal vapor formed when the fuse blows on heavy overload is more readily dissipated. Figs. 477 and 478 show two forms of the cylinder link, the plain cylinder fig. 477, being used for low voltage and large current, and fig. 478, for certain *high tension* service. The corrugated cylinder presents more surface to the fuse filling *than the plain* type and secures a maximum radiating surface with resulting minimum *volume of* metal for a given current.

Ques. How should fuses be mounted?

Ans. They should be placed on a base of slate, porcelain, marble, or other incombustible material.

Ques. What is the objection to copper fuses?

Ans. They heat perceptibly soon after their rated capacity is passed. The melting temperature is higher than lead alloy.

Ques. Upon what consideration does the choice between switches and circuit breakers depend?

Ans. Simple knife switches are suitable for use when the circuit is not liable to be opened while carrying large current. A circuit breaker, operated automatically or by hand should be used for interrupting heavy currents.



FIGS. 479 and 480.—D & W fuse indicator. The operation is illustrated in the figures which show appearance of the label before the blowing of the fuse, fig. 479, and the same fuse blown, as indicated by the appearance of the black spot within the circle fig. 480.

Circuit Breakers.—A circuit breaker is a switch which is opened automatically when the current or the pressure exceeds or falls below a certain limit, or which can be tripped by hand.

Ques. What is the construction of a circuit breaker?

Ans. It is composed of a switch and a solenoid in the main circuit. When the current, flowing through the circuit, exceeds a certain value, the core of the solenoid is drawn in and trips a *trigger which* allows the switch to fly open under the action of *a spring.*



FIG. 481.

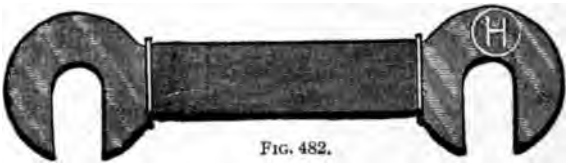


FIG. 482.

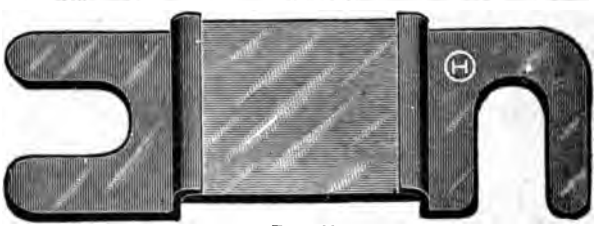


FIG. 483.



FIG. 484.



FIG. 485.

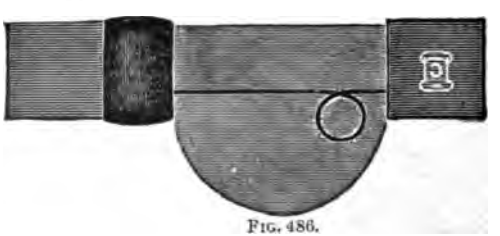



FIG. 486.

FIGS. 481 to 486.—Various open fuses. Fig. 481, fuse for main and branch blocks; fig. 482, *standard railway* fuse; fig. 483, Edison main style; fig. 484, W. U. pattern; fig. 485, *Bell telephone* style; fig. 486, sneak current fuse. When an open fuse "blows as a result of overloading, the rupture is accompanied by a flash, and by spattering of the *fused material*. With large currents this phenomenon is a source of danger, and the use of enclosed fuses is accordingly recommended whenever the rating of the fuse exceeds 2 amperes. Various types of enclosed fuse are shown in figs. 468 to 470.



There are numerous kinds of circuit breaker to meet the varied conditions of service of which may be mentioned the following:

1. Maximum circuit breaker;
2. Minimum circuit breaker;
3. Reverse current circuit breaker;
4. Maximum and reverse circuit breaker;
5. No voltage circuit breaker.

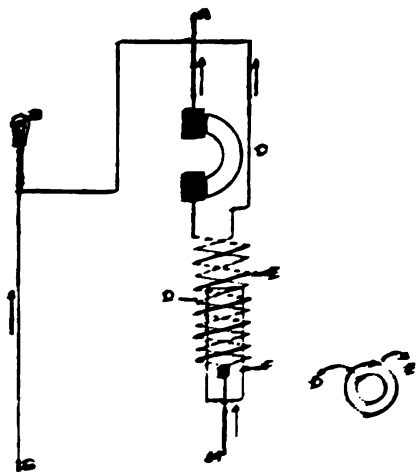

FIGS. 45 and 46.—[illegible]

Of these the maximum, reverse, and maximum and reverse type are the most essential.

A maximum circuit breaker is equivalent [illegible]


A reverse [illegible]

A reverse [illegible]

Maximum and reverse [illegible]


Ques. Describe a reverse current circuit breaker or discriminating cut out.

Ans. This type of circuit breaker is arranged to open a circuit in the event of current flowing in the circuit in a direction reverse to the normal. This is sometimes effected by winding the

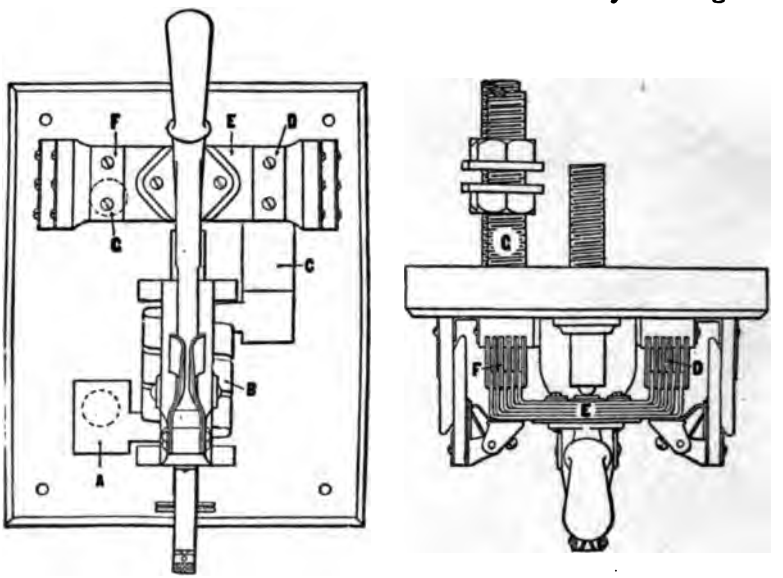

FIGS. 489 and 490.—Front and top views of I-T-E automatic overload circuit breaker. In fig. 489 the current in the circuit enters at A, passes through the solenoid coil B (which in its iron jacket becomes a powerful magnet), through the copper terminal C, to the contact blades D, across the bridge at E to the contact blades F, and out into the line at G. The path of the current as indicated above is more clearly indicated in the top view fig. 490. When the current in the solenoid coil produces sufficient magnetism to overcome the weight of the plunger, the latter is drawn up with constantly increasing velocity until it strikes a restraining latch or trigger which forces the arm out of the switch, thus automatically opening the circuit. The device is so constructed that in opening the circuit the arc is broken on the carbon contacts instead of the copper contacts.

electromagnet of the circuit breaker with two coils, one connected *as a shunt* across the main circuit and the other in series with the *main circuit*, the two coils being so arranged that when the main *current flows* in the normal direction their effects assist one

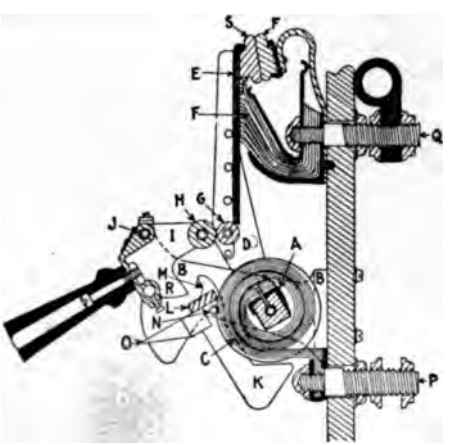

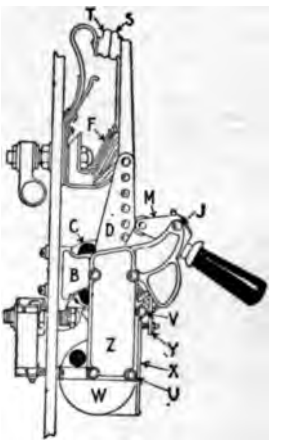


FIG. 491.—Roller-Smith "S.E." plain overload circuit breaker. In operation, current entering through the lower studs flows through the laminated strap windings C, from this into the arm D, through the contact plate E, into the stationary brush F, and finally out through the upper stud Q. In its passage through the laminated windings C, the square core A is of course magnetized to a degree dependent on the current strength. When this magnetization reaches a pre-determined value, the attraction exerted on the ends K of the pivoted armature causes the same to rise with great and increasing velocity, finally bringing the finger D which forms part of the armature into violent contact with the face R of the corresponding projection on the housing which carries the handle and the roller H. This heavy blow causes H, in its rotation about the shaft J, to go over the center and consequently allows the strong outward pressure of the brush F and the resilient coil C to throw the arm outward with a high velocity and so break the circuit, first between the brush fingers and the contact plate and finally between the carbons S and F, the one of which is rigidly secured to the arm and the other of which is resiliently mounted on its supporting spring. To reset the breaker, the handle, which the act of opening has raised, is pulled down, thus bringing roller H into engagement with roller G once more and in that way forcing the arm back into its initial position.

FIG. 492.—Roller-Smith "S.E." combination overload and underload circuit breaker. Attached to the supporting frame B is the extension Z, which like B, is of non-magnetic material and carries a rectangular magnetic core around which there are wrapped laminated copper conductors. Hinged at U is a heavy cup shaped mass of magnetic material, and hinged at V is a flat lever X which bears against the extension Y secured to the housing which carries the operating handle. The circuit through the breaker conveys the current around the windings of this underload coil carried by frame Z and passes from it to the regular overload winding C from which it pursues the same course and exercises the same function as in a plain overload breaker. The core of Z being thus magnetized, the cup-shaped member W is held in firm contact therewith and the lever X hangs free. Should, however, the current fall below the minimum value, W is no longer sustained by the magnetic attraction but drops away, swinging on its hinge U until the projection on the heel thereof strikes the lever X, which blow is transmitted through Y to the handle and thus trips the breaker. When closing to reset the breaker, the handle is manipulated just *as in the case of a plain* overload breaker, that is, it is pulled down, thus not only closing and *locking the breaker* as before but through the pressure exerted by Y on X and by X on W, *putting the latter* into contact with its rectangular core to which it will adhere if the *necessary current be* present.

another, whereas, when the main current reverses, the effects of the coils are neutralized and the breaker opens.

Ques. State some disadvantages of a discriminating cut out.

Ans. If one current reverse very rapidly, and soon reach a large value in the opposite direction, it is possible the cut out may not open at the desired instant, and thereafter the effect of the heavy reverse current will be so great that the breaker will be held in more and more strongly; a second disadvantage is that should the supply fail, the breaker will open in any case, and have to be reset before the supply can be resumed, though in certain cases, as, for instance where there is a motor load, this feature is an advantage and not a disadvantage, since the breaker acts as a no-voltage cut out as well as a reverse current cut out.

Reverse breakers, however, can be made positive in their action; that is, they can be so arranged that a reverse current exerts a positive pull on the tripping gear, so that the greater the reverse current, the greater the tripping effect.

Ques. What are time limit attachments?

Ans. Devices which are fitted to circuit breakers and which act as dampers and prevent the too sudden operation of the breakers on what may be only a temporary overload or reverse current.

By having different time limits on feeder and dynamo breakers it can be ensured that the former operate before the latter, and suitably in other cases where it is desired that one breaker shall operate before another.

***Ques.* Describe a time limit attachment.**

Ans. There are numerous types. It may consist of a clock-work device, a weight acting on a small drum or pulley

a modified dash pot arrangement, or a device operating by the expansion of a conductor due to the heat generated by a current passing through it.

Ques. How should a time limit device be arranged?

Ans. It should be so arranged that the heavier the overload the quicker the device acts, until with a short circuit the device is almost instantaneous in its action.

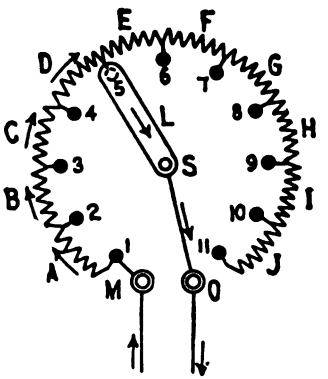


FIG. 493.—Diagram showing connections of a rheostat. The various resistance coils are connected to brass buttons or "contacts." The rheostat is connected in series in the circuit that it is to control. In operation when the lever is on contact 1, the current is opposed by all the resistance of the rheostat so that the flow is very small. As the lever is moved over contacts 1, 2, 3, etc., the coils are successively cut out, thus diminishing the resistance, and when contact 11 is reached all the resistance is short circuited allowing the full current to flow. In some types of rheostat the wire is wound around an iron frame-work which has been previously dipped into a fireproof insulating enamel. The advantage of this construction is that the heat from the wire is dissipated much more rapidly, so that a much smaller wire can be used to carry a given current. The size of such an enameled rheostat required for absorbing a given amount of energy is much smaller than one made of coils of wire stretched between an iron supporting framework.

Rheostats.—These devices consist of conductors inserted into a circuit for the purpose of diminishing, either constantly or in a variable degree, the amount of current flowing, or to develop heat by the passage of a current through them. Rheostats *designed to be used* in starting electric motors are frequently called *"starting boxes."*

Ques. Describe the construction of a rheostat.

Ans. In fig. 493, resistance coils, A, B, C, etc., are mounted in a frame or box, and are connected at intervals to the contacts 1, 2, 3, etc. The rheostat arm or lever L is pivoted at S, and when moved over the contacts, inserts more or less of the resistance in the circuit thus regulating the flow of the current. One terminal M of the rheostat is connected to the first contact and the other terminal O, to the lever at S.

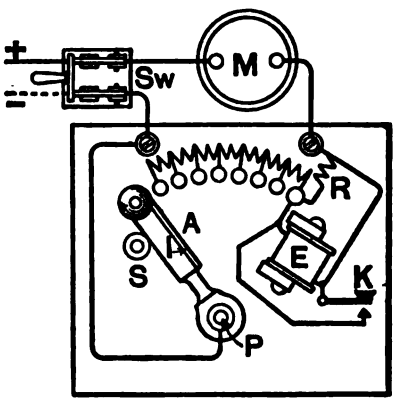


FIG. 494.—Starter with no voltage release for a series motor. A helical spring coiled around the lever pivot P, and acting on the lever A, tends to keep it in the off position against the stop S. This lever carries a soft iron armature I, which is held by the poles of the electro-magnet E, when, in starting the motor, the arm has been gradually forced over as far as it will go. Should anything happen to interrupt the current while the motor M is running, E will lose its magnetism and A will be released, and will fly over to the off position. E is usually shunted by a small resistance R, so that only a portion of the main current flows through it. This device constitutes the *no voltage release*, and ensures that all the resistance is in circuit every time the motor is started.

Ques. How is a starting box connected to a motor?

Ans. In series.

Ques. Why should a starting box be used with a motor?

Ans. If the line voltage should be applied directly to the terminals of the armature when not running, an excessive flow of current will result, on account of the low resistance

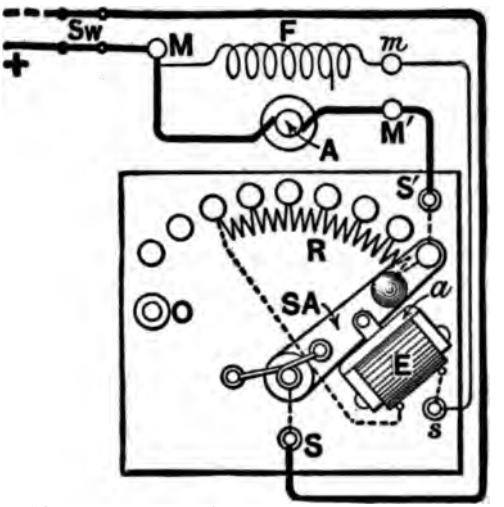


FIG. 495.—Starter with no voltage release for a shunt motor. The terminals of the motor are at M, M', *m*, and those of the starter at S, S', *s*. The lever SA is shown in the "on" position. The current enters the motor at the terminal M, and there divides, part going through the field coil F, and the main current through the motor armature A. The armature current enters the starter at the terminal S', and traversing the lever SA, leaves by the terminal S. The field current enters the starter at the terminal *s*, traverses the coil of the magnet E (which holds up the armature *a* linked to the lever) and thence completes its journey through the whole of the resistance R, and through the lever SA, to the terminal S. When the supply is cut off by opening Sw, or should the field circuit be accidentally broken, the magnet E will release *a* and the lever, which will thereupon fly to the "off" stop O. It should be noticed that when SA is off, A and F form a closed circuit with the resistance R and magnet E. The inductance of F has consequently no chance of causing destructive sparking when the current is shut off. In starting the motor, Sw is first closed, and then, as the lever is slowly moved, the resistance R, which at first is all in circuit with A, is gradually transferred from A to F. The resistance of R is too small to affect appreciably the current in F, which necessarily consists of a comparatively large number of turns of fine wire. The arrangement is adopted to render the breaking of the shunt circuit unnecessary and is rendered clearer by the diagram fig. 496. It should be noted that E may be provided with a short circuiting key or push if required.

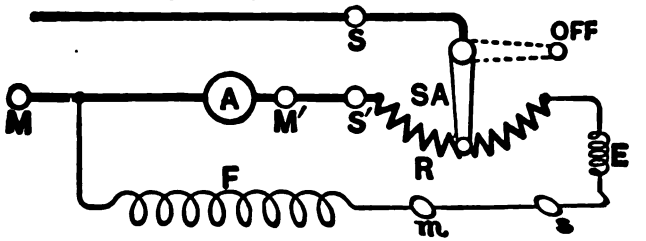


FIG. 496.—Simplified diagram of the connections of fig. 495.

Accordingly, to prevent injury to the winding, a variable resistance or starting box is inserted between one supply terminal and the armature so that the pressure may be applied gradually while the motor is coming up to speed.


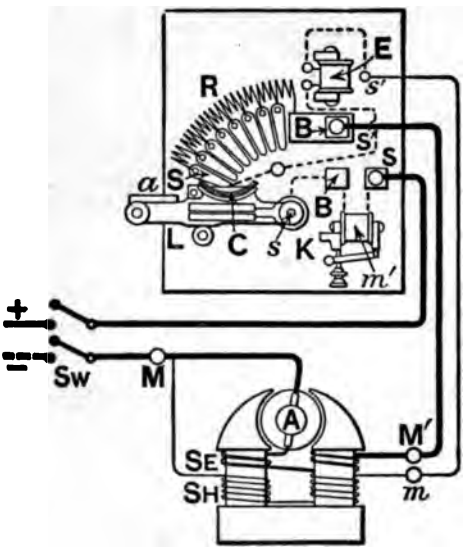


FIG. 497.—Starter with no voltage release and overload release connected to a compound motor. With a shunt motor, the only difference in the diagram would be that the series winding SE would be absent, and the armature A would then be connected straight across between the main terminals M and M'. When switch SW is closed, the current will enter the starter at its terminal S, and pass through the magnet coil *m'* of the overload release to the switch lever L, which is shown in the off position. As soon as L is moved up to make contact with the first contact S the current divides; part going through the resistance R and the terminals S' and M' to the series coil SE (if a compound motor) and armature A; and part through the no voltage magnet E to the shunt winding SH. As the lever L is moved up toward E, the effect is to take R out of the armature circuit and put it into the shunt circuit. When the iron armature *a*, fixed on the switch lever, comes against the poles of E, the laminated copper brush C bears against the blocks B, B, and so affords a better path for the current than through the spindle *s*. Should the supply voltage fail, either temporarily or permanently, E will release *a*, and L will fly off under the tension of a helical spring coiled round *s*. If there should be an overload on the motor, tending to pull it up and cause an excess of current to flow through the armature; this excess current, passing through *m'*, will make it attract its armature, so bringing two contacts together at K which *will short* circuit E, and allow the switch to fly off. The connections between E and *m'* *are not shown* in the figure, but they are indicated at C in fig. 498, which is a simplification *of fig. 497*, and which should be carefully compared therewith. When only the normal *current is flowing*, the attraction between *m'* and its armature is not sufficient to pull the *latter up*. The actual forms and arrangement of parts on the starters are well shown in *some of the figures.*

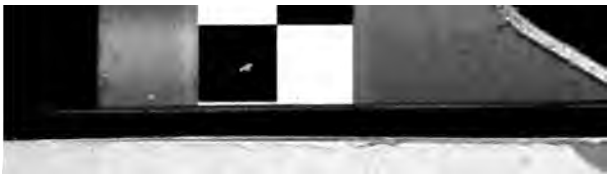

Ques. What attachments should be provided on a starting box?

Ans. An overload release, and a no voltage release.

Ques. Describe these devices.

Ans. The overload release is an electromagnetic circuit breaker that opens the circuit if the motor become greatly overloaded. A no voltage release may consist of an electromagnet in series with the shunt field circuit; it holds the rheostat arm

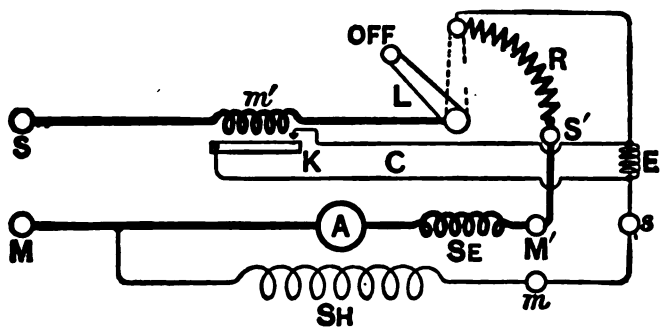


FIG. 498.—Simplified diagram of the connections of starter connected to compound motor as shown in fig. 497.

in the operating position as long as current flows through the shunt field from the line. If the line switch be opened or the shunt field circuit accidentally broken, the device becomes demagnetized and releases the arm, which returns to its starting position by the action of a spring.

The general arrangement of switches, cut outs and starting boxes should be in accordance with the requirements of the National Electrical Code as follows:

"*Each motor* and starting box must be protected by a cut out and *controlled by* a switch, said switch plainly indicating whether 'on' *'off.' The* switch and rheostat must be located within sight of

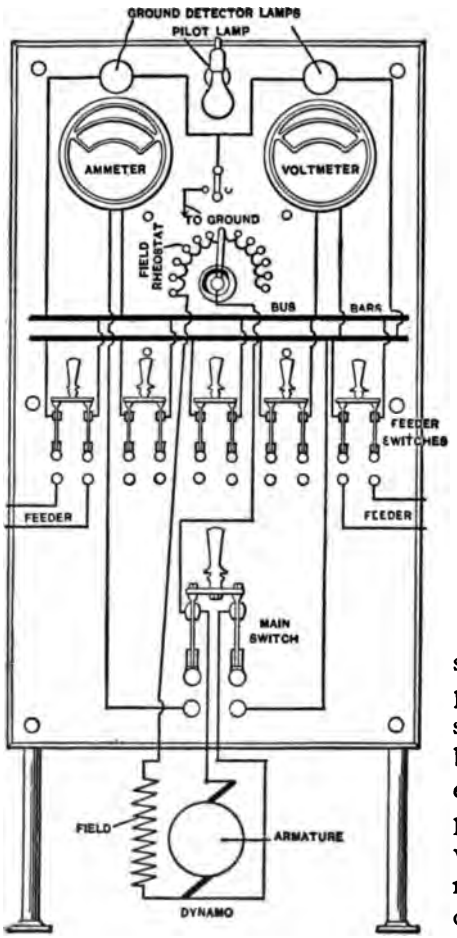


FIG. 490. View showing general arrangement of a switchboard. The wires are shown to illustrate the various connections, but in actual construction these wires are connected on the back of the switchboard.

motor, except in cases where special permission to locate them elsewhere is given, in writing by the inspection department having jurisdiction.

"Where the circuit breaking device on the motor starting rheostat discs disconnects all wires of the circuit, this switch may be omitted.

"Overload release devices on motor starting rheostats will not be considered to take the place of the cut out required if they be inoperative during the starting of the motor.

"The switch is necessary for entirely disconnecting the motor when not in use, and the cut out to protect the motor from excessive currents, or careless handling when starting. An automatic circuit breaker disconnecting all wires of the circuit, may, however, serve as both switch and cut out."

Switchboards.— A switchboard consists of a panel or series of panels of slate, marble, soapstone or brick tile erected in an electric plant for the purpose of mounting in a convenient group the instruments for controlling and distributing the current and safeguarding the system. Switchboards may be divided according to operation into two classes:

1. Direct control;
2. Remote control.

A direct control switchboard has all its apparatus mounted directly on the board and controlled by hand, while in the remote control type, the main current carrying parts are at some distance from the operating board, the control being effected by mechanical devices or by electric motors or solenoids. When the control system of a plant is very extensive, it sometimes occupies a separate building known as the *switch house.*

Ques. What may be said with respect to the material for switchboards?

Ans. In order to avoid danger of fire from short circuits, the panel should be made of some non-combustible material, such as marble, slate, glass plates or earthenware tiles. If slate be used, care should be taken to have it free from conducting veins, or it should be marbleized, that is, subjected to a treatment that will fill up the pores of the veins and thus prevent the absorbtion of moisture.

Wood is seldom used, except in cases where the switches, fuse blocks, wire supports, etc., are all mounted on porcelain or other incombustible material.

Ques. How should the instruments and connections be arranged on a switchboard?

Ans. They should be arranged so as to provide the shortest possible path for the current, and preferably always in the same direction, that is, from right to left or from top to bottom, the connecting wires being brought in on one side and out on the other, and the crossing of wires avoided as far as possible

All wires and current carrying parts should be kept far enough apart *at all points to* prevent accidental contact or the jumping across of the

current where there is a great difference of voltage. Such wires should be also kept at a sufficient distance from screw heads, metal brackets, gas pipes, water pipes, and other conducting bodies, in order to prevent accidental grounds or short circuits.

All instruments and switches should be placed so as to be conveniently accessible for observation and operation, and sufficiently out of reach of accidental contact by persons; otherwise they should be protected by some form of insulating shield.

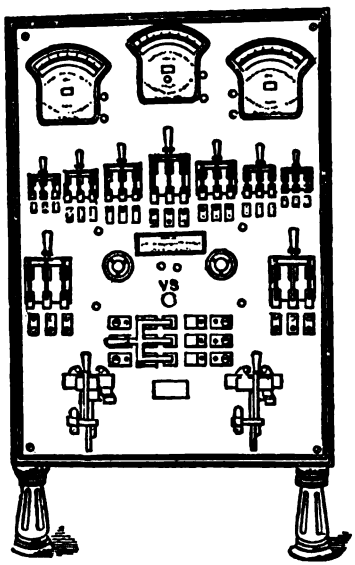


FIG. 500.—Small switchboard suitable for two dynamos; view showing ammeters and voltmeters, switches, circuit breakers, etc.

Ques. What type of switch is used on switchboards?

Ans. The "knife" switch.

Ques. Describe a small switchboard.

Ans. *Fig.* 500 shows one suitable for two dynamos. At the *top is a* voltmeter and two ammeters. Immediately below is a *row of* feeder switches serving to connect and disconnect the

various feeders with and from the bus bars which are mounted behind the board. Below are two rheostat handwheels, and two large switches connecting the dynamos with the bus bars. V S is a voltmeter switch connecting the voltmeter with various parts of the system. Below the voltmeter switch is a double throw

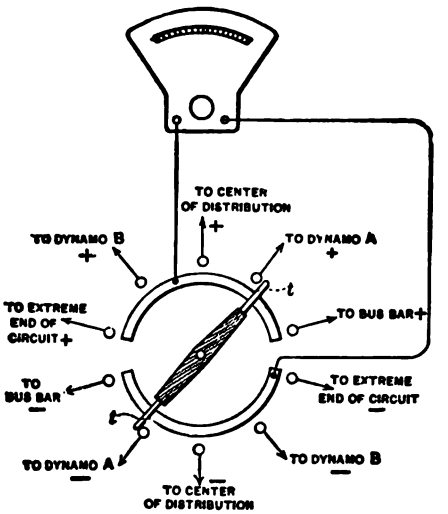


FIG. 501.—Diagram showing various connections of voltmeter switch of the small switchboard shown in fig. 500.

switch to transfer the bus bars from connection with the dynamo switches to one with some other source of current such as a street circuit, in the event of a breakdown. At the bottom are two circuit breakers.

Ques. Describe the voltmeter switch.

Ans. Fig. 501 shows the connections, from which it can be seen that the voltmeter can be connected with the terminals of *either dynamo* or with the bus bars, or with either a central or *remote part in the* lamp circuits.

Under ordinary conditions it remains connected to the circuit at the central point of distribution. When one dynamo is already in circuit, however, and it becomes necessary to connect up the other one, the voltage of the latter must be the same as that at the bus bars. Accordingly,

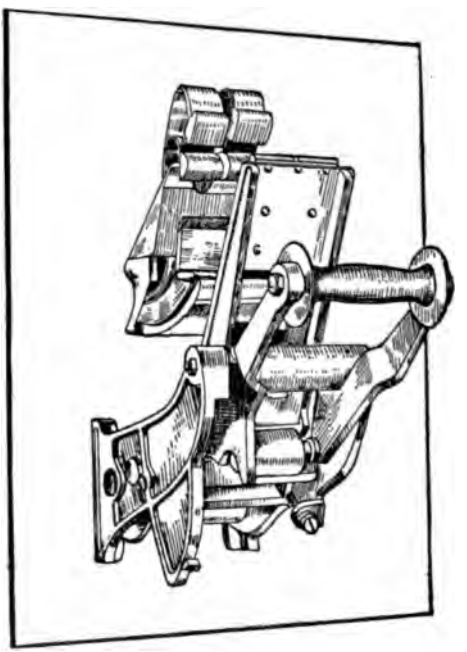


FIG. 502.—Roller-Smith, single pole, plain overload circuit breaker. As its name indicates, the function of the plain overload circuit breaker is to automatically interrupt the circuit in which it is placed when the flow of current through it exceeds the predetermined limit for which the apparatus is set. It is the most common of all of the types and is utilized for the protection of dynamos and motors and all other electrical apparatus which, by reason of the conditions of operation, may become subject to loads in excess of the normal. The single pole type may be used separately for the protection of a single wire of a given circuit or grouped to protect the two or more wires of one circuit, becoming in the latter case the so called independent arm multipole apparatus. The action of this type of circuit breaker is fully explained in fig. 491.

connections are provided to the voltmeter switch such that the attendant can compare the voltages at the dynamo terminals and bus bars before closing the dynamo switch. All the positive connections are on one side of the circle swept by the switch and all the negative connections on the o[illegible]ide.

HAWKINS PRACTICAL LIBRARY OF

ELECTRICITY

IN HANDY POCKET FORM **PRICE $1 EACH**

They are not only the best, but the cheapest work published on Electricity. Each number being complete in itself. Separate numbers sent postpaid to any address on receipt of price. They are guaranteed in every way or your money will be returned. Complete catalog of series will be mailed free on request.

ELECTRICAL GUIDE, NO. 1
Containing the principles of Elementary Electricity, Magnetism, Induction, Experiments, Dynamos, Electric Machinery.

ELECTRICAL GUIDE, NO. 2
The construction of Dynamos, Motors, Armatures, Armature Windings, Installing of Dynamos.

ELECTRICAL GUIDE, NO. 3
Electrical Instruments, Testing, Practical Management of Dynamos and Motors.

ELECTRICAL GUIDE, NO. 4
Distribution Systems, Wiring, Wiring Diagrams, Sign Flashers, Storage Batteries.

ELECTRICAL GUIDE, NO. 5
Principles of Alternating Currents and Alternators.

ELECTRICAL GUIDE, NO. 6
Alternating Current Motors, Transformers, Converters, Rectifiers.


ELECTRICAL GUIDE, NO. 7
Alternating Current Systems, Circuit Breakers, Measuring Instruments.

ELECTRICAL GUIDE, NO. 8
Alternating Current Switch Boards, Wiring, Power Stations, Installation and Operation.

ELECTRICAL GUIDE, NO. 9
Telephone, Telegraph, Wireless, Bells, Lighting, Railways.

ELECTRICAL GUIDE, NO. 10
Modern Practical Applications of Electricity and Ready Reference Index of the 10 Numbers.

Theo. Audel & Co., Publish

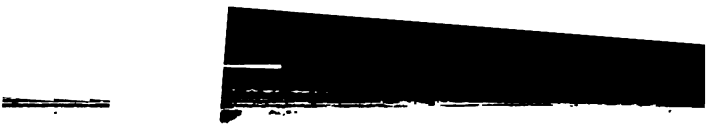











MAR 2 9 1945

